



**S-Series™**  
BACKED BY MCNEILUS

## SAFETY NOTICE

**VSR-TSB-029**

NHTSA Campaign Number: 20E-070

# Vehicle Safety Recall - Technical Service Bulletin

## ***PROMPT ACTION REQUIRED***

**Attention:** Oshkosh Product Owner  
**Subject:** Bendix Pressure Switch  
**Models Affected:** Oshkosh S-Series Front Discharge Mixer  
**Model Year:** 2020  
**Date:** September 2020

### **Purpose:**

A concern affecting safety exists in some Oshkosh S-Series Front Discharge Mixers. Trucks have been identified that are equipped with Bendix pressure switches with damaged plastic housing threads. If the switch(es) fail an air leak will develop ranging from a small leak to a larger leak causing a loss of pressure in the vehicle air system. Loss of pressure in the vehicle air system will result in diminished braking of the vehicle or automatic engagement of the parking brakes. Failure of both switches will result in a loss of brake light functionality. This bulletin describes how to inspect and replace affected pressure switches.

**Important:** Do not run or use the vehicle if the pressure switches are faulty. Contact S-Series Service Support at 888-686-7278 immediately.

### **Affected Vehicles:**

The affected vehicle population is Oshkosh S-Series Front Discharge Mixers produced in 2020. Please refer to the attached VIN list of affected vehicles.

### **Time Completion:**

Complete the enclosed procedure for each affected truck. The time of accomplishment may vary due to a number of factors; however, the estimated time for inspection is 30 minutes, and the estimated time for replacement is 30 minutes under normal circumstances.

### **Required Action:**

Review and verify your ownership of all affected serial numbers of Oshkosh vehicles. Oshkosh records indicate that you are the owner of one or more affected trucks, a Serial Number List is enclosed. **Please be reminded that it is a violation of Federal law for you to sell or lease the vehicles covered by this notification until this recall has been performed on these vehicles. Substantial civil penalties apply to violations of this law.**

### **Reimbursement of Costs:**

Affected trucks shall be inspected using the customer's own qualified service technicians - at no cost to the owner. The inspection should take approximately 30 minutes. The replacement of affect switch(es) should take approximately 30 minutes.

### **Parts/Labor Reimbursement:**

In order to receive credit, claims are to be submitted through the normal warranty claim system. Claims must be received within 30 days of the repair. Claims must include the Oshkosh VIN of the vehicle, the customer asset number, and the number of this bulletin.

### Contacts:

If you have questions or need further information, please contact S-Series Service Support at 888-686-7278

### Enclosures:

Procedure

### Parts Required:

Item	Part Number	Description	Qty.
1	4133101	SWITCH, PRESS, SPST, BKL	2

#### **⚠ WARNING**

For trucks without a battery disconnect switch, to prevent accidental vehicle start-up, which could cause death or serious injury, disconnect battery cables (negative cable first) before proceeding.

Disconnect negative (-) battery cable first. If positive (+) cable should contact ground with negative (-) cable connected, the resulting sparks can cause a battery explosion, which could result in death or serious injury.

#### **SAFETY NOTICE**

Perform your company's Lockout/Tagout procedure. If your company does not have a Lockout/Tagout procedure, follow OSHA 1910.147 and 1910.146 Confined Space as appropriate.

#### **SAFETY NOTICE**

Use appropriate Personal Protective Equipment (PPE) as required by your company.

## **PROCEDURE: Bendix Pressure Switch Inspection and Replacement**

### ***Preparation and Inspection***

**Important:** Do not run or use the vehicle if a Bendix pressure switch is defective. Contact S-Series Service Support at 888-686-7278 immediately.

1. Park vehicle on flat, level surface. Perform your company's Lockout/Tagout procedure. If your company does not have a Lockout/Tagout procedure, follow OSHA 1910.147 and 1910.146 Confined Space as appropriate. Chock wheels.
2. Battery Disconnect Switch

The vehicle's BATTERY DISCONNECT switch is located on the left-hand side of the battery box. Use the battery disconnect switch when performing any maintenance so the vehicle cannot accidentally be started.

- a. Turn the battery disconnect switch (Figure A, Item 1) counterclockwise so the hole on the switch aligns with the hole in the bracket (Figure A, Item 2).
- b. Install the safety lockout device ring (Figure B, Item 1) through the holes on the battery disconnect switch and the bracket.
- c. Install a padlock (Figure B, Item 2) onto the safety lockout device ring, lock it, and put the key in your pocket. If more than one person is working on the vehicle, each person must install his or her own padlock.

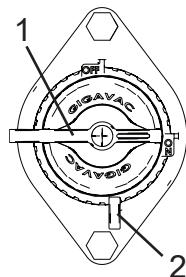


Figure A

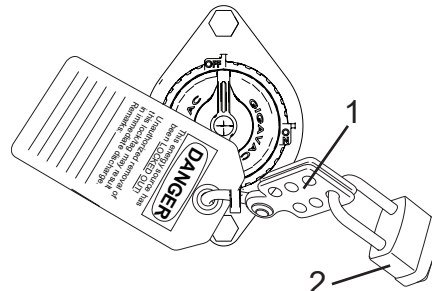


Figure B

3. Locate the two Bendix pressure switches installed on the brake treadle valve, see Figure 1.
4. Check the pressure switch lot number date code label. Suspect lots include 12/19 and 01/20. See Figure 1.

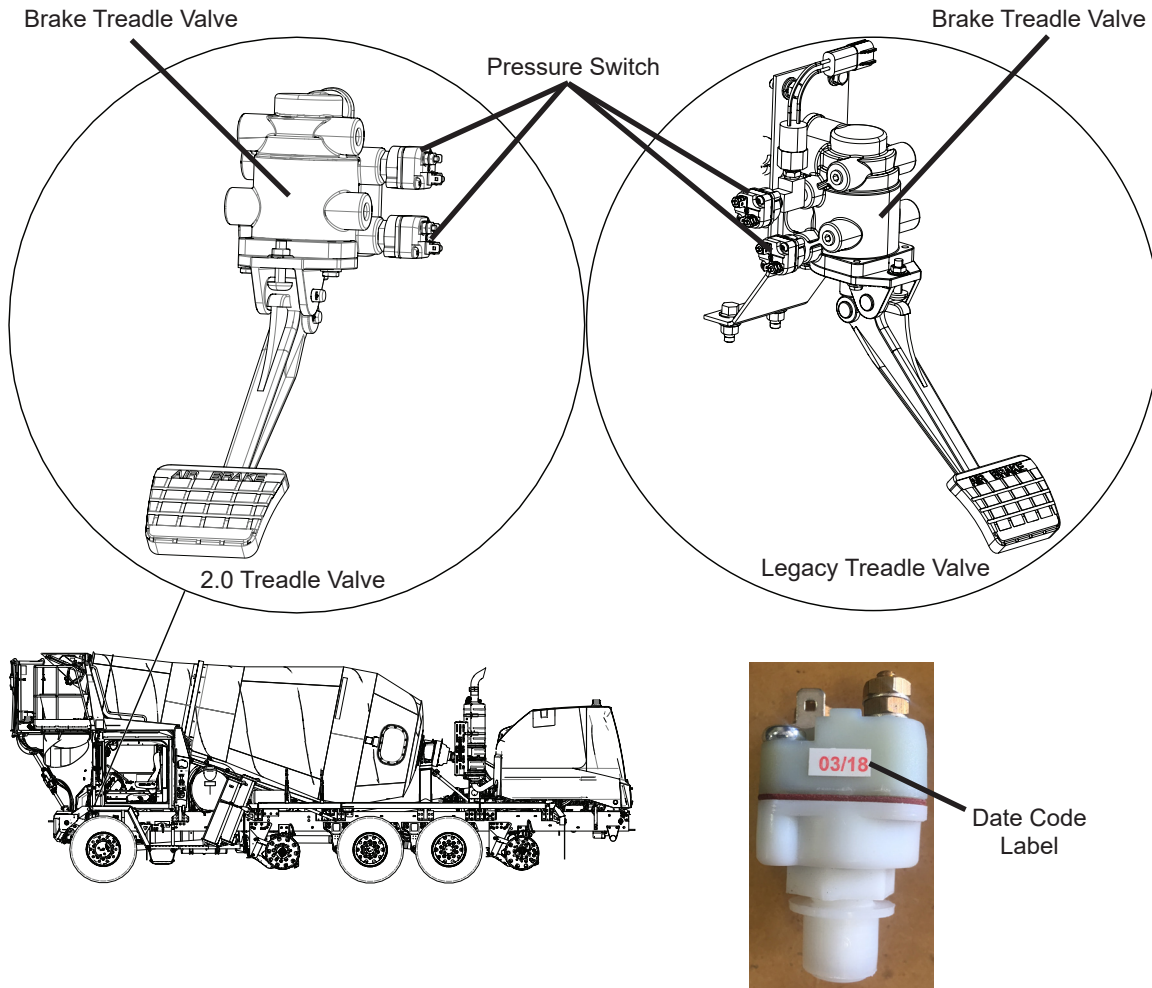


Figure 1. Brake Treadle Valve

### Inspection Results and Actions

- A. If either of the pressure switches lot number date code label does not include 12/19 or 01/20 this procedure is complete and no further action is required. Remove your company's Lockout/Tagout procedure. If your company does not have a Lockout/Tagout procedure, follow OSHA 1910.147 and 1910.146 Confined Space as appropriate. Remove the wheel chocks. Return the vehicle to service.
- B. If either of the pressure switches lot number date code label includes 12/19 or 01/20 or the date code label is missing **Do not run or use the vehicle**, maintain your company's Lockout/Tagout on the vehicle, and replace the pressure switch(es) per the replacement procedure.

### Replacement

1. Disconnect harness connections from the pressure switch.
2. Loosen and remove the pressure switch from the brake treadle valve.
3. Apply Loctite® 567 sealant to the threads of new pressure switch.
4. Install pressure switch in brake treadle valve. Final tighten pressure switch hand tight plus 2-3 turns.
5. Reconnect harness connections to pressure switch.

**Continuous Improvement:**

The change included in this document is part of the McNeilus Continuous Improvement Process.

*McNeilus's quality policy is providing customer satisfaction through innovative products, dedicated service, and a constant focus on continuous improvement.*



**(888) 686-7278**

**[www.streetsmartparts.com](http://www.streetsmartparts.com)**