

Service Bulletin

20-122

December 11, 2020 Version 1

Safety Recall: 2002-06 CR-V Driver's Power Window Switch (Only VINs that start with SHS)

IMPORTANT: Confirm the vehicle's VIN starts with SHS before proceeding with this service bulletin. This bulletin only applies to 2002–06 CR-Vs with VINs that start with SHS. Refer to Service Bulletin 11-057 for 2006 CR-Vs with VINs starting with JHL.

AFFECTED VEHICLES

Year	Model	Trim Level	VIN Range
2002-06	CR-V	ALL	Check the iN VIN status for eligibility.

BACKGROUND

Under severe conditions, water or other liquid may enter the driver's window and reach the power window master switch on the door panel. Liquid in the switch can damage the switch's printed circuit board (PCB), causing the switch to fail. In rare cases, the damaged PCB creates a short circuit that overheats the switch connectors and melts them, leading to a possible fire.

All affected vehicles, even those previously repaired under S/B 12-067, must have the driver's power window switch replaced under the current recall.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the customer or anyone else harmed as a result of such failure. To see if a vehicle in inventory is affected by this safety recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Remove the driver's power window master switch and inspect the driver's door wire harness connector. Based on your inspection, do one of the following:

- REPAIR PROCEDURE A: Replace the driver's power window master switch.
- REPAIR PROCEDURE B: Replace the driver's power window master switch and the driver's door wire harness.

NOTE

REPAIR PROCEDURE B is rare; the replacement rate is about 1 percent.

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

PARTS INFORMATION

Part Name	Part Number	Quantity
Switch Assy., Power Window Master	06357-S9A-509	1

TOOL INFORMATION

Tool Name	Part Number	Quantity
KTC Trim Tool Set	SOJATP2014	1

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7441C8	REPAIR PROCEDURE A	0.2 hr.	6WW00	P9D00	A20122A	35750-S9A-C05ZA
	Replace the power window master switch.					
7441D0	REPAIR PROCEDURE B	0.8 hr.	6WW00	P9D00	A20122B	35750-S9A-C05ZA
	Replace the power window master switch and switch harness.					

Skill Level: Repair Technician

INSPECTION PROCEDURE

- 1. Make sure the window is closed completely.
- 2. Using the appropriate trim tool, start prying at the rear of the driver's switch panel and work forward to release the hooks.





Start prying at the rear and work forward.


- 3. Disconnect the two connectors from the driver's power window master switch. Inspect the 20-pin power window master switch connector for any damage.
 - If no damage is found on the harness connector, go to REPAIR PROCEDURE A on page 4.
 - If there is damage found on the harness connector, go to REPAIR PROCEDURE B on page 5.





REPAIR PROCEDURE A


1. Remove the three screws that attach the switch to the switch panel. Using the three screws removed, install the new switch to the switch panel.

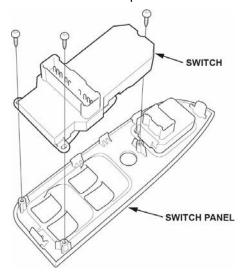


- 2. Reconnect the connectors.
- 3. Reinstall the driver's switch panel into the door panel.
- 4. Reset the power window control unit:
 - Turn the ignition switch to ON.
 - Move the driver's window all the way down by holding the driver's window switch firmly down; when the window reaches the bottom, hold the driver's window switch down for 2 seconds.
 - Move the driver's window all the way up by holding the driver's window switch firmly up; when the window reaches the top, hold the switch firmly up for 2 seconds.
 - If the window does not work in AUTO, turn the ignition switch to LOCK and repeat step 4.

REPAIR PROCEDURE B


1. Make sure the window is up, then using the appropriate trim tool, pry out the upper portion of the cover to release the hooks, then remove the cover.

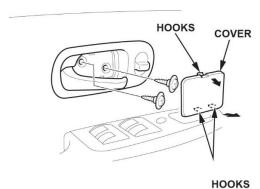


- Remove the screws.
- 3. Release the power door lock switch bracket from the door panel by pulling the inner handle rearward and out halfway.

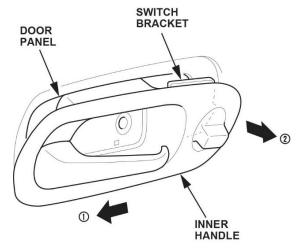


Disconnect the power door lock switch connector. Disconnect the inner handle rod, and remove the inner handle.

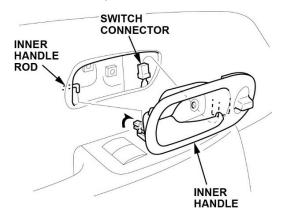


5. Remove the screws from under the armrest.

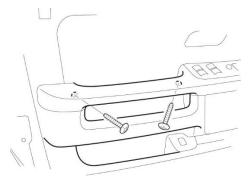


6. Carefully pry out the mirror mount cover by hand in the sequence shown.

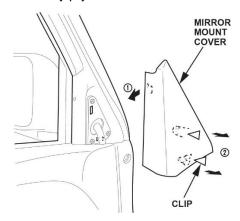


7. Remove the door panel by removing the clip. Then with the appropriate trim tool, pry up to release the clips that hold the door panel. Starting at the rear, pull the door panel upwards and release the lock knob.

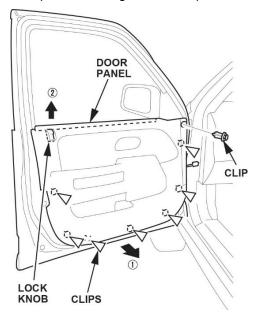

8. Disconnect all driver's door harness connectors and replace the harness.

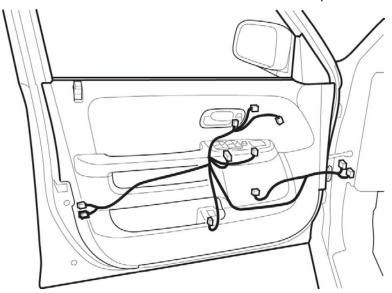

- 9. Install all removed parts in reverse order.
- 10. Remove the three screws that attach the switch to the switch panel. Using the three screws removed, install the new switch to the switch panel.

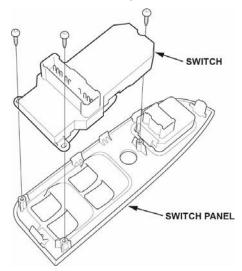

- 11. Reconnect the connectors.
- 12. Reset the power window control unit:
 - Turn the ignition switch to ON.
 - Move the driver's window all the way down by holding the driver's window switch firmly down; when the window reaches the bottom, hold the driver's window switch down for 2 seconds.
 - Move the driver's window all the way up by holding the driver's window switch firmly up; when the window reaches the top, hold the switch firmly up for 2 seconds.
 - If the window does not work in AUTO, turn the ignition switch to LOCK and repeat step 12.

END