

To All Lamborghini Dealers and Licensed Service Point.

From Customer Service Department.

Subject Headlight Adjuster Accessibility Enhancement.

Group 9.81.00 Date 14/12/2012

Pages 10

## **Subject**

Headlight adjuster accessibility enhancement.

#### Model

Lamborghini Aventador US version LP-700 My 2012 from Vin CLA00091 to CLA00793

<u>Warning:</u> some vehicles included in this VIN range may not be affected, so check carefully on the Lamborghini WEB Portal ( at the section named VIN Info) if the cars in your workshop or in your eventual stock are effectively affected before performing any other operation.

### Information to the field

As a continuous product monitoring, Automobili Lamborghini Spa has found that on some US vehicles the accessibility to the headlight beam adjuster may result in difficulty.

#### **Field solution**

Update headlights.

### **Spare Parts**

P/N	Description		Q
0R8340027	Headlight bracket kit:		1
	Cable tie	2	
	Right brackets	1	
	Left brackets	1	
	M4X12 screws	6	



## Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code: L834-R.01.12

Campaign Description: Headlight adjuster accessibility enhancement

Cost Code: 60

Component Code: CCR0112

Trouble Code: 220

Labour Code: CCR0112100

Labour Time: 2 h

Fill out the Service and Recall Campaign section in the warranty booklet, which is shown in the figure below.

Servicio Liam	ilamo/Rückruf HI/Roppel nada a Taller	Service/Service Richiamo/Rückruf Service/Service Recall/Rappel
Numero/Nummer Number/Numero Numero	loud di Idiret	Servicio Liamada à Taller  Numero/Nummer Number/Numéro
Data/Datum/Date/Date/Fecha	Thurn VV	Data/Datun/Date/Date/Fecha
Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación	YYOR YY	Date rickerations/Reparaturisatum Reciair Data/Date de réparation Féchs reparación
Eseguito dal Concessionario / Ausgeführt von der Ve Effectué par le concessionnaire / Efectuado por el Co Firma / Unterschrift / Sign	oncesionario	Eseguito dal Concessionario / Ausserlührt von der Vertragsverristatt / Done by the Dealer Effective par le concessioninarie / Efectuado por el Concesionario Firma / Uniterschrift / Signature / Signature / Firma.
Service/Service Richie Service/Service Recal	amo/Rückruf il/Rappel ada a Taller	Service/Service Richamo/filicitrul Service/Service Llamata haller
Numero/Nummer		Numero/Numero Number (Numero Number (Numero
Number/Numéro Número		
Number/Muméro Número  Deta/Datum/Date/Date/Fecha	The state of the s	Data/Datum/Date/Date/Fecha

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.





# Insrtructiopn

1 **WARNING!** Wait until the braking system is completely cool down. 2 Place car properly on a suitable lift before jacking in order to work safe from risks. Disassenble both front wheels 3 (060103).Disassenble wheel house panels (081003).




5 Disassenble on both side headlight brackects (094103).

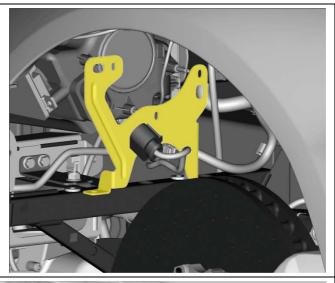

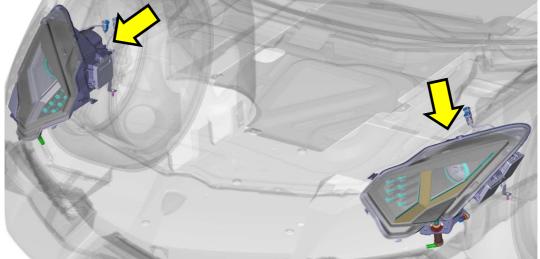

Locate the working area.




7





Remove the three screws that secure horizontal adjuster plate.

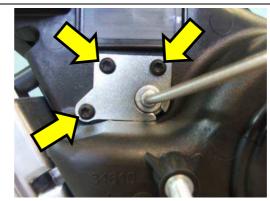


Remove cable tie.


9



Cable tie clip can be left on headlight.

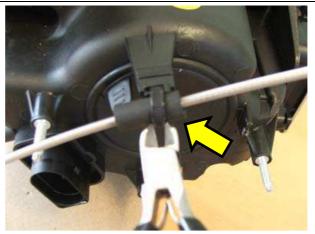

STEP2: exchange position of two adjusting inhibitors, horizontal and vertical beam.

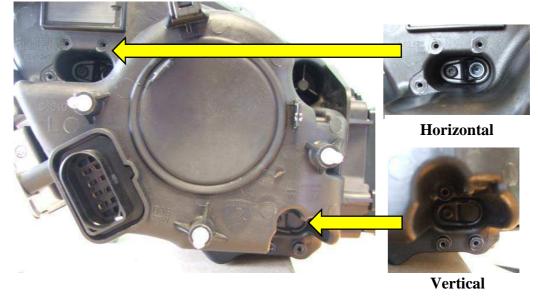

10



Remove two inhibitors unscrewing fixing elements.

Swap position and secure by the screws formerly removed

# Horizontal adjustment

Before After





# Vertical adjustment

Before

After









Holed inhibitor has to be fitted in the inner side of headlight lower part (vertical adjustment).







Holed inhibitor

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



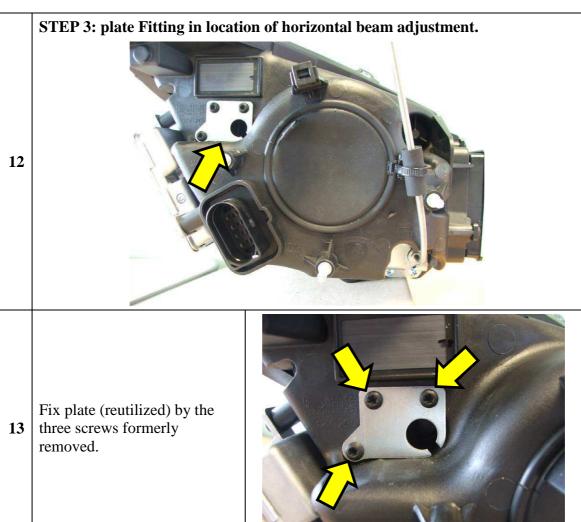



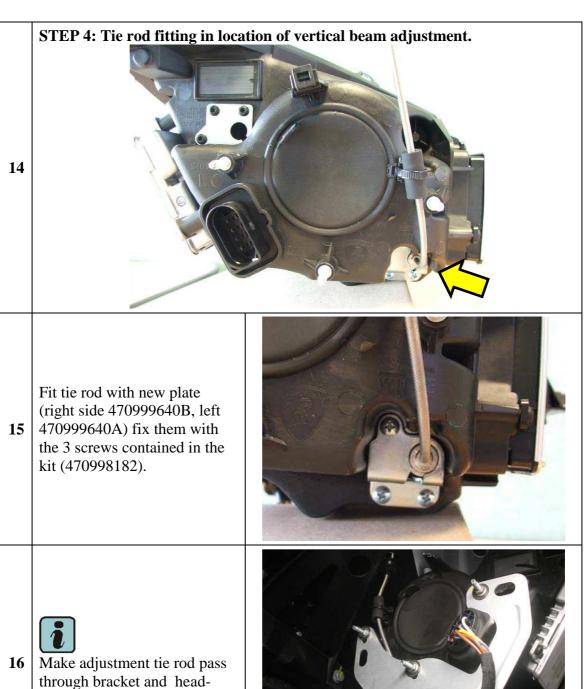

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

light.



17	Fit cable tie (470998225).		
18	Fasten tie rod with cable tie.		
19	Check that adjuster screws are alligned with adjustment hole in trunk.		
20	Perform operation on both vehic	ele sides.	
21	Fit headlight brackets (094105)		
22	Fit wheel house panels (081005).		



23	Fit front wheels ( <b>060105</b> ).
24	Lower vehicle from lift (000000)

Your Area Manager is at you full disposal for further information.

Best regards

After Sales Department