



Bulletin No.: 14815B
Date: March 2015

Program Bulletin

CUSTOMER SATISFACTION PROGRAM

SUBJECT: Heated Back Window Glass Structurally Weakened Due To Surface Flaw

MODELS: 2015 Chevrolet Silverado
2015 GMC Sierra
Equipped with RPO C49 Electric Rear Window Defogger

The Warranty Transaction Information section has been revised. Please discard all copies of bulletin 14815A.

CONDITION

Certain Light Duty 2015 Silverado and Sierra vehicles built with RPO C49 fixed-window (not sliding), heated back glass might have a structurally weakened glass due to an internal flaw (spall). In this condition, the back glass could shatter when the door is closed or during normal vehicle operation.

CORRECTION

Dealers are to replace the rear window.

VEHICLES INVOLVED

All involved vehicles are identified by Vehicle Identification Number on the Investigate Vehicle History screen in GM Global Warranty Management system. Dealership service personnel should always check this site to confirm vehicle involvement prior to beginning any required inspections and/or repairs. It is important to routinely use this tool to verify eligibility because not all similar vehicles may be involved regardless of description or option content.

For dealers with involved vehicles, a listing with involved vehicles containing the complete vehicle identification number, customer name, and address information has been prepared and will be provided to US and Canadian dealers through the GM GlobalConnect Recall Reports, or sent directly to export dealers. Dealers will not have a report available if they have no involved vehicles currently assigned.

The listing may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than follow-up necessary to complete this program is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this report to the follow-up necessary to complete this program.


PART INFORMATION

Parts required to complete this program are to be obtained from General Motors Customer Care and Aftersales (GMCC&A). Please refer to your “involved vehicles listing” before ordering parts. Normal orders should be placed on a DRO = Daily Replenishment Order. In an emergency situation, parts should be ordered on a CSO = Customer Special Order.

NOTE: The service parts listed below are in limited supply until March 09, 2015. DO NOT ORDER for inventory before this date.

Part Number	Description	Quantity/Vehicle
23216681	Rear Window Glass Privacy Tint - RPO AKO	1
23216683	Rear Window Glass Solar Tint - RPO AKP	1
Obtain Locally	Urethane Adhesive Kit (Use a urethane adhesive system that meets GM Specification GM 3651G)	1

SERVICE PROCEDURE

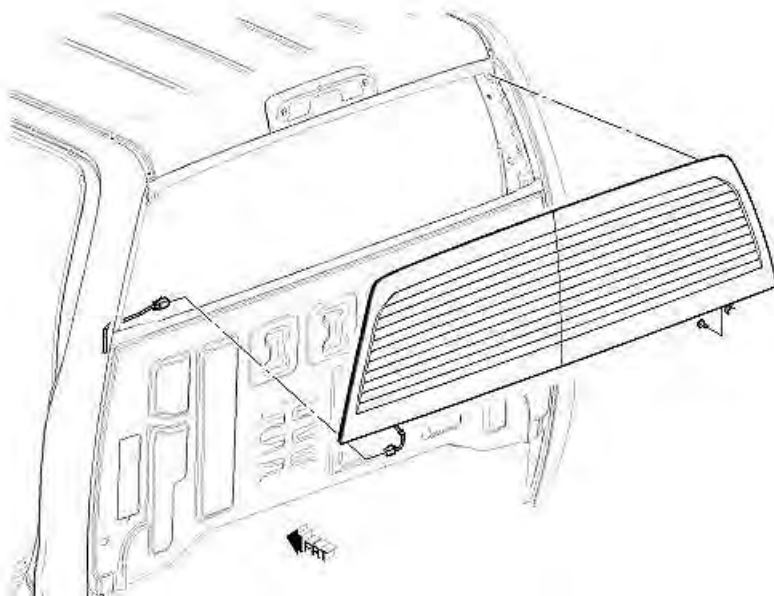

4052351

Replace fixed rear window glass. Refer to *Rear Window Replacement* in SI.

WARRANTY TRANSACTION INFORMATION

Submit a transaction using the table below. All transactions should be submitted as a ZFAT transaction type, unless noted otherwise.

Labor Code	Description	Labor Time	Net Item
** 9101294	Rear Window Replacement		*
	Regular Cab	1.6	
	Extended/Crew Cab	1.4	

*The amount identified in "Net Item" should represent the actual sum total of the locally sourced Urethane Adhesive Kit needed to perform the required repairs, not to exceed \$40.00 USD, \$49.80 CAD.

** This labor code has a revised labor time based on a current time study. The Labor Time Guide in SI will be updated to reflect this change May 1, 2015.

CUSTOMER NOTIFICATION – For US and Canada

General Motors will notify customers of this program on their vehicle (see copy of customer letter included with this bulletin).

CUSTOMER NOTIFICATION – For Export

Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached sample letter.

DEALER PROGRAM RESPONSIBILITY

All unsold new vehicles in dealers' possession and subject to this program must be held and inspected/repaired per the service procedure of this program bulletin before customers take possession of these vehicles.

Dealers are to service all vehicles subject to this program at no charge to customers, regardless of mileage, age of vehicle, or ownership, from this time forward.

Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the involved vehicle listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. A copy of the customer letter is provided in this bulletin for your use in contacting customers. Program follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this program enters your vehicle inventory, or is in your facility for service in the future, you must take the steps necessary to be sure the program correction has been made before selling or releasing the vehicle.

March 2015

This notice applies to your vehicle, **VIN:** _____

Dear General Motors Customer:

We have learned that your 2015 model year Chevrolet Silverado or GMC Sierra may have been built with a heated back window that might have a structurally weakened glass due to an internal flaw (spall). In this condition, the back glass could shatter when the door is closed or during normal vehicle operation.

Your satisfaction with your Chevrolet Silverado or GMC Sierra is very important to us, so we are announcing a program to correct this condition.

What We Will Do: Your GM dealer will replace the rear window. This service will be performed for you at **no charge**.

What You Should Do: To limit any possible inconvenience, we recommend that you contact your dealer as soon as possible to schedule an appointment for this repair. By scheduling an appointment, your dealer can ensure that the necessary parts will be available on your scheduled appointment date.

If you have any questions or concerns that your dealer is unable to resolve, please contact the appropriate Customer Assistance Center at the number listed below.

Division	Number	Text Telephones (TTY)
Chevrolet	1-800-222-1020	1-800-833-2438
GMC	1-800-462-8782	1-888-889-2438
Guam	65-6267-1752	
Puerto Rico – English	1-800-496-9992	
Puerto Rico – Español	1-800-496-9993	
Virgin Islands	1-800-496-9994	

We sincerely regret any inconvenience or concern that this situation may cause you. We want you to know that we will do our best, throughout your ownership experience, to ensure that your GM vehicle provides you many miles of enjoyable driving.

Alicia S. Boler-Davis
Sr. Vice President
Global Connected Customer Experience

14815B