

May 9, 2015

01825 Version 1

Roof Rack Rattles

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2011–15	Odyssey	ALL	ALL

SYMPTOM

There is a rattle coming from the roof rack area.

POSSIBLE CAUSES

There is too much clearance in the roof rack cross bar.

CORRECTIVE ACTION

Apply anti-rattle tape to the right side of each roof rack cross bar.

PARTS INFORMATION

Part Name	Part Number	Quantity
Anti-Rattle Tape Kit (kit repairs one vehicle)	08L04-TZ5-20020	1

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
0160A0	Apply anti-rattle tape to the right side of each roof rack cross bar.	0.7 hrs	15-032A	08L04-TK8-10001

Defect Code: 06201


Symptom Code: 04209

Skill Level: Repair Technician


CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE


1. Remove the rear cross bar (4 bolts).

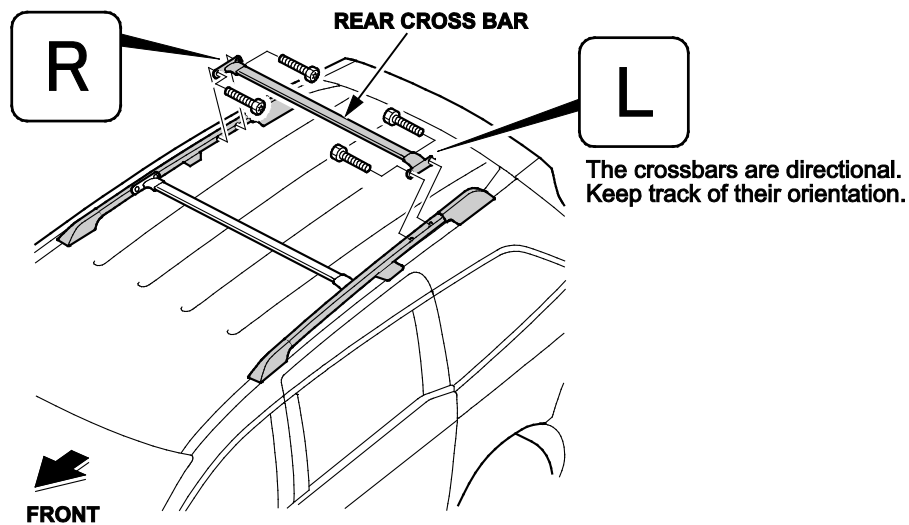

2. Remove the front cross bar (4 bolts).

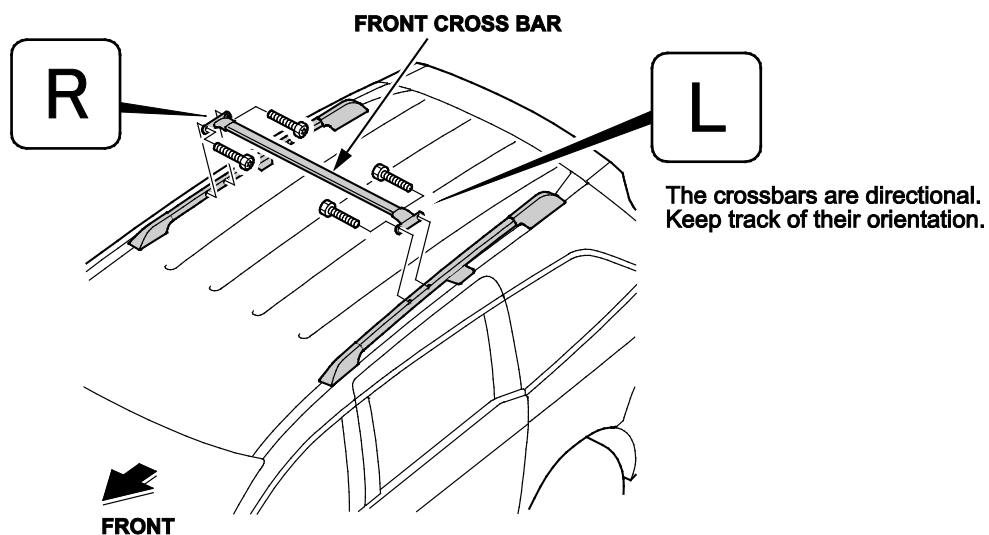

3. On the rear cross bar, remove the 2 torx bolts from the right cross bar end. Then, remove the cross bar end.

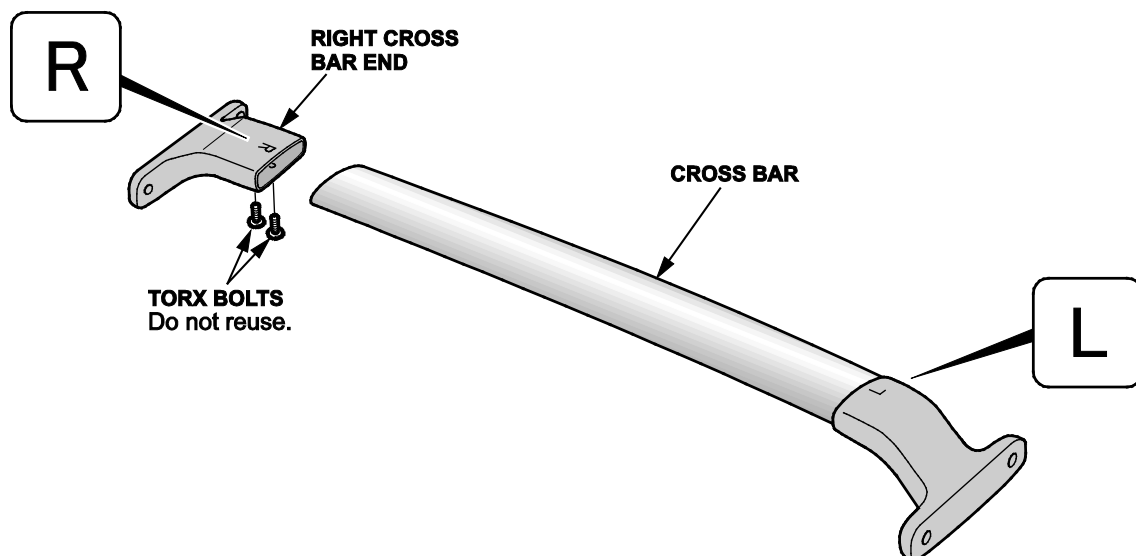

4. Apply 1 square of anti-rattle tape to the end of the right cross bar, as shown.

Leave the top
adhesive backing on.


Remove the bottom
adhesive backing.

ANTI-RATTLE TAPE


Install between
the support beams.

Install to the
edge of the bar.

5. Reinstall the cross bar end and torque the new Torx bolts to 4-5 N·m (2.9-3.6 lb-ft).

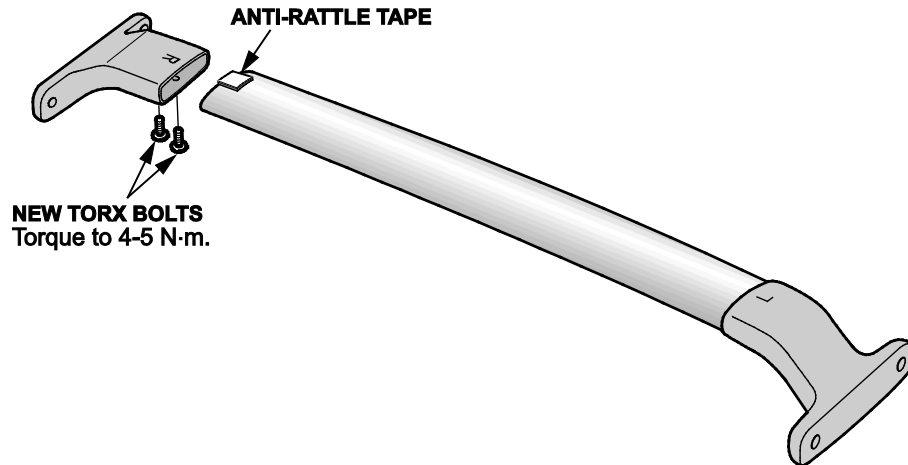

6. Repeat steps 3 thru 5 on the front cross bar.
7. Install the cross bars and torque the bolts to 10 N·m (7.3 lb-ft).

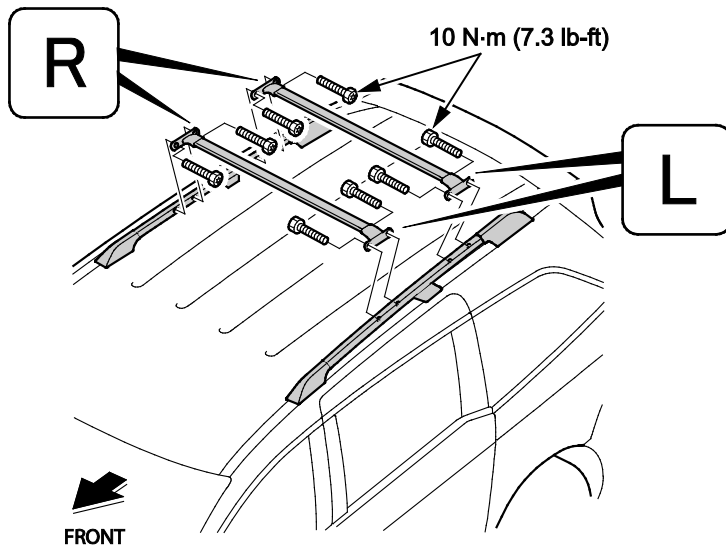

END