



## Preliminary Information

### PIT5291E Wind Whistle Noise at Highway Speeds from Left or Right Rear Quarter Glass Area

#### Models

| Brand:    | Model:       | Model Years: | VIN: |     | Engine: | Transmissions: |
|-----------|--------------|--------------|------|-----|---------|----------------|
|           |              |              | from | to  |         |                |
| Chevrolet | Suburban     | 2015 - 2019  | All  | All | All     | All            |
| Chevrolet | Tahoe        | 2015 - 2019  | All  | All | All     | All            |
| GMC       | Yukon Models | 2015 - 2019  | All  | All | All     | All            |

#### Supersession Statement

This PI was superseded to add 2019 Model Year. Please discard PIT5291D.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition / Concern

**Some owners may comment when driving at highway speeds (60mph and up) there is a wind whistle noise heard from the right or left rear quarter glass area. This noise may be more noticeable with a cross wind. This concern could be caused by either of the following:**


**1. The fit between the exterior "D" pillar trim and the rear quarter glass in the area shown below.**



**Excessive urethane from the quarter glass installation may not allow the exterior "D" pillar trim to fit properly against the rear quarter glass, as shown below.**



2. The gap between the rear tail light assembly and the quarter panel, as shown below.

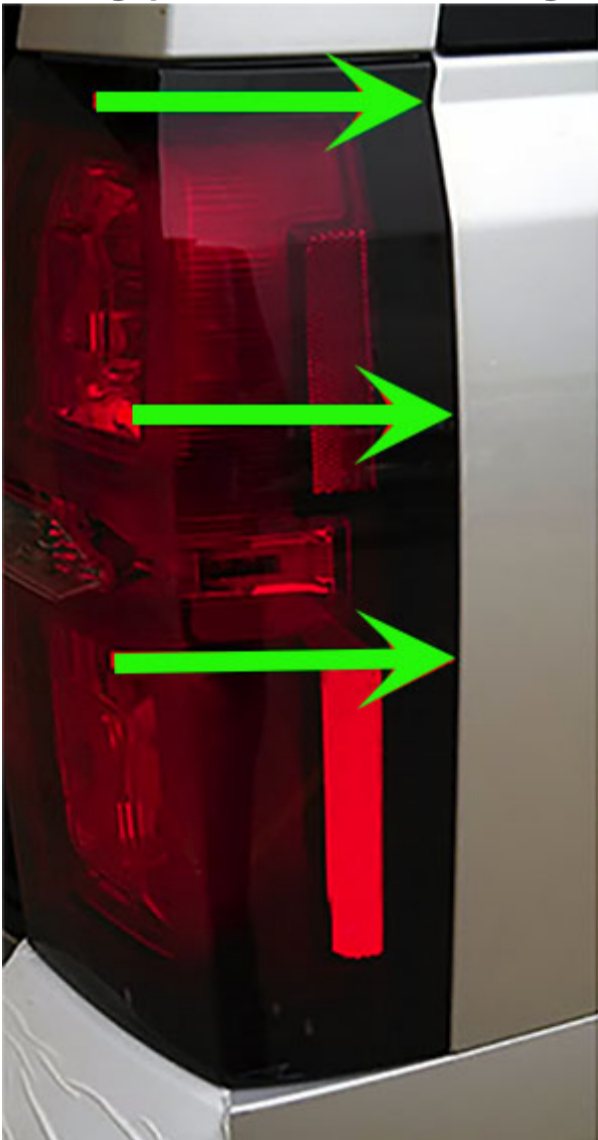


#### Recommendations / Instructions

1. Use a sharp knife and cut off the excessive urethane, as shown below. In most cases the urethane will need to be cut sub-flush to the sheet metal. This will allow the exterior "D" pillar trim to fit correctly against the rear quarter glass.



**2. Install a 5mm X 5mm (3/16 X 3/16) piece of closed cell foam tape along the entire length of the tail light assembly, as shown below.**

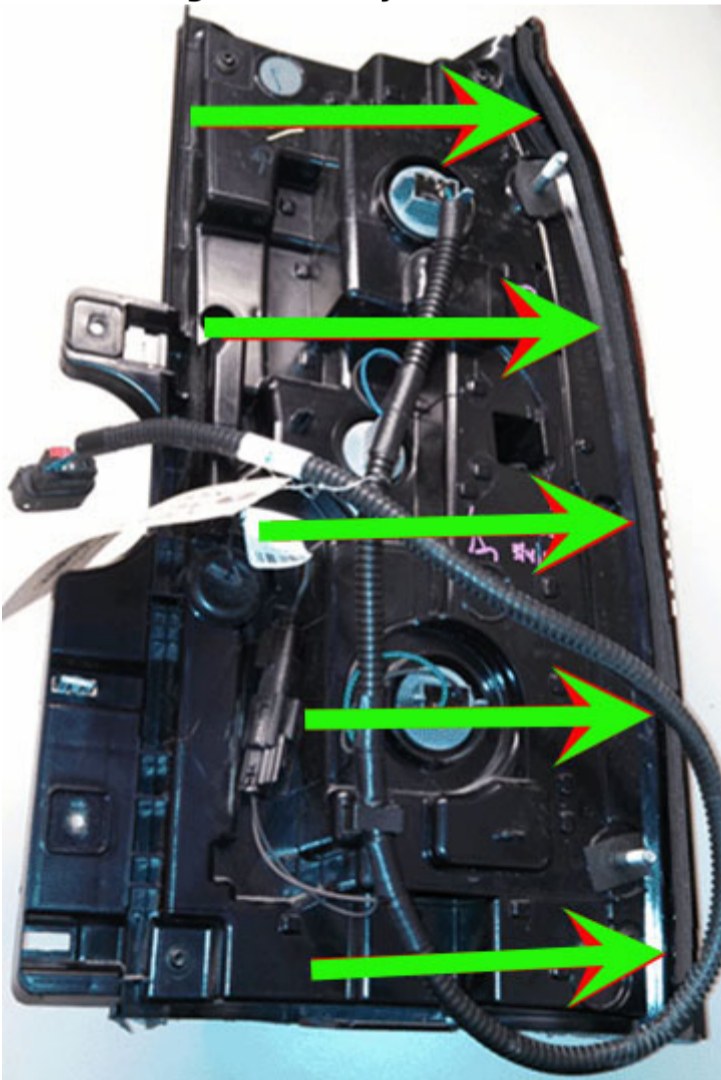

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage

information.

| <b>Labor Operation</b> | <b>Description</b>  | <b>Labor Time</b>                         |
|------------------------|---|---|
| <b>1016250</b>         | <b>Back Body Opening Side Molding Replacement (Condition 1)</b> | <b>Use Published Labor Operation Time</b> |
| <b>Labor Operation</b> | <b>Description</b>  | <b>Labor Time</b>                         |
| <b>2041150</b>         | <b>Rear Body Structure Stop Lamp Replacement (Condition 2)</b>  | <b>Use Published Labor Operation Time</b> |

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



© 2019 General Motors. All Rights Reserved.