

Parktronic Sensor Holders Missing from Rear Bumper Cover, Lower Section, With SA Code 773

Topic number	LI88.20-P-080034
Version	1
Function group	88.20 - Bumpers
Date	5/7/26
Validity	Model series 192 with SA code 773
Reason for change	

Complaint

Replacement rear lower carbon bumper cover is delivered without Parktronic (PTS) sensor holders.

This is observed during part replacement when the bumper is received without holders included.

Applicable Bumper Part Numbers (SA 773):

- A1928854401
- A1928855601

Attachments	
File	Description
PTS-Halter fehlen.png	Complaint: PTS holders are missing from the purchase order and delivery



Cause

There is no underlying defect → See Remedy

Remedy

When replacing the rear lower carbon bumper cover, the PTS sensor holders must be ordered separately.

Required Additional Parts:

- A1928883700 PTS holder, left
- A1928883800 PTS holder, right

If the item numbers cannot be ordered regularly via Paragon, please open a TIPS case to the Body/Chassis/Entertainment inbox and provide the following information:

- recipient address
- contact person

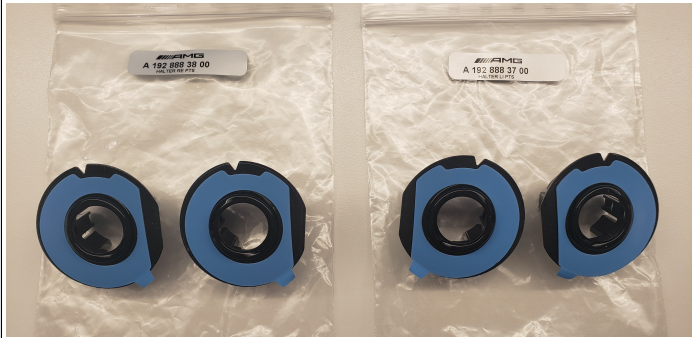
The parts will then be made available accordingly.

Installation Notes

PTS holders are supplied with adhesive tape and positional markings.

Ensure the bonding surface of the bumper trim is clean and dry.

Position the PTS holder correctly and apply firm, even pressure to ensure proper adhesion and secure bonding.

Attachments	
File	Description
PTS holders.png	Must be ordered separately, each number contains 1 each
	

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms						
Body > Bumper > Poor fit						

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A1928883700			PTS holder, left	1		X
A1928883800			PTS holder, right	1		X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note