

Fifth Gen Cascadia Turn Signal/DRL

Concern: Some Fifth Gen Cascadias may exhibit turn signal flashing white and/or out of sync with other turn signal lamps on the vehicle; random flashing sequence

Affected Models:
Fifth Generation Cascadia

Root Cause: Solder delamination on PCB

Correction: Fix as failed. Replace the headlamp assembly.

Use **suction cup pullers to firmly pull out and remove the LH side radome. Remove the side radar mounting fasteners, then remove the LH side radar unit. See Fig. 4.

Production Changeover: April 2026



[HEADLAMP - LED, LEFT HAND DRIVE, HEATED, LEFT HAND | A66-20649-006 | Excelsior Parts - DTNA](#)

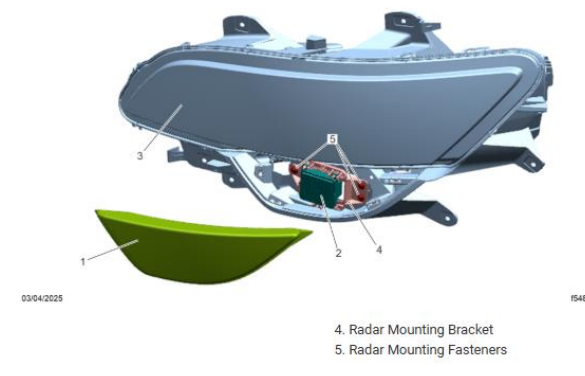


Fig. 4, Front Radar Removal

[Removal of the Headlamp - Technical Literature](#)
[Installation of the Headlamp - Technical Literature](#)
[Aiming and Adjusting the Headlamp - Technical Literature](#)