

 Preview Solution CBR-2588-2

## **VMCU B1524-49 – Rain Sensor Internal Electronic Failure (Rain Sensor Will Not Calibrate) - AN (4) - PR - VN (4)**

Published 01 June 2026

### **Valid For**


Mack Chassis - AN (4), PR

Volvo Chassis - VN (4)

Model Year - 2024 to Current

The purpose of this CBR is to provide aid in VMCU fault B1524-49 along with a Rain sensor which will not calibrate

If VMCU fault B1524-49 – Rain Sensor Internal Electronic Failure is encountered ensure the rain sensor is mounted correctly. This will be referenced in IMPACT operation ID 3639-03-02-12. The rain sensor electrical connection should be pointed down. If correct mounting is encountered with the fault code refer to PTT (Premium Tech Tool) and or WSTB (Workshop Toolbox) for further troubleshooting.

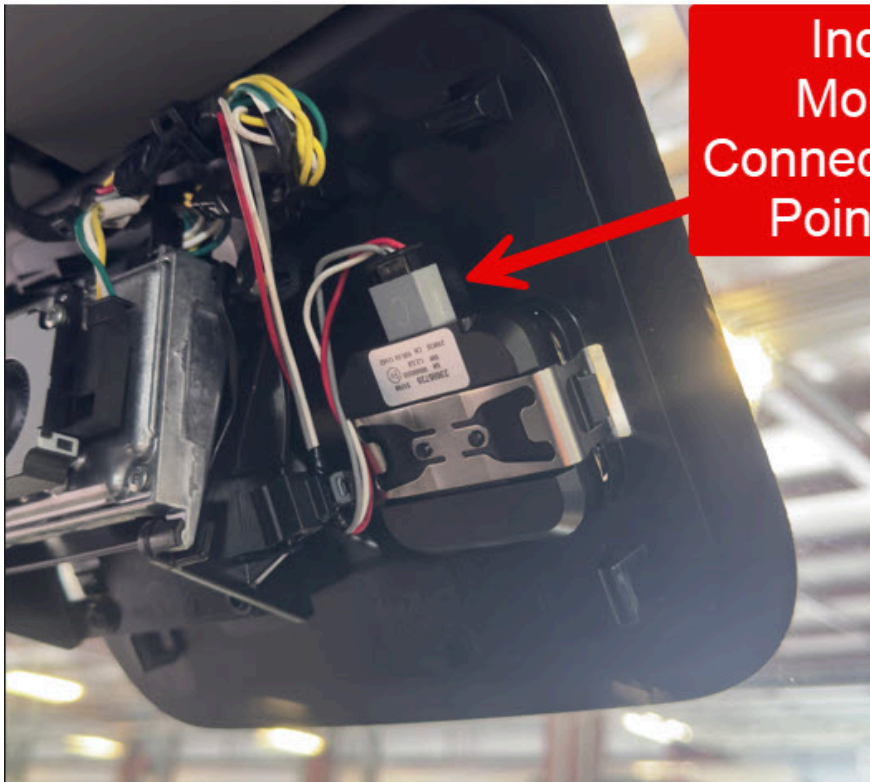

**Incorrect Mounting!  
Connector Should Point Down!**

### Related links and attachments

No links or attachments available



#### Share

to others that might find it helpful



#### Feedback

[Give feedback](#)

to help improve the content of this article