

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5, S5 (FU), Q5, Q5 Sportback, SQ5, and SQ5 Sportback	2025 – 2026	Q	00A5 Front sensor for driver assistance systems Software version: 0250 0295 0381 0386
A6 (FN)	2026		


Customer States:

- Check engine light (MIL) appears in instrument cluster and/or
- Unusual behavior of radiator fan – long run-on or runs at full load

Workshop Findings:

The following DTC is logged in the thermal management control unit (diagnostic address 00C5):

- **P1A7B00** – Control module 1 for radiator fan, incorrect component installed.

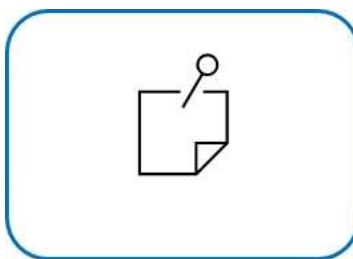

Postpone repair

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

If the scenario described occurs, please check the configuration of the HCP4 (J519/onboard supply control unit).

Please postpone any repairs related to this issue. A combined software update with the target VR combined software version 03.20.00/C [KD3] is currently being implemented. It will be rolled out in stages for the different models and markets. All information about the current schedule and availability of the measure can be found in TSB 2081477, 00 Service info: central overview of combined software update 03.11.00/C PPE PPC - KD2*

As a part of the process, create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in Audi Now; Service | AU-US > Pending Service Solutions (PSS).

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	0040		
Labor Operations:	GFF/Guided Function	0150 0010	See SRT with associated operations
	GFF/Guided Function	0150 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2082283/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

There is no reason to replace parts. Unjustified work/replacement parts will be charged back.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2082283**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.