

V O L V O

Volvo Car USA LLC

Technical Journal

Technical Journal Title Noise From Engine During Idling		Ref. No. TJ 37844.1.0	
Issuer (Dept.) Technical Service		Issue Date 5/21/26	Status Date 6/24/26
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA		Function Group 2570
Function Description Crankcase ventilation		Page Page 1 of 3	

Attachment

File Name	File Size
TJ_37844_1.pdf	0.3708 MB
TJ_37844_1.MOV	1.0563 MB
TJ_37844_2.MOV	9.4452 MB

DESCRIPTION:

If a noise from the engine occurs during idling, please follow the advice under “Service”.

CSC Customer Symptom Codes

Code	Description
F1	Driving/Unusual noise/At engine shut off
ZE	Idling/Unusual noise

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
246	HD	BHDPHEV					2027-2027		-	202617-202619
256	HD	BHDPHEV					2027-2027		-	202617-202619

SERVICE:

If a noise from the engine occurs during idling, refer to the attached sound file for reference and comparison; see attachment [TJ_37844_1.MOV](#).

If the noise corresponds to the attached sound file, make sure that the fresh air hose is not squeezed or kinked; see attachment [TJ_37844_2.MOV](#).

For location and correct clip positions, see attachment TJ_37844_1.pdf.

Note that this noise is similar to the chirping noise from the camshaft seal described in TJ 36551.



Technical Journal 37844.1.0


Warranty claim info:

No warranty claim is accepted for this TJ.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support needed", use function group 2570.

To view TJ attachments continue to next page. This TJ has one attachment and two video files.

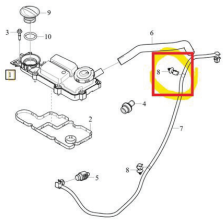

VOLVO

TJ_37844

