
FRONT AIRBAG SENSOR RH NX200t

REMOVAL


1. RECORD SETTINGS OF THE AUDIO SYSTEM, AIR CONDITIONER, ETC.

a. For devices such as the audio system, air conditioner, etc, record current settings before disconnecting the negative battery cable.

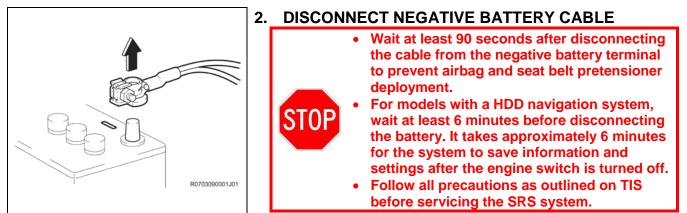



- 3. DISCONNECT CONNECTOR OF FRONT AIR BAG SENSOR RH
 - a. Disconnect the connector following the steps below. (Under hood)

This special connector has a double locking mechanism and needs to be handled with care.
DO NOT apply pressure on the wire harness.

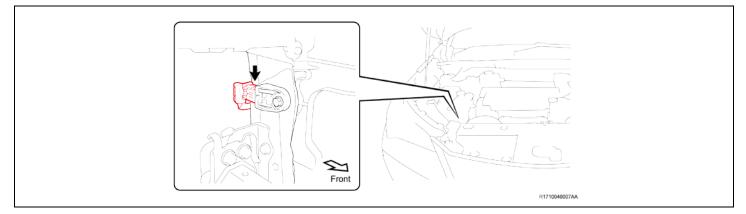

- (1) To unlock the first lock, keep pushing down the white housing lock and then slide the yellow CPA towards the wire harness.
- (2) To unlock the second lock, keep pushing down the white housing lock again and disconnect the connector.

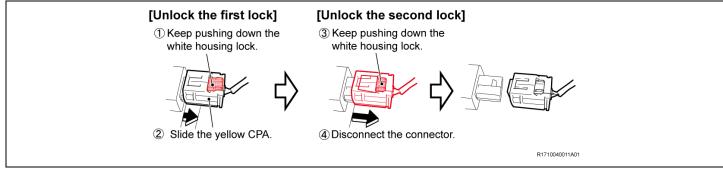

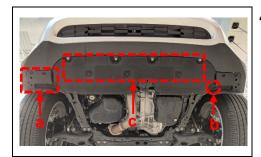

4. REMOVE SPLASH PLATE


- a. Remove the 5 screws from the RH side.
- b. Remove the 1 screw from the LH side.
- c. Remove the 4 bolts and 3 clips to remove the splash shield.

5. REMOVE FRONT AIR BAG SENSOR RH

- a. Remove the bolt while holding the front air bag sensor RH.
- b. Mark and store the removed front air bag sensor RH in a separate container so as to not reinstall it in error.



If you DO NOT hold the sensor, it may be rotated together with the bolt and the guide pin may be broken.

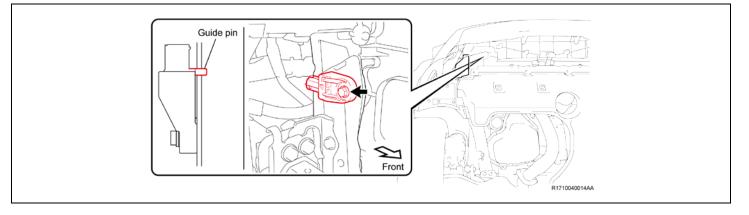


INSTALLATION


- 1. INSTALL A NEW FRONT AIR BAG SENSOR RH
 - a. Engage the guide pin of a **NEW** front air bag sensor RH and hold it in place.
 - b. Reinstall the bolt.

Torque: 80 in.lbs {9 N·m, 92 kgf·cm}




DO NOT use a sensor which has been affected by strong shocks such as being dropped. If you DO NOT hold the sensor, it may be rotated together with the bolt and the guide pin may be broken.

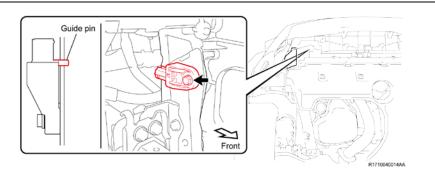


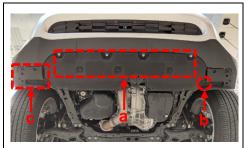

6. INSTALL SPLASH PLATE

- a. Install the 4 bolts and 3 clips.
- b. Install the 1 screw from the LH side.
- c. Install the 5 screws on the RH side.
- 2. RECONNECT CONNECTOR OF THE **NEW** FRONT AIR BAG SENSOR RH
 - a. Engage the connector of the **NEW** front air bag sensor RH holding the sides of its yellow CPA (A click sound can be heard).

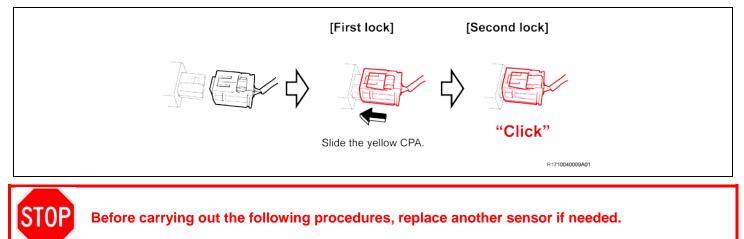

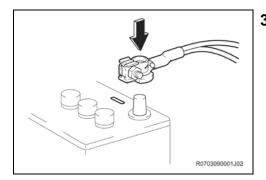

3. RECONNECT NEGATIVE BATTERY CABLE

4. INSPECT THE AIR BAG SENSORS USING THE JUDGMENT SOFTWARE

5. RESTORE VEHICLE

a. Perform system initializations.