



EGRESS WINDOW CRANK HANDLE

Bulletin Type:	Safety Recall
Bulletin #:	19V-691 US 2019-501 Canada
Job Code:	9901441
Flat Rate:	.3 hour

Publication Date:	October 2019
Make:	JAYCO
Model:	Jay Feather HY
Model Year:	2019-2020

Incident:	Crank handle on emergency window prevents opening to the extent required for an egress.
Affected Units:	2019 Jay Feather HY K1JH0185-0274 2020 Jay Feather HY L1JH0051-0080
Parts Kit:	Parts Kit #: 19V-691
	Red Z shaped handle
Misc. Tools & Supplies:	Screw gun with long #2 Philips bit

REPAIR INSTRUCTIONS

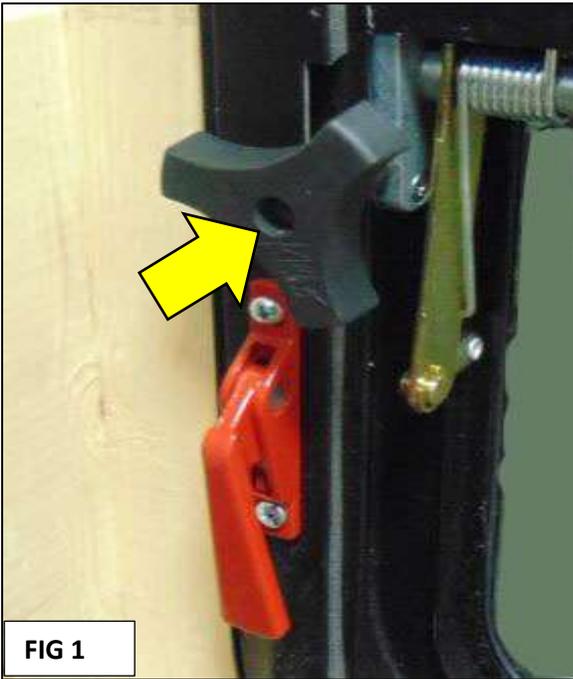


FIG 1:

- Remove the philips screw in the black knob on the egress window
Save screw to install new handle – remove knob and discard.

FIG 2:

- Place the red Z shaped crank handle on the stud – use screw removed from original handle.
- Tighten the screw on the new crank handle .

Check operation of the window.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco at our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax: (574) 825-0572