



Campaign code:

L636-R.04.21

Campaign name:

Rear seat belt middle position replacement

Model:

Urus

Model Year:

2021

Limited or special editions:

All versions

Markets:

Australia, Austria, Azerbaijan, Bahrain, Belgium, Brazil, Cambodia, Canada, Chinese People Republic, Czech republic, Denmark, Estonia, France, Germany, Hong Kong, Italy, Kuwait, Luxembourg, Mexico, Monaco, Netherlands, New Zealand, Oman, Philippines, Poland, Qatar, Romania, Russia Fed., Saudi Arabia, Singapore, South Africa, South Korea, Spain, Sweden, Switzerland, Taiwan, Thailand, Turkey, United Arab Emirates, United Kingdom, USA.

VIN Identification:

From MLA12266 to MLA14982


Important information: before proceeding with the repair, connect to the Warranty Portal and, using the "VIN Info" function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific procedure, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

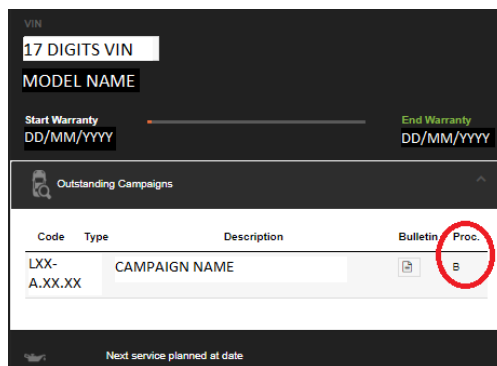

N.B.:

Procedure A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:

It has been determined that certain seat belt assemblies may not comply with safety standards. In these certain seat belt assemblies, the automatic locking retractor (ALR) function may deactivate early before the webbing is fully retracted.

Solution for the field:

The safety belt retractor will be inspected for correct function and, if necessary, replaced.

Operations:

- **OPTION A:** Rear seat belt middle position inspection. (**NOT for South Korea**)
- **OPTION B:** Rear seat belt middle position replacement.

Note:

Vehicles of South Korea market must be performed only with OPTION B.



Replacement Parts:

OPTION B

| Part number | Description | Q |
|-------------|-------------------------|---|
| 4M8857807A | REAR CENTER SAFETY BELT | 1 |

Management of replaced parts:



IMPORTANT:

Store properly and tagged the parts replaced with bar code form for their identification during Area Manager visits.

Labor time:


- Option A: 0,1 h
- Option B: 2,8 h

Previous bulletins superseded.

None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the "LIASS" system on the Lamborghini portal and, following the instructions in the system's "Manuals" section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

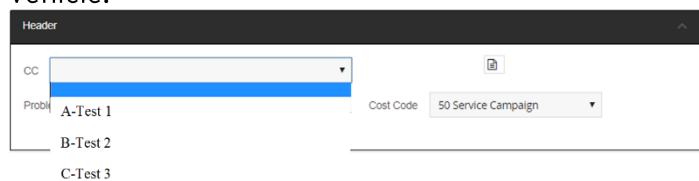

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPTION A:** Rear seat belt middle position inspection
 - o Steps to perform: 1
 - o Labour: 0,1 hours
- **OPTION B:** Rear seat belt middle position replacement
 - o Steps to perform: 1, II
 - o Labour: 2,9 hours

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section "Service and Recall Campaigns":



N.B. (*)

All ODIS technical documentation can be viewed on the Lamborghini web portal, in the ODIS section.




Work instructions:

The updating procedure described here includes the following steps:


- I. **Rear seat belt middle position inspection**
- II. **Rear seat belt middle position replacement**

I. Rear seat belt middle position inspection


1. Put the safety belt across the empty vehicle seat and insert the metal tongue of the belt into the buckle.

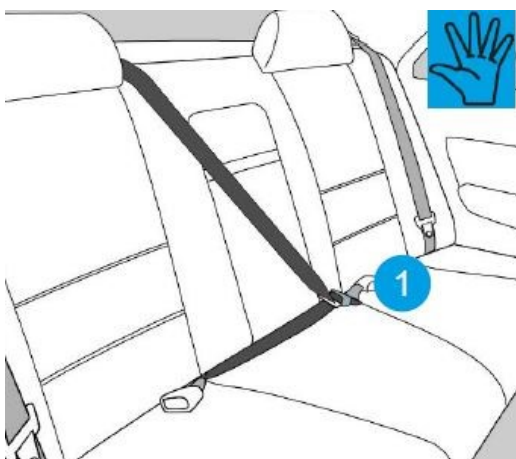


2. Pull the safety belt all the way out of the retractor to activate the Automatic Locking Retractor (ALR).

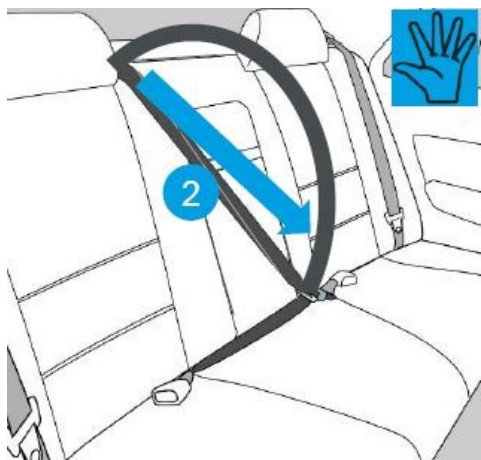

3. Carefully let the safety belt retract fully into the retractor while the belt remains buckled, which simulates a restrained child seat. You will notice that when in ALR mode, there is a ratcheting/clicking noise from the retractor. This is normal.

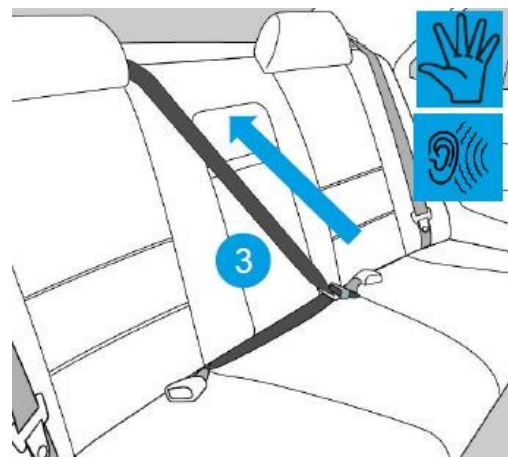

4. Grasp the torso portion of the safety belt and carefully pull on the belt in an attempt to pull the belt back out of the retractor. The belt should not pull out of the retractor.

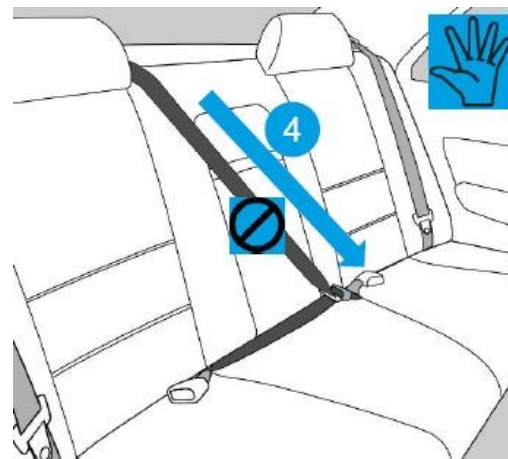

5. Unlatch the belt, and let it completely retract back into the retractor.
6. Repeat steps 1-5 five times (a total of 6 cycles).



Conclusions of inspection

Case 1

If the safety belt locked so that the strap cannot be pulled out of the retractor in step 4.

The ALR function works properly and the safety belt assembly meets the requirements. Don't replace the rear seat belt.

Case 2

If the safety belt has not locked so that the strap can be pulled out of the retractor in step 4.

ALR does not work properly, the safety belt must be replaced according to the repair instructions.

II. Rear seat belt middle position replacement

To replace the rear seat belt follow the instructions on the workshop manual at the path:

08 Body → Passive safety systems → Rear Center Safety Belt



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or write to Technical Support (service.department@lamborghini.com).