SAFETY RECALL Volvo Trucks North America



Greensboro, NC USA

 Date
 Number
 Release
 Page

 11.2021
 RVXX2105
 01
 1(3)

ZF Power Steering Pump Replacement

RECALL INFORMATION

(November, 2021)

Volvo has determined that certain model year 2021 trucks may have been built with a defective power steering pump. The possible defect in the power steering pump could cause it to leak power steering fluid. If this happens, there could be a loss of power steering assist. A loss of power steering assist may result in a sudden increase in steering effort, especially at low speeds. This could increase the risk of a crash.

Volvo Trucks has not received any complaints or reports of vehicle crashes because of this issue.

To ensure that these vehicles meet Volvo's stringent safety standards, the replacement of the power steering pump will be required.

VEHICLES AFFECTED

Certain Volvo North America vehicles manufactured between June 22, 2020 and August 17, 2020.

VEHICLE QUANTITY

There are 3 vehicles affected by this recall (3 U.S., 0 Canada).


Parts Information

Part Number	Part Names	Quantity
21123415	Power Steering pump	1
8161532	Power steering pump mounting gasket	1
977937	Line Seals	2

Repair Instructions

- 1. Secure vehicle for service.
- 2. Remove and replace power steering pump referencing IMPACT operation ID 6453-03-02-01.
- 3. Release vehicle to service.

Diesel Engine mounting gasket shown below

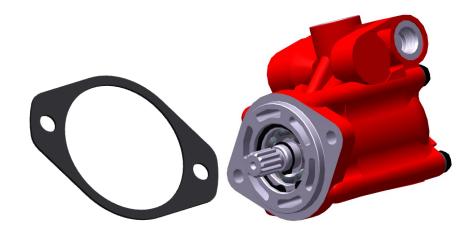

REIMBURSEMENT

This repair is covered by an authorized Safety recall. Reimbursement is obtained through the normal claim handling process.		
	UCHP Reimbursement	
Claim Type (used only when uploading from the Dealer Business System)	40	
Recall Status		
Vehicle repaired per instructions	1-Modified per instructions	
Labor Codes		
Primary Labor Code: 6453-03-02-01 Power Steering Pump, Replacement	1.4	
Causal Part	21123415	
Authorization Number	C6638	

Note: Dealers are to perform Safety Recall Campaign on all subject vehicles at no charge to the vehicle owner regardless of mileage, age of vehicle or ownership (original purchaser or subsequent purchasers). Whenever vehicles are subject to a Safety Recall are brought to your dealership for service, or taken into your dealership vehicle inventory, it is strongly recommended that every effort be made to perform the recall correction before the vehicle is sold or released to the owner.