

RECALL 22V184, 2022-138 REMEDY INSTRUCTIONS



Make(s): PUMA
Model(s): MANY, SEE BELOW
Model Year(s): 2022

Concern:
The exterior griddle may be stowed while in use and increase the risk of fire.

Repair Code: RC-029-03-00-004172
Allotted Time: .30 HRS.
Inspection Code: RC-029-05-00-004171
Allotted Time: .10 HRS.


Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100189268
Part(s) Return: NO

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2022 MODELS: PUT30RKQS, PUT31FKRK, PUT32MBDS, PUT22FKC-425, PUT25BHFQ-1, PUT25RKQB-1, PUT26FKDS-1, PUT26RBSS-1, PUT26RLS-1, PUT28DBFQ-1, PUT28RKQS-1, PUF253FBS, PUF255RKS, PUF257RESS, PUF265RDS & PUF315BHTS

STEP 1: REFERENCE FIGURE 1 FOR REMEDY INSTRUCTIONS;

FIGURE 1

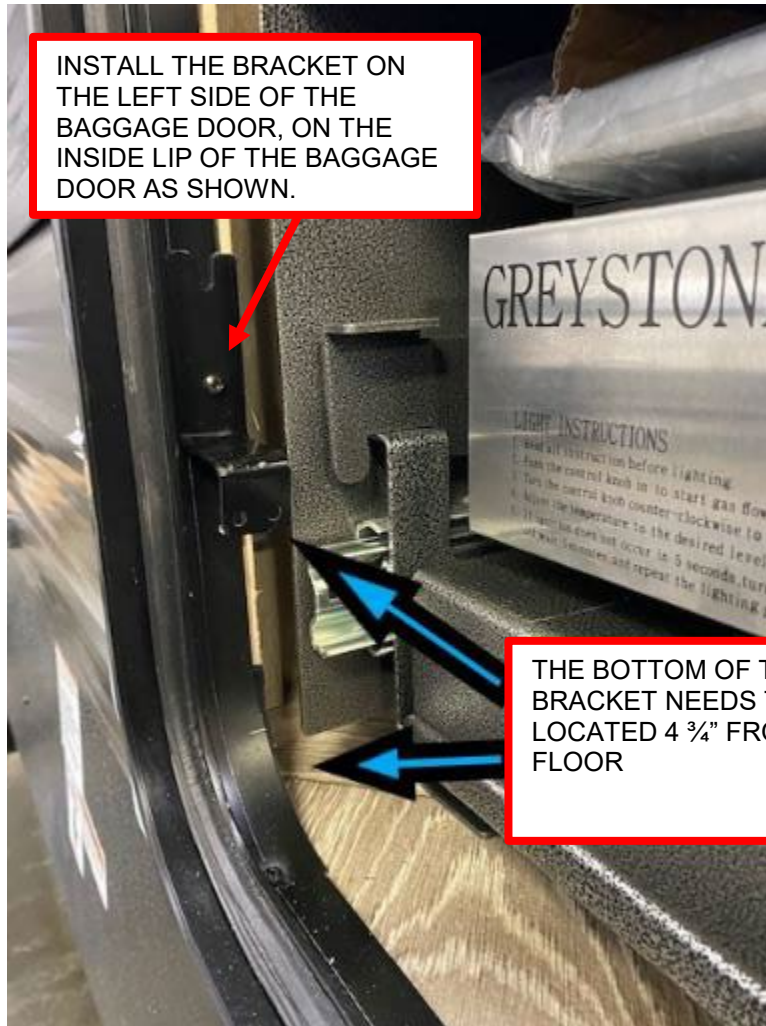

INSTALL THE BRACKET ON THE LEFT SIDE OF THE BAGGAGE DOOR, ON THE INSIDE LIP OF THE BAGGAGE DOOR AS SHOWN.

THE BOTTOM OF THE BRACKET NEEDS TO BE LOCATED 4 ¾" FROM THE FLOOR

STEP 2: CLAIM THE REPAIR CODE.