



# HYUNDAI Technical Service Bulletin

Group	FUEL
Number	08-FL-005
Date	MARCH, 2008
Model	2007-2008 ELANTRA

Subject


## RATTLE NOISE FROM ACCELERATOR CABLE

<b>CIRCULATE TO:</b>	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

### DESCRIPTION

Some Elantra vehicles may have a rattle/buzz/tapping noise from the accelerator cable. This noise is usually described as a body noise heard near the base of the windshield.

**NOTE: There are no operational issues associated with this condition.**

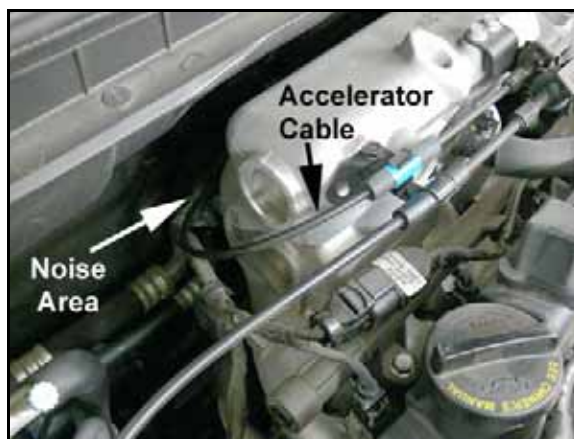

### AFFECTED VEHICLES

- 2007 Elantra vehicles built after January 29, 2007.
- 2008 Elantra vehicles built before November 25, 2007

## REPAIR PROCEDURE

1. Locate the unused plastic clip located behind the engine on the bulkhead.



2. Snap the accelerator cable into the clip.



## WARRANTY INFORMATION

Normal warranty coverage applies.