



**Technical Service
BULLETIN**

April 26, 2002

Title:
DOME LAMP FLICKERS OR STAYS ON
Models:
'01 – '02 Sequoia



ELECTRICAL
EL004-02

Introduction On some 2001 – 2002 model year Sequoia vehicles, the Rear Interior Light (Dome Light) may flicker or will not turn off. This usually occurs when the Dome Light switch is set in the “Door” position. The Dome Lamp Assembly has been improved to correct this condition.


Applicable Vehicles

- **2001 – 2002** model year **Sequoia** vehicles produced before the VIN shown below.

MODEL	STARTING VIN
Sequoia	5TD#T##A92S090584

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
81240-0C030-##	Same	Lamp Assembly, Dome

Repair Procedure Replace the Dome Lamp Assembly with a countermeasure part.

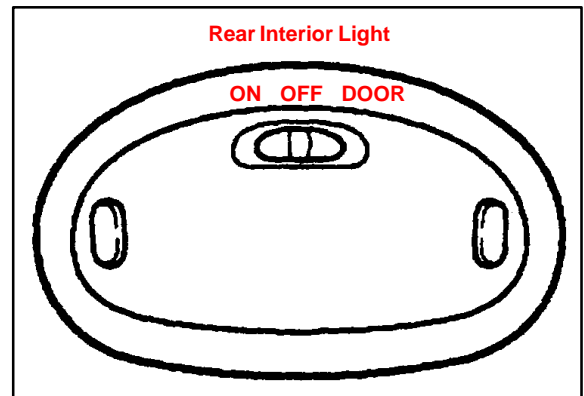

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
EL1019	R & R Dome Lamp Assembly	0.5	81240-0C030-##	82	51

Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

