

To: All Lamborghini Dealers and Service Points

Dealer Principal and Service Manager

From: After Sales Department

Pg: 3

Subject: Service Campaign ref.: L147.A-04.03

Wheel Bolt Replacement

Date: 22.12.2003

Automobili Lamborghini S.p.A.

Dear Lamborghini Dealer,

Service Campaigns are meant to maintain a high quality level of the product.

Therefore, we have enclosed the necessary instructions in order to carry out the above mentioned Service Campaign.

<u>Please perform the indicated operations whenever one of vehicles listed below is at your dealership for service.</u>

Description:

Wheel bolts may develop a surface discoloration.

Vehicles involved:

Lamborghini Murciélago L147

- MY02 from VIN **ZA9BC10__2LA12026** to VIN **ZA9BC10__2LA12331**
- MY03 from VIN **ZA9BC10_3LA12332** to VIN **ZA9BC10_3LA12609**
- MY03 from VIN ZHWBE16_3LA00610 to VIN ZHWBE16_3LA00790

Technical information:

The action refers to Murciélago having the chassis numbers listed above.

Solution:

Replacement of the wheel bolts as explained in the attached procedure: **L147.A-04.03.procedure.**

Network information:

All Authorized Lamborghini Dealers will be informed of this action.

Via Modena,12 I-40019 Sant' Agata Bolognese Phone: +39 051 6817652

Fax: +39 051 6817738



Parts for vehicle:

PN 0052003030 Wheel Bolts 20 Each.

Parts supply:

Lamborghini will send an initial supply to all authorized dealers. Additional parts can be requested utilizing normal spare parts ordering procedures.

Replaced material:

No need to return any parts.

Reimbursement:

Submission of a properly completed Warranty Claim with the following information:

Problem description: Service Campaign L147.A-04.03

Cost code: Component code: 52120 Problem code: 220

Labour code: 52104100 Time: 1 hour

For any further information you may need please contact your Area Manager.

Best regards,

rgio Gamberini

After Sales Manager

Michele Capelli

Service Manager



Procedure: L147.A-04.03

Operation: Wheel Bolt Replacement

1.1 Remove the 5 wheel bolts P.N. 0052003030 (Fig. 1 Ref. 17) for each wheel.

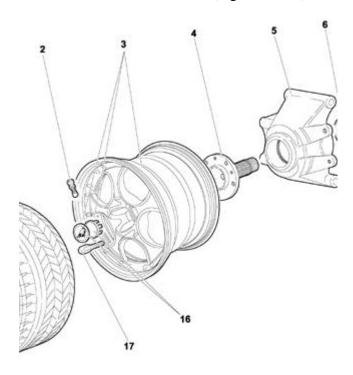


Fig. No. 1

1.2 Apply a light coating of anti-seize compound to the new wheel bolt threads and tighten to 140 Nm (103 ft.lbs.) using a properly calibrated torque wrench.