



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** SES Lamp With Camshaft Position Codes

**Models:** 2015-2016 Cadillac Escalade  
2014-2016 Chevrolet Silverado 1500  
2015-2016 Chevrolet Suburban, Tahoe  
2014-2016 GMC Sierra 1500  
2015-2016 GMC Yukon Yukon XL  
Built with RPO's 4.3L 5.3L 6.2L L83 L86 LV3

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


### Condition/Concern

A vehicle may be setting DTC's P0340 and P0341 at times

### Recommendation/Instructions

If normal SI Diagnostics does not isolate the concern, inspect for corrosion in connector X154 located on the front cover next to the vacuum pump.

See the illustration below

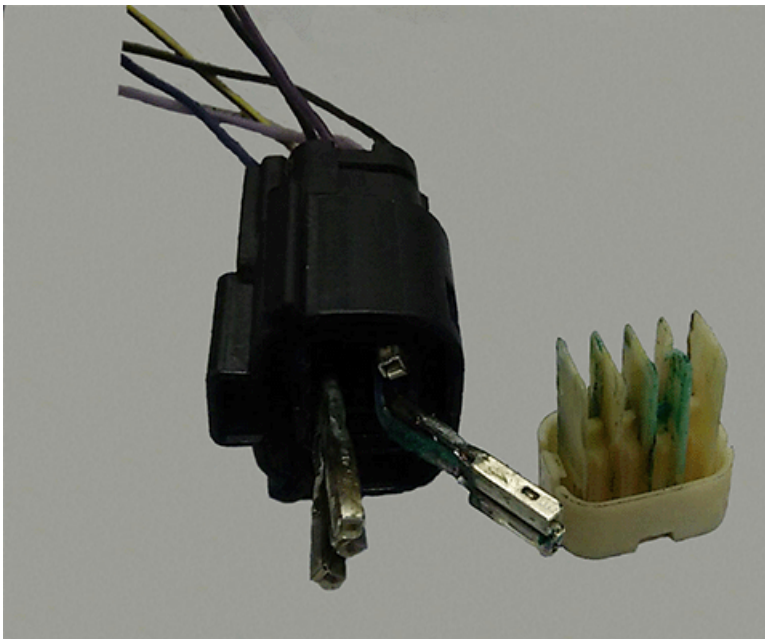

If this condition is encountered repair as needed.

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION