



Preliminary Information


PIP5773B DTC P0331 Knock Sensor 2 Performance Under Engineering Investigation

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Camaro	2019 - 2020	All	All	2.0 LTG	All
Chevrolet	Equinox	2019 - 2020	All	All	2.0 LTG	All
GMC	Terrain	2019 - 2020	All	All	2.0 LTG	All

Involved Region or Country	North America
Condition	SES light on and technician may find DTC P0331 set.
Cause	The cause is unknown at this time.

Correction:

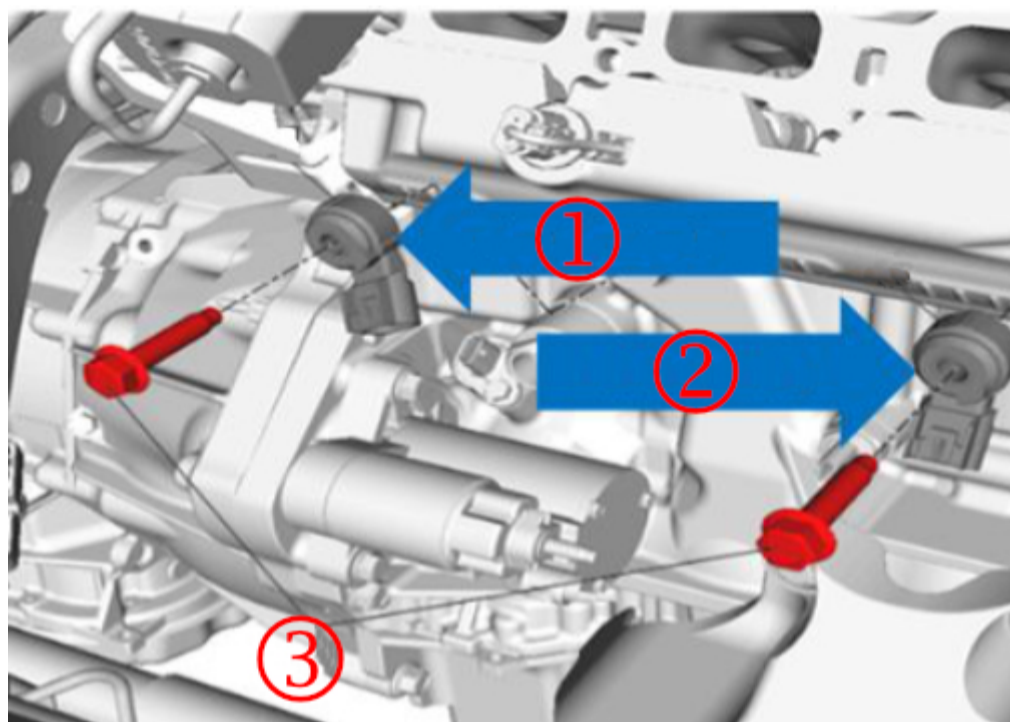

1 - Knock Sensor #2

2 - Knock Sensor #1

3 - Bolts for knock sensors

Perform a visual inspection to make sure the wire harness is connected and the sensor is bolted into place.

If no trouble found, do not replace any parts, clear the code and return the vehicle back to the customer.

Engineering is currently investigating the cause of this concern.

NOTE: This PI will be updated or changed to a bulletin as more information becomes available

Version History

Version	3
Modified	01/05/2021 - Created on. 02/22/2021 - Added Model Years and Models 04/20/2021 - Change document to read this is under engineering investigation do not replace any parts



© 2021 General Motors. All Rights Reserved.