
ATTENTION:

GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.





© 2015 Subaru of America, Inc. All rights reserved. SERVICE BULLETIN

APPLICABILITY: 2015-16MY STI Models

NUMBER: 07-105-16

SUBARU

SUBJECT: Change to Driver Controlled Center Differential

DATE: 01/11/16

(DCCD) Control Module

INTRODUCTION:

This bulletin announces availability of a new DCCD control module to address customer concerns of the manual setting being lost when turning off the ignition. If the operator adjusts the setting of the DCCD feature from the default, this new control module will retain that setting and eliminate the need to "reset" the DCCD whenever the ignition is turned off.

PRODUCTION CHANGE INFORMATION:


The new DCCD control modules were incorporated into production starting with VIN G9818320.

PART INFORMATION:

The new DCCD control module part number is **32520AA332**.

SERVICE PROCEDURE / INFORMATION:

When replacing the DCCD control module, always follow the procedure outlined in the applicable Service Manual. The module is located to the right of the audio / HVAC stack behind the glove box.

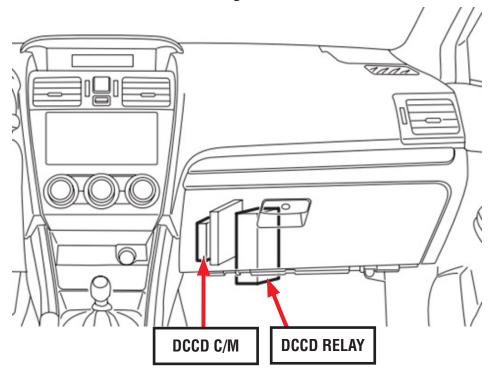

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited Warranty period or covered by a Subaru Added Security Classic or Gold plan, this repair may be submitted using the following claim information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
DCCD Testing and Diagnosis	B561-001	USM-43	0.5
DCCD Control Module R&R	C568-141		0.3

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Bulletin Number: 07-105-16; Date: 01/11/16