



# SERVICE BULLETIN

Classification: EM16-005	Reference: NTB16-083	Date: August 23, 2016
-----------------------------	-------------------------	--------------------------

## 2013 – 2015 SENTRA; REAR TORQUE ROD SERVICE

**APPLIED VEHICLE:** 2013-2015 Sentra (B17)

### SERVICE INFORMATION:

The forward end of the rear torque rod on applied vehicles may develop a crack in the rubber during its normal service life.

- Refer to Figures 2 and 3 on page 2 for the rear torque rod location on the vehicle.

Figure 1 shows a crack in the rubber of the forward end of the rear torque rod that **does not extend** the complete circumference (all the way around) the rubber. This may occur during normal service life.

- **Do not** replace the torque rod for a crack that **does not** extend all the way around the rubber part of the forward end.

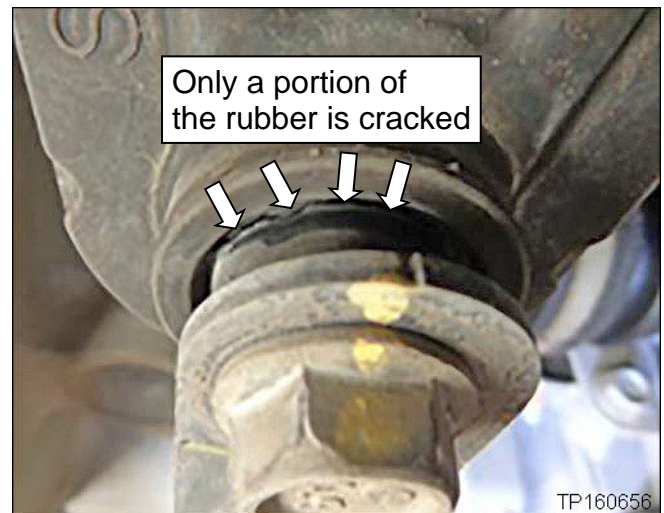


Figure 1

**NOTE:** For 2013-2014 Sentra with a rough idle, refer to NTB15-057.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

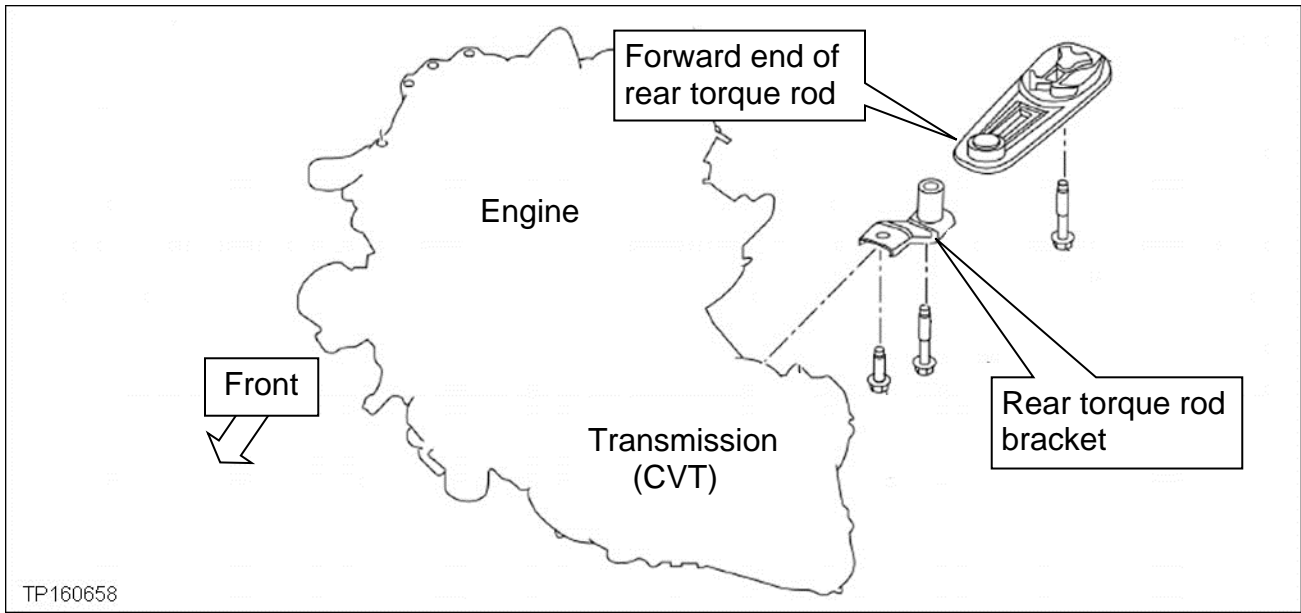


Figure 2

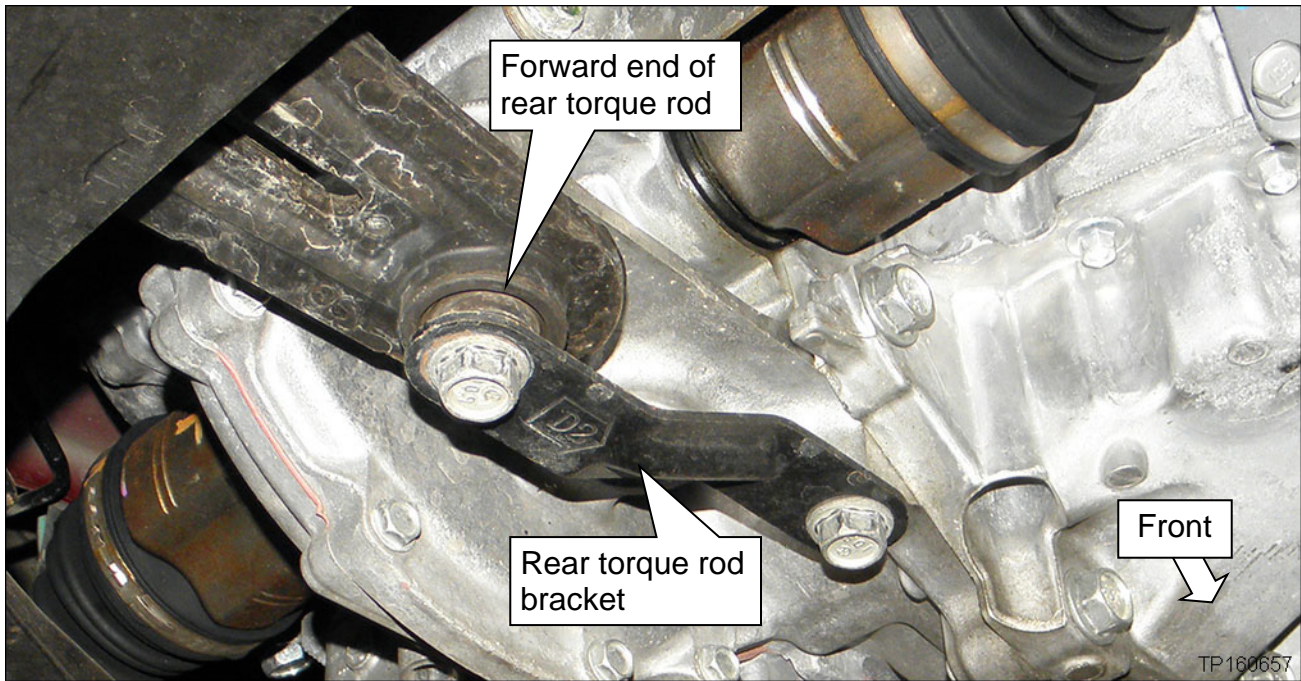


Figure 3

