ATTENTION:					
ATTENTION.	IMPORTANT - All				
GENERAL MANAGER	Service Personnel				
PARTS MANAGER	Should Read and Initial in the boxes				
CLAIMS PERSONNEL	provided, right.				
SERVICE MANAGER	© 2014 Subaru o	f Ameri	ca, Inc.	All right	ts reserved



QUALITY DRIVEN® SERVICE

SERVICE INFORMATION

APPLICABILITY:	2015MY Legacy & Outback Models with 3.6L Engine	NUMBER:	02-158-14R
SUBJECT:	Accessory Drive Belt Tensioner Component	DATE:	11/21/14
	Changes	REVISED:	01/09/15

INTRODUCTION


This Service Information bulletin announces changes to the component parts of the accessory drive belt tensioner assembly used on 3.6L H-6 engines. These design changes will increase the rigidity of the tensioner assembly while improving production efficiency.

COUNTERMEASURE IN PRODUCTION

The new accessory belt tensioner components were incorporated into production on July 18, 2014 starting with Engine Number: **552158**.

PART INFORMATION

PART NUMBER	DESCRIPTION
13086AA200	BRKT- TENSIONER
13082AA020	STOPPER- BELT ADJ
13063AA020	WASH- BELT ADJ
800110670	BOLT- 10 X 70 X 70

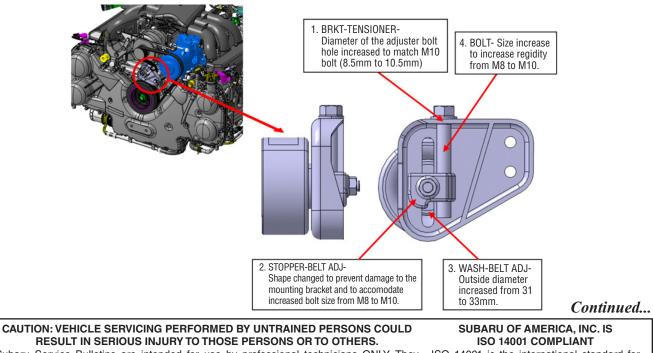

Details of the Design Changes

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotiveproducts in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE / INFORMATION

When repairing or replacing the belt tensioner or its component parts, follow the procedures outlined in the applicable Service Manual.

****VERY IMPORTANT:** If any of the four belt tensioner components described in this bulletin require replacement, <u>ALL FOUR PARTS MUST BE REPLACED AS A SET</u> as they cannot be mixed and matched.

REMINDER: SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time. Always refer to STIS for the latest service information before performing any repairs.