



**SUBARU**

PART NUMBER: H671SXC200


**GENUINE PARTS**  
*INSTALLATION*  
*INSTRUCTIONS*

DESCRIPTION: WIRELESS  
CHARGER


**1**

**KIT CONTENTS**

Wireless Charging Assembly

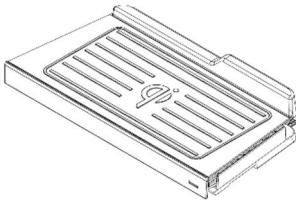


T- Harness

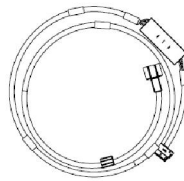

Tie Wrap (Quantity=6)



Foam Tape (Quantity=2)

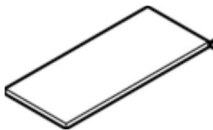


Wireless Charging Information Card



**2**

**TOOLS REQUIRED**

Phillips Screwdriver



Torque Wrench



Panel Removal Tool



10mm socket and ratchet



Nipper



PART NUMBER  
H671SXC200

ISSUE  
REV 01

DATE  
Nov 27 2019

SUBARU OF AMERICA

1 OF 13

### 3

## VEHICLE PREPARATION

1. Place vehicle in ACC mode, engage Parking brake, turn vehicle OFF.
2. Disconnect the negative battery terminal using a 10mm socket/ratchet. (FIGURE A)

**NOTE: If equipped, disconnect eyelet cable only.**

**NOTE: DO NOT PROCEED TO THE NEXT STEP FOR ONE (1) MINUTE TO ALLOW TIME FOR THE ACCESSORY POWER SUPPLY TO DISCHARGE.**

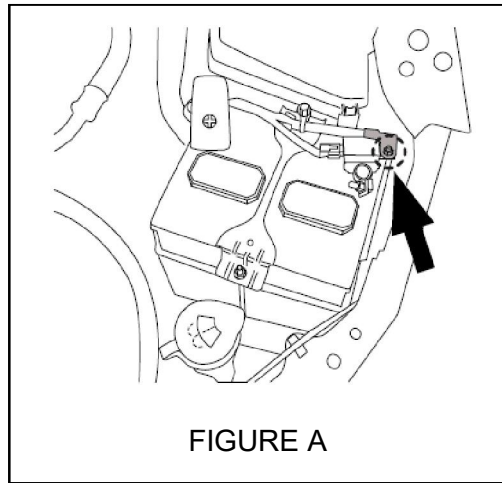


FIGURE A

3. Use panel removal tool to pry and push down on the shift collar. (FIGURE B)



FIGURE B

4. Remove shifter knob retention pin by pushing both sides of the clip forward and then remove the shifter knob and collar. (FIGURE C)

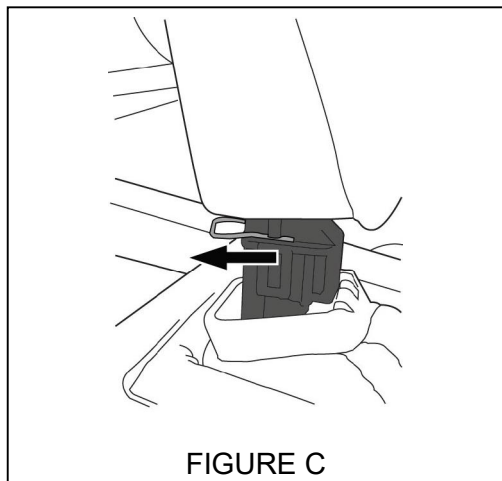


FIGURE C

### 3

#### VEHICLE PREPARATION, continued

5. Use panel removal tool to remove rubber mat and plastic tray and discard. (FIGURE D)



FIGURE D

6. Use panel removal tool to remove console cover. (FIGURE E)



FIGURE E

7. Disconnect console power connection. (FIGURE F)

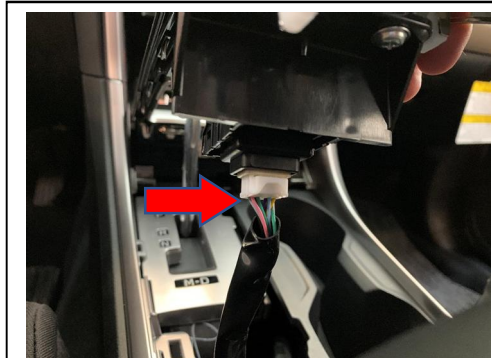


FIGURE F

### 3

#### VEHICLE PREPARATION, continued

8. Use panel removal tool to remove rear console trim cover. (FIGURE G)

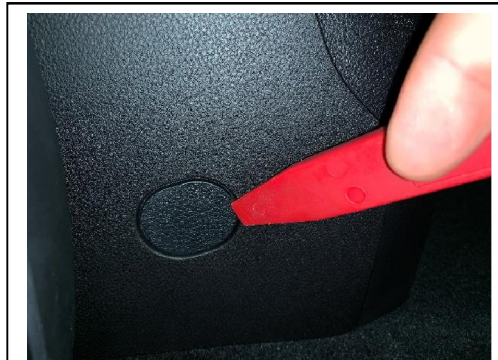


FIGURE G

9. Remove 10mm bolt. Repeat on opposite side of console. (FIGURE H)



FIGURE H

# 4

## WIRELESS CHARGER INSTALLATION

1. Remove 4 Philips head screws. Save screws for reuse. (FIGURE I)



FIGURE I

2. Pull back rear console. (FIGURE K)

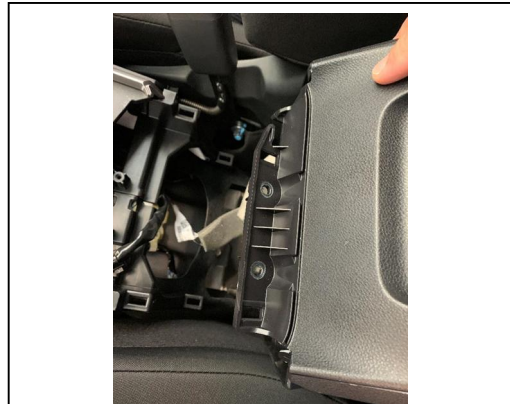


FIGURE J

3. Unplug connector. Remove rear console. (FIGURE K)

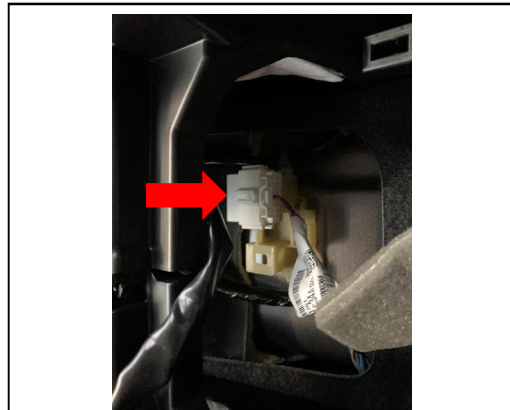


FIGURE K

# 4

## WIRELESS CHARGER IN STALLATION, continue

4. Release center clips. (FIGURE L)

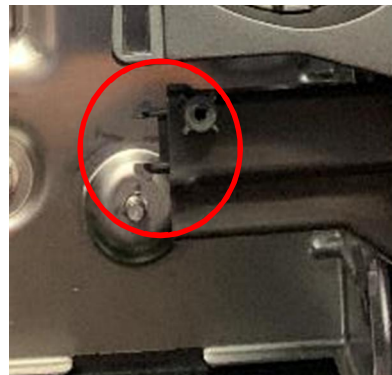


FIGURE L

5. Pull passenger side console cover and remove. (FIGURE N)



FIGURE M

6. Pull back driver side console cover and lay to the side. (FIGURE N)



FIGURE N

PART NUMBER  
H671SXC200

ISSUE  
REV 01

DATE  
Nov 27 2019

SUBARU OF AMERICA

6 OF 13



# 4

## WIRELESS CHARGER INSTALLATION, continue

7. Pull back button bar to release clips. Leave button bar connected. (FIGURE O)



FIGURE O

8. Plug in wireless charger harness and route as shown. Place tie wraps as shown. (FIGURE P)

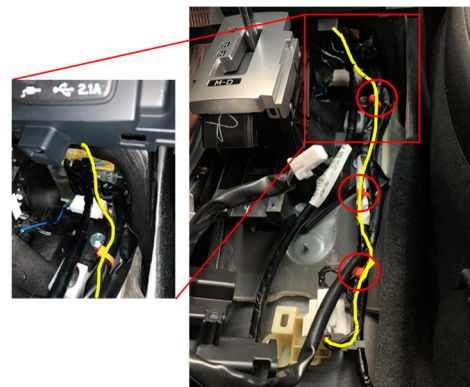


FIGURE P

9. Route harness up through driver side hole containing AVH and Xmode harnesses. Secure to harness. Leave slack for installation. Place tie wrap as shown. (FIGURE Q)

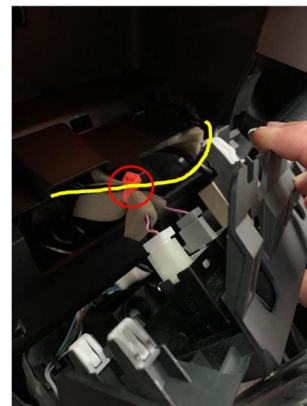


FIGURE Q

PART NUMBER  
H671SXC200

ISSUE  
REV 01

DATE  
Nov 27 2019

SUBARU OF AMERICA

7 OF 13

# 4

## WIRELESS CHARGER INSTALLATION, continue

10. Push button panel back into place, ensuring harness is routed through outer edge. Wireless charger connector will be facing driver side.
11. Plug in wireless charger. Clip down. (FIGURE R)



FIGURE R



# 5

## VEHICLE PARTS RE-INSTALLATION

1. Reinstall driver side console cover.  
(FIGURE S)



FIGURE S

2. Reinstall passenger side console cover.  
Make sure center clip is latched. (FIGURE T)



FIGURE T

8. Reconnect connector. (FIGURE U)

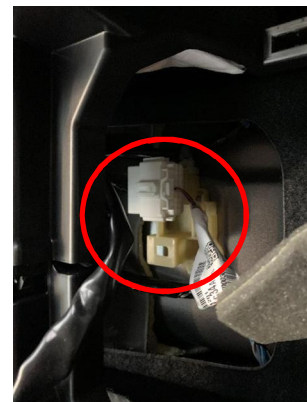


FIGURE U

# 5

## VEHICLE PARTS RE-INSTALLATION

4. Reinstall rear console by sliding it forward.cover. (FIGURE V)



FIGURE V

5. Reinstall 4 Philips head screws. (FIGURE T)

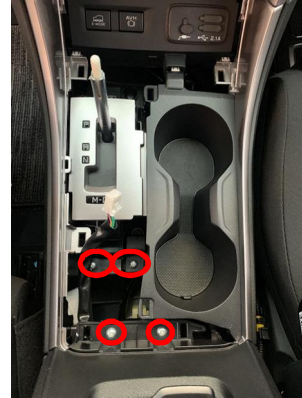


FIGURE W

# 5

## VEHICLE PARTS RE-INSTALLATION

6. Reinstall rear console by sliding it forward.cover. (FIGURE V)



FIGURE V

7. Reinstall 4 Philips head screws. (FIGURE T)



FIGURE W

8. Reinstall 10mm bolts on both sides of console. (FIGURE X)

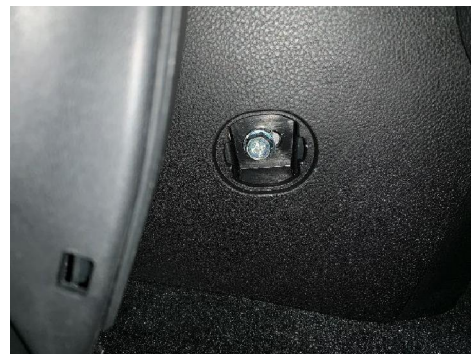


FIGURE X

# 5

## VEHICLE PARTS RE-INSTALLATION

9. Reinstall console trim cover. (FIGURE Y)



FIGURE Y

10. Reconnect console power connection. (FIGURE Z)

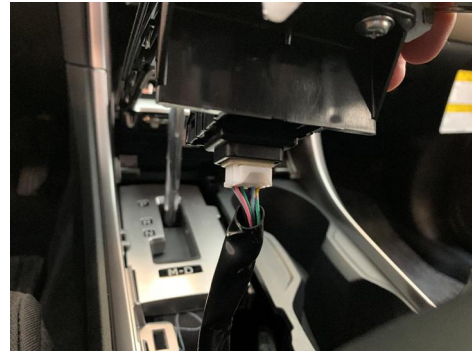


FIGURE Z

11. Reinstall console cover. (FIGURE AA)



FIGURE AA

**6****POST INSTALLATION CHECKLIST**

Place car in ACC or ON mode  
Ensure wireless charger indicator light  
illuminates in white.

PART NUMBER  
H671SXC200

ISSUE  
REV 01

DATE  
Nov 27 2019

SUBARU OF AMERICA

13 OF 13