

Retrofitting Trelleborg Engine Mounts to Pre-GHG17 Heavy-Duty Engines

TSB-01-102-FTL

Creation Date: 2017-01-17

Last Revision Date: 2026-05-07

Engine or Vehicle Affected:

- ▶ Business Class M2
 - ▶ Argosy
 - ▶ 108SD
 - ▶ 114SD
 - ▶ 112SD and Coronado
 - ▶ Columbia
 - ▶ Century Class Conventional
 - ▶ Cascadia
-

Description of Revisions:


- 01/17/2017 - Initial Release
- 11/30/2022 - General information and parts list have been updated.
- 05/07/2026 - The Trelleborg Lower Front Mount position part number has been updated.

This is an informational bulletin only. The described condition is a product improvement and is not warrantable.

Described Condition

Vehicles built prior to GHG17 use engine mounts produced by Parker LORD. See Fig. [1](#). If the rear LORD engine mounts are not available from the Parts Distribution Center (PDC), the new version from Trelleborg can be adapted to replace the original mounts. It is recommend to replace both rear and front mounts, if one LORD engine mount is being replaced with a Trelleborg engine mount. In some installations, the original mount is an assembly that includes an additional spacer. See Fig. [2](#). In these cases, the spacer needs to be removed from the original assembly and installed between the new mount and the engine leg. For parts, see Table . Follow the steps below to convert the rear engine mounts. The front mounts are interchangeable.

❗ Important: Do not use the fasteners for the LORD rear engine mount for the Trelleborg rear engine mount.

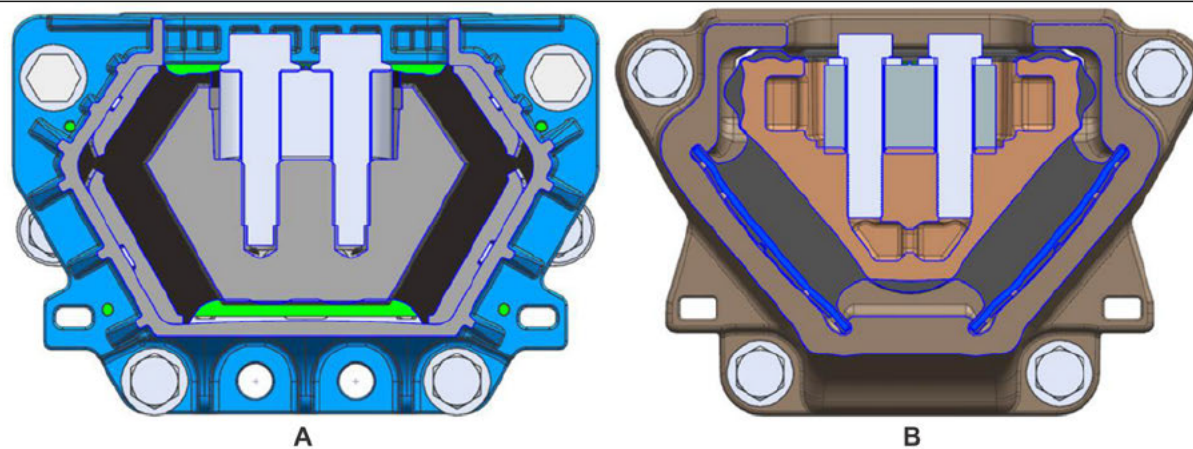

11/21/2016

A


A. LORD Rear Engine Mount

B

f012210


B. Trelleborg Rear Engine Mount

Fig. 1, Rear Engine Mounts by Manufacturer

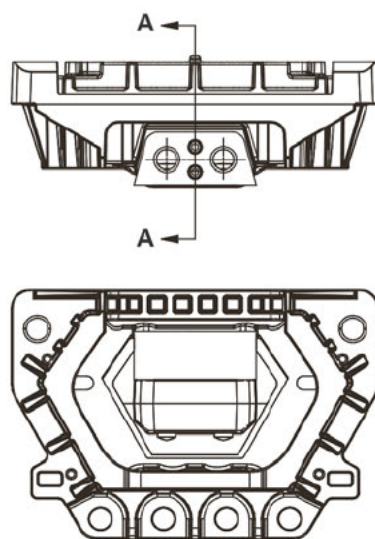

11/09/2022

A. Cross-Section View

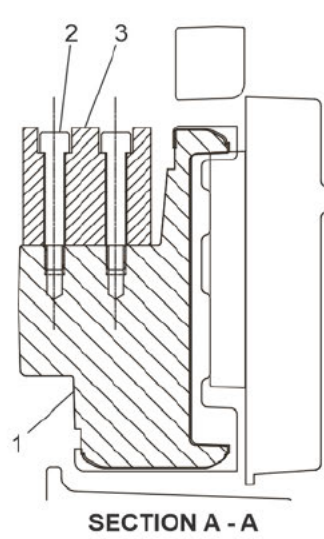

f012260

1. Engine Leg Mounting Boss
2. Spacer Fasteners (not used for the Trelleborg installation)

3. Engine Leg Spacer

Fig. 2, LORD Engine Mount Assemblies with Spacers

Parts

Parts are available from the PDCs. See Table [1](#).

Table 1, Trelleborg Engine Mounts Retrofit Part List

LORD Engine Mount	Original Fastener	Trelleborg Mount	Replacement Fastener	Position
LORJ26185 27	23-13421-300	01-35313-001	23-14068-080	Rear Mount
LORJ26185 28	23-13421-300	01-35313-000	23-14068-080	Rear Mount
LORJ26185 29	23-13421-300	01-35313-001	23-14068-080	Rear Mount
LORJ26185 30	23-13421-300	01-35313-000	23-14068-080	Rear Mount
A01-31455-004	23-13421-375	01-35313-000	23-14284-100	Rear Mount
A01-31455-015	23-13421-375	01-35313-001	23-14284-100	Rear Mount
A01-31455-006	23-13421-425	01-35313-000	23-14068-120	Rear Mount
A01-31455-007	23-13421-425	01-35313-001	23-14068-120	Rear Mount
A01-31455-008	23-13421-425	01-35313-000	23-14068-150	Rear Mount
A01-31455-009	23-13421-375	01-35313-000	23-14284-100	Rear Mount

A01-31455-010	23-13421-375	01-35313-001	23-14284-100	Rear Mount
LORJ21246 60	23-13539-500	01-33963-000	23-13539-500 and 23-09114-004	Upper Front Mount
LORJ21247 21	23-13833-112	01-33964-000	23-13934-065 and 23-09114-004	Lower Front Mount

Table 1, Trelleborg Engine Mounts Retrofit Part List

Procedure

1. ☐ Park the vehicle on a level surface, shut down the engine, and set the parking brake. Chock the tires.
2. ☐ Follow the engine mount repair process in the applicable workshop manual to remove the rear mounts.
3. ☐ If there is a spacer attached to the original mount, remove it and save it for the assembly process.
4. ☐ Follow the applicable workshop manual procedures to install the new mount on the frame rail.
5. ☐ Use the new fasteners to secure the engine leg and spacer, if applicable, to the new mount. Tighten the fasteners 229 lbf·ft (310 N·m).
6. ☐ Use the applicable workshop manual to replace the front engine isolators.

Warranty

This is an informational bulletin only. The described condition is a product improvement and is not warrantable.

Note:
REPAIR
F12
F22
F07
F18
F15
F25
F01
F32
F02
F27
F28
F29
F08
F03
F14
F24
F33
F39

CONTACT INFORMATION

For questions, please create a Service Technical Request using the DTTS Application on the DTNA Portal.

Document Number: 0000080853
Topic Publication Date: 2026-05-07