

Technical Service Bulletin (TSB)
Fuel Oil Refresh Mode (FORM)
Message - Safety Recall 68C Supplement

REFERENCE:	TSB: 08-238-26 GROUP: 08 - Electrical	Date:	June 12, 2026	REVISION:	—
VEHICLES AFFECTED:	2020 - 2025 (JL) Jeep Wrangler 2022 - 2025 (WL) Jeep Grand Cherokee This bulletin applies to vehicles equipped with 2.0L I4 DOHC DI Turbo PHEV Engine (Sales Code ECX).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to the North America market.	
CUSTOMER SYMPTOM:	Technicians may experience the following: A FORM message will display in the Instrument Panel Cluster (IPC) after performing RC-682-25 - Safety Recall 68C - High Voltage Battery.				
CAUSE:	Software issue				

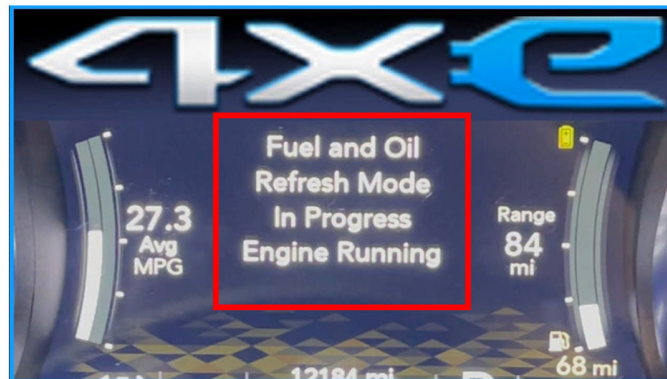


Fig. 1
FORM Message

DISCUSSION:

This Information Only bulletin is to advise dealer technicians on how to resolve the FORM message that may display in the IPC after programming the BPCM per RC-682-25 - Safety Recall 68C - High Voltage Battery. The FORM message states the following: **"Fuel and Oil Refresh Mode"** Fig. 1.

When you first press the ignition start button, the FORM message will appear in the center of the IPC display for five seconds stating. Additionally, trying to force the vehicle into electric-only drive by pressing the "ELECTRIC" button on the E-Select Mode switch will cause the IPC to display the message **"Electric Mode Temporarily Unavailable"**.

Once the vehicle is confirmed to be in FORM, the engine oil must be changed and then the "Oil Life Indicator" must be reset.

POLICY:

Information Only.