

Wheel Bolt Replacement Requirement - Change from Wheel Bolts with Aluminum Washers to Wheel Bolts with Steel Washers (40/26)


Model Line: **Cayman/Boxster (981/982)
911 (991/992)
Taycan (Y1A/Y1B/Y1C)
Panamera (970/971)
Macan (95B)
Cayenne PA (92A/9YA/9YB)**

Model Year: **As of 2010**

Concerns: **Replacement requirement for wheel bolts with aluminium washers**

Cause: **As part of a material change due to long procurement times for aluminium washers, an interim change has been made to a wheel bolt variant with a steel washer.**
As a result, wheel bolts with aluminium washers can sometimes no longer be supplied.

Action: If wheel bolts with aluminium washers are required to be replaced and parts are not available, replace **all** wheel bolts with aluminium washers on the vehicle with wheel bolts with steel washers. ⇒ *Visual differentiation of wheel bolts*

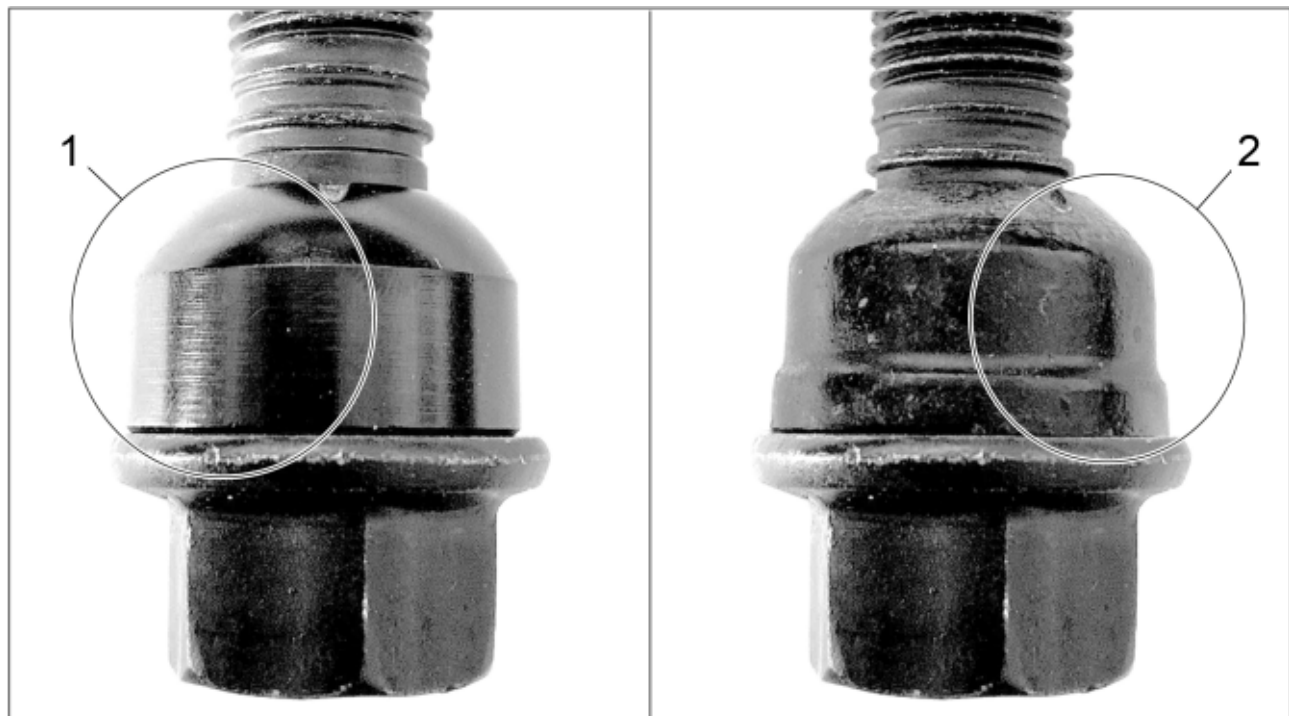

Visual differentiation of wheel bolts

- 1 – Wheel bolt with aluminium washer
- 2 – Wheel bolt with steel washer

Overview:

Overview of the affected part numbers and their alternative part numbers:**Information****No mixed installation of the wheel bolts is permitted.**

It must be ensured that there is no mixed installation of wheel bolts with aluminium washers and wheel bolts with steel washers on the vehicle.

Affected part numbers "Aluminium" wheel bolts	Alternative part number "Steel" wheel bolts	Designation	Possible use
Wheel bolt 49 mm			
PAF004676A	PAF004676B	Wheel bolt, a/f 19 – M14 x 1.5 x 49	▪ 911 (991) ▪ Cayman/Boxster (981) ▪ Taycan (Y1A/Y1B/Y1C) ▪ Panamera (970/971) ▪ Cayenne PA (92A/9YA/9YB)
971698030B	00004460289	1 set of wheel bolts, a/f 19, anti-theft Consisting of: – 4x wheel bolts, anti-theft – 1x adapter	▪ 911 (991) ▪ Cayman/Boxster (981) ▪ Taycan (Y1A/Y1B/Y1C) ▪ Panamera (970/971) ▪ Cayenne PA (92A/9YA/9YB)

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.