#### **DEMONSTRATION / DELIVERY HOLD - Safety Recall 16S06**

Certain 2015-2016 Model Year Transit Wagon Vehicles Seat Belt Buckle Repair/Replacement


#### **TABLE OF CONTENTS**


Vehicle Configuration (VC) Illustrations

- Page 2 VC 1 8 Passenger, Low Roof
- Page 3 VC 2 8 Passenger, Mid Roof
- Page 4 VC 3 10 Passenger
- Page 5 VC 4 12 Passenger
- Page 6 VC 5 15 Passenger
- Page 7 VC 6 15 Passenger, Extended-Length

### VC 1 - 8 Passenger, Low Roof

NOTE: Do not install a new webbing buckle if a webbing buckle is already present in location C.

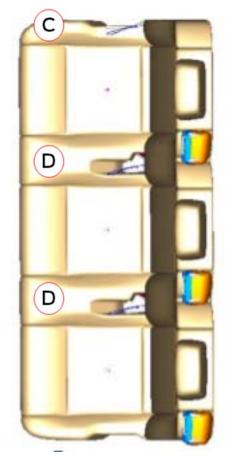


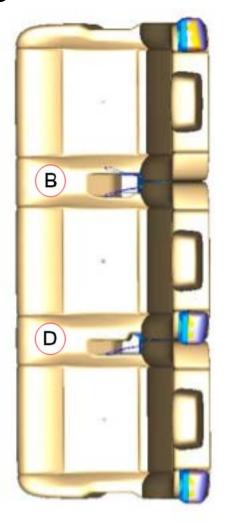





- B Replace Double Buckle CK4Z-1460044-A Qty. 1
- C Install Webbing Buckle BK3Z-6160044-A Qty. 1
- D Refer to Attachment III: Technical Information
  Inspect All LH Seat Belt Buckle/Retractor Assemblies
  Install 3 Reinforcement Blockers CK4Z-14613D10-B
  (1 package includes 5 pieces)

## VC 2 - 8 Passenger, Mid Roof

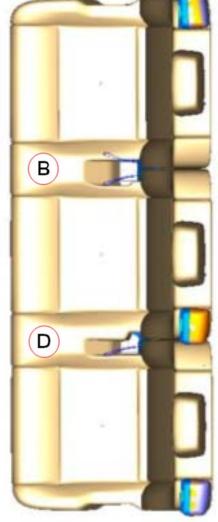


Front Seats
Not Affected




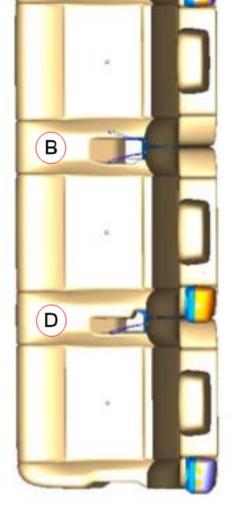


Refer to Attachment III: Technical Information
Inspect All LH Seat Belt Buckle/Retractor Assemblies
Install 2 Reinforcement Blockers CK4Z-14613D10-B
(1 package includes 5 pieces)


# VC 3 - 10 Passenger

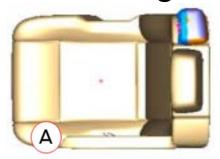


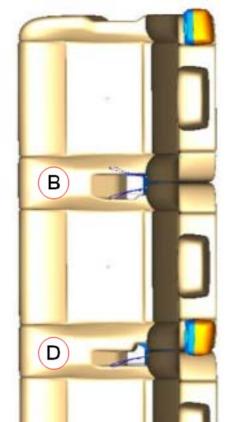


Front Seats
Not Affected

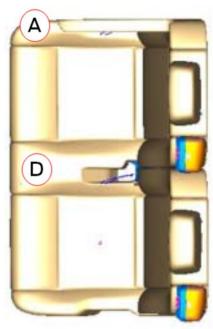

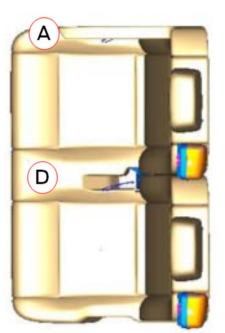










D


## VC 4 - 12 Passenger

NOTE: Do not install a new webbing buckle if a webbing buckle is already present in location C.

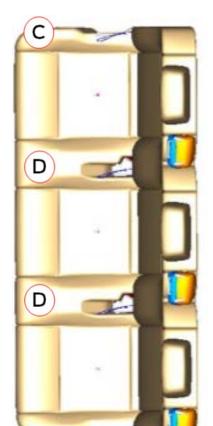

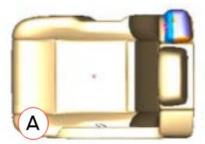

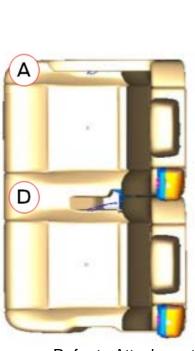

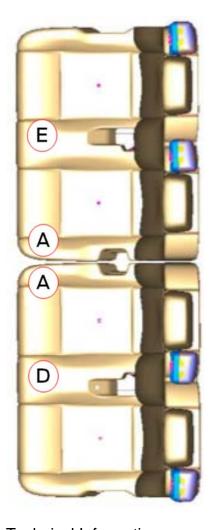



Front Seats
Not Affected

- A Replace Single Buckle CK4Z-1460044-B Qty. 4
- C Install Webbing Buckle BK3Z-6160044-A Qty. 1
- Refer to Attachment III: Technical Information
- D Inspect All LH Seat Belt Buckle/Retractor Assemblies
- Inspect All RH Seat Belt Buckle/Retractor Assemblies
  Install 5 Reinforcement Blockers CK4Z-14613D10-B
  (1 package includes 5 pieces)

### VC 5 - 15 Passenger

NOTE: Do not install a new webbing buckle if a webbing buckle is already present in location C.

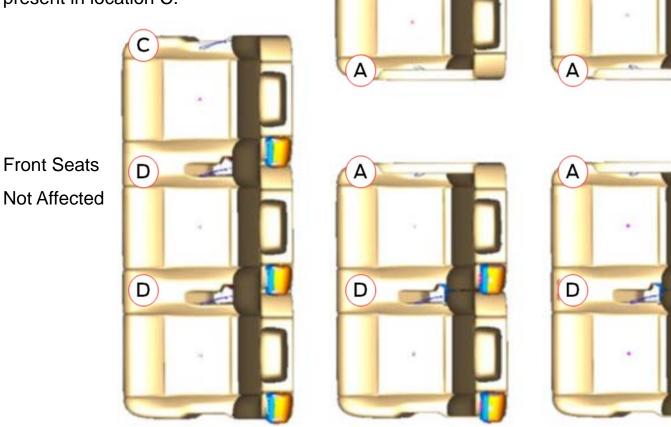


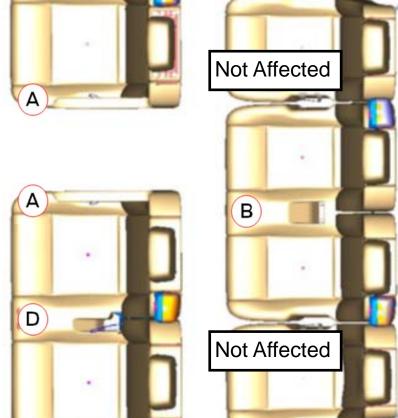



- A Replace Single Buckle CK4Z-1460044-B Qty. 4
- B Replace Double Buckle CK4Z-1460044-A Qty. 1
- C Install Webbing Buckle BK3Z-6160044-A Qty. 1
- Refer to Attachment III: Technical Information
  Inspect All LH Seat Belt Buckle/Retractor Assemblies
  Install 4 Reinforcement Blockers CK4Z-14613D10-B
  (1 package includes 5 pieces)


# VC 6 - 15 Passenger, Extended-Length

NOTE: Do not install a new webbing buckle if a webbing buckle is already present in location C.

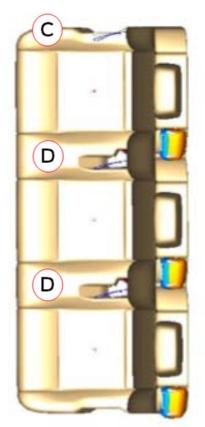


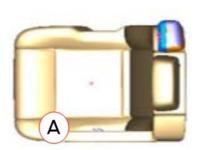

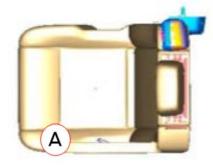

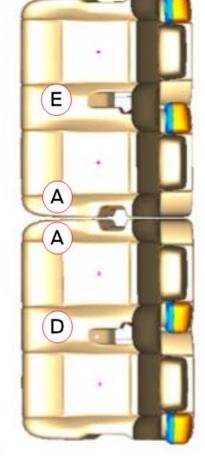

Front Seats Not Affected

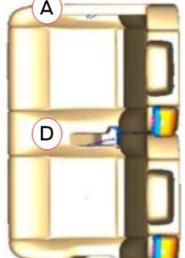



Refer to Attachment III: Technical Information

