

RECALL CAMPAIGN BULLETIN

Reference:

Date:

<u>NTB18-011</u>

February 8, 2018

VOLUNTARY SAFETY RECALL CAMPAIGN 2018 VERSA NOTE; DRIVER SIDE CURTAIN AIR BAG MODULE

 CAMPAIGN ID #:
 PM752

 NHTSA #:
 17V-837

 APPLIED VEHICLES:
 2018 Versa NOTE (E12)

Check Service COMM or Dealer Business Systems (DBS) National Service History to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2018 Versa NOTE vehicles to replace the driver side curtain air bag module. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number PM752 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

REQUIRED SPECIAL TOOLS

Quick Scan Tool (J-52352) and Panel Popper Tool Set (J-46534)

- Each dealer was previously shipped these tools.
- Additional tools can be obtained from Tech-Mate at 1-800-662-2001.

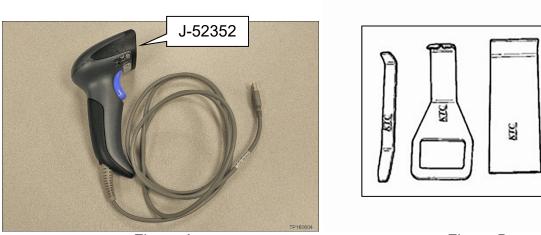


Figure A



J-46534

TP171626

ă

SERVICE PROCEDURE

IMPORTANT: Follow all cautions, warnings, and notes in the Electronic Service Manual (ESM) when working on or near a Supplemental Restraint System (SRS), such as an air bag.

CAUTION: Handle interior trim carefully to avoid damage. Work with clean hands and clean tools to avoid dirt and stains. Use protective covers as needed.

- Presets 1 2 3 6 4 5 AM **FM 1 FM 2** SAT 1 SAT 2 SAT 3 Speed Sen. Bass Treble **Balance** Fade Vol.
- 1. Write down the radio settings.

- 2. Turn the ignition OFF.
- 3. Disconnect both battery cables, negative cable first.
- 4. Wait at least three (3) minutes.

- 5. Remove the new driver side curtain air bag module (module) from its packing and register the module numbers as follows:
 - The new module is listed in the Parts Information.
 - a. Attach the quick scan tool (J-52352) to your CONSULT PC USB port.



Figure 1

b. On the left side of the ASIST main menu, select **Tech Support Info**, and then **Inventory Vehicle Actions**.

	Last Sync. 10/10/2016 8:48:08 PM	
	Automotive service informatio	N SUPPORT TERMINAL Version 13.8.2
	VIN: Retrieve VIN Clear Model: Year: What's New Service Manual CONSULT Codes Symptom Diag. Service History Campaign	Quick Reference
TECH LINE DB Search		Featured NEWS
Latest TSBs TSB Search	Keyword Search: * Red indicates TSBs & Campaigns issued/updated within last 30 days	ASIST CRITICAL UPDATE!
CONSULT-II 😵	LATEST INFORMATION ADDED ITSE ITB16033 2017 QX30; Main 12 Volt Battery Testing With Midtronics GR8 or EXP800	if you see this
NATS & Keycode Image: Constraint of the second se	Tech Support Info	message the ASIST update has been applied. Please check if this message is
Powertrain Call Center Pre-Call Forms Tech-Mate & Virtual Academy & ASIST Support &	Inventory Vehicle Actions	displaying on your other workstations, if not, please run the ASIST Synchronizer. Sept 26, 2016

Figure 2

c. Select CLICK HERE (AirBag to VIN Registration).

Service Actions -Nissan PC507 2016-17 Titan Diesel TCM Reprogram - Service Action - Dealer Announcement and Procedure CLICK HERE PC502 - 2017 Altima_Maxima Front Member Welds CLICK HERE PC522 Titan and P6334 Armada ECM Reprogram CLICK HERE PC469 - 2016 Titan Center Seat - QAH Dealer Announcement and Repar Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC490 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC543 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Airbag to VIN Registration CLICK HERE
PC502 - 2017 Altima_Maxima Front Member Welds CLICK HERE PC522 Titan and P6334 Armada ECM Reprogram CLICK HERE PC469 - 2016 Titan Center Seat - QAH Dealer Announcement and Repar Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC543 2017 Rogue TPMS Initialization CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC522 Titan and P6334 Armada ECM Reprogram CLICK HERE PC469 - 2016 Titan Center Seat - QAH Dealer Announcement and Repar Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC543 2017 Rogue TPMS Initialization CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC469 - 2016 Titan Center Seat - QAH Dealer Announcement and Repar Procedure CLICK HERE PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC543 2017 Rogue TPMS Initialization CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC499 - 2017 Rogue Front Camera - Service Action - Dealer Announcement & Procedure CLICK HERE PC543 2017 Rogue TPMS Initialization CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC543 2017 Rogue TPMS Initialization CLICK HERE PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PM666 - 2017 Sentra Accelerator Pedal Inspection CLICK HERE PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC470, PC549, PC550 Titan Tailgate Lock CLICK HERE R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
R1703 2002 Pathfinder Takata Passenger Air Bag Inflator CLICK HERE Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
Inventory Inspections - Nissan PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
PC482 - ABS Actuator Inspection CLICK HERE Airbag to VIN Registration CLICK HERE
Select CLICK HERE

Figure 3

- d. Use the quick scan tool to scan the bar code (VIN) on the B-pillar label.
 - Make sure the label is clean.

NOTE:

- Some labels may not scan quickly.
- Hold the scan tool approximately six (6) inches away from the label.
- Hold the trigger down until the label is read (this may take several seconds).



Figure 4

- The VIN will automatically populate (see next page, Figure 5).
- If needed, the VIN can be entered manually.

Please enter/scan the VIN and Airbag Inflator Serial Number Dealer Code Key Number VIN Airbag Serial Number Step f (see next page	11/28/2016	
Key Number VIN Airbag Serial Number		Airbag Inflator Serial Number
VIN Airbag Serial Number Submit	Dealer Code	
Airbag Serial Number Submit	Key Number	
	VIN	
Step f (see next page	Airbag Serial Number	Submit
Step f (see next page		
		Step f (see next page)
Select Submit after b fields are populated		Select Submit after both fields are populated

Figure 5

- e. Use the quick scan tool to scan the bar code (serial number) on the new module.
 - The serial number will automatically populate (see Figure 5 on previous page).

If needed, the serial number can

be entered manually.

DO NOT use the asterisks.

NOTE:

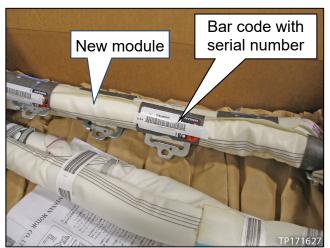


Figure 6

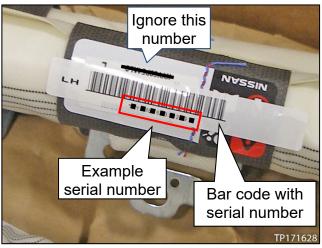


Figure 7

- f. Select **Submit** on the ASIST screen (see Figure 5 on the previous page).
- 6. Replace the driver side curtain air bag module with the new one.
 - Refer to the Electronic Service Manual (ESM), section SR-SRS Airbag, for replacement information.
 - Use Panel Popper Tool Set (J-46534) or equivalent when removing interior trim and parts.
 - > See page 2, REQUIRED SPECIAL TOOLS.
- 7. Reconnect both battery cables positive cable first.

- 8. Reset/reinitialize systems as needed.
 - Refer to the ESM, section PG-Power Supply, Ground & Circuit Elements, for a listing of systems that require reset/initialization after reconnecting the 12 V battery.
 - Look in the PG section index for ADDITIONAL SERVICE WHEN REMOVING BATTERY NEGATIVE TERMINAL.
 - This list often includes items such as radio, power windows, clock, sunroof, etc.
- 9. Turn the ignition from OFF to ON and observe the air bag warning light:
 - The air bag warning light should illuminate for seven (7) seconds, and then go out.

NOTE: If the air bag warning light does not operate as described above, there may be an issue not covered by this campaign. Refer to ASIST and the ESM for additional diagnostic and repair information.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
MODULE ASSY-CURTAIN AIR BAG, LH	985P1-9ME8A	1
GARNISH-CENTER PILLAR, UPPER LH	76914-9ME0A	1
GARNISH-CENTER PILLAR, UPPER RH	76913-9ME0A	1
HEADLINING ASSY (S and Low trim levels)	73910-9ME2A *	
HEADLINING ASSY (SV, SR, and Base trim levels)	73910-9MF3A *	1
BETASEAL 57302N (10.5 oz) **	999MP-57302NP ***	****

* It is recommended to use the VIN in FAST or your electronic parts catalog to determine which Headlining Assembly is needed.

** An equivalent sealant may be used.

***Order BETASEAL 57302N through the Nissan Maintenance Advantage program: Phone: 877-NIS-NMA1 (877-647-6621). Website order via link on dealer portal www.NNAnet.com and click on the "Maintenance Advantage" link.

****Use **EXPENSE CODE** 101 below for BETASEAL 57302N or equivalent sealant.

NOTE: Return the old/non deployed air bag modules using the <u>Air Bag Module Return</u> <u>Instructions</u> on the next page.

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

CAMPAIGN ("CM") I.D.	DESCRIPTION	OP CODE	FRT
PM752	Replace driver side curtain air bag module	PM7520	2.8 hrs

EXPENSE CODE

EXPENSE CODE	DESCRIPTION	MAX AMOUNT
101	999MP-57302NP or Equivalent	\$65.00

AIR BAG MODULE RETURN INSTRUCTIONS


NOTE: <u>DO NOT</u> DEPLOY THE USED/NON-DEPLOYED AIR BAG MODULE REMOVED FROM THE VEHICLE.

Returns via YRC Reverse Logistics (for non DDS dealers)

Packaging Instructions

NOTE: Individuals preparing hazardous material ('Hazmat') shipments are required to be trained in accordance with the Code of Federal Regulations, Title 49, section 172.704.

- 1. Place the used/non-deployed air bag module from the vehicle in the carton that the new air bag module was received in. Be sure to package the used module the same way as the new module. Include any packing material that was used to ship the new module in the carton with the used module.
- 2. Seal the carton with 3 inch clear tape across the flaps and along the edges to securely close the carton.
- 3. Verify that the Class 9 hazardous material diamond, UN ID (UN3268), and the proper shipping name (safety devices) are still clearly visible on the carton and are not covered or obstructed in any way.

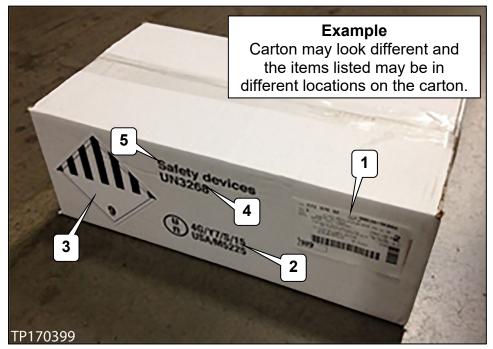

Required markings:

- 1. Transportation information
- 2. UN specification package markings
- 3. Labels

- 4. ID number
- 5. Proper shipping name
- 4. Write on top of the carton: "Campaign".

Shipping Instructions

NOTE: Please accumulate a minimum of 10-15 air bag modules prior to contacting the YRC Reverse Logistics call center to arrange for the pick-up of the modules.

- 1. Call the YRC Reverse Logistics call center at 1-800-357-9199 and tell the operator that you need to return Campaign air bag modules to your servicing PDC.
- 2. Provide the call center with the name, address and telephone of your servicing PDC.
- 3. Provide your dealership name, address and telephone number.
- 4. Provide the number of air bag modules being returned and the total weight.
- 5. The YRC Reverse Logistics team will fax/email you a copy of the completed Bill of Lading and shipping labels for the shipment.
- 6. The YRC Reverse Logistics call center will notify the local YRC terminal to pick up the air bag modules at your dealership.
 - Please do **NOT** call the local YRC terminal to schedule the pick-up.
- 7. Place the packaged air bag modules and completed Bill of Lading aside for pick up by the carrier.

Returns via DDS


Packing Instructions:

NOTE: Individuals preparing hazardous material ('Hazmat') shipments are required to be trained in accordance with the Code of Federal Regulations, Title 49, section 172.704.

1. Place the used/non-deployed air bag module from the vehicle in the carton that the new air bag module was received in. Be sure to package the used module the same way as the new module. Include any packing material that was used to ship the new module in the carton with the used module.

NOTE: The carton must be in like new condition.

- 2. Seal the carton with 3 inch clear tape across the flaps and along the edges to securely close the carton.
- 3. Verify that the Class 9 hazardous material diamond, UN ID (UN3268), and proper shipping name (safety devices) are still clearly visible on the carton and are not covered or obstructed in any way.

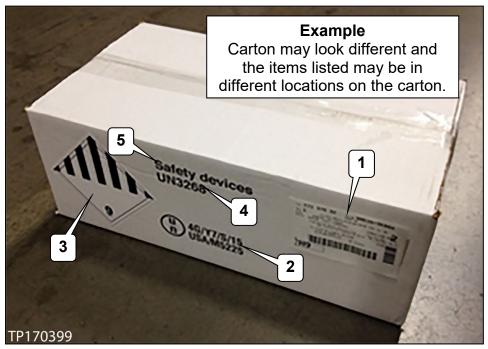

Required markings:

- 1. Transportation information
- 2. UN specification package markings
- 3. Labels

- 4. ID number
- 5. Proper shipping name
- 4. Write on top of the carton "Campaign".

Bill of Lading Instructions (refer to example on the next page):

Use the blank Bill of Lading on page 14 and enter the following:

- 1. Servicing PDC name, address & telephone number.
- 2. Date of the shipment.
- 3. Dealership name and address as indicated on the sample Bill of Lading.
- 4. Number of packages being shipped on line 1.
- 5. Total weight of the packages being shipped on line 1.
- 6. Total number of packages being shipped.
- 7. Total weight of the packages being shipped.
- 8. Print the name of the Hazmat trained/certified employee and have him/her sign as shown on sample Bill of Lading.
- 9. Print the name of the DDS carrier that will be transporting the air bag modules back to your servicing PDC.

Shipping Instructions:

Place the packaged air bag cartons and completed Bill of Lading in DDS delivery area for DDS driver pick up.

SI PLEASE	HIPP NC		CARRIER PLEASE NOTE		SINGLE SHI HECK BOX			
PLACE PRO LA	BEL HE	RE	DING					
				ORIGINAL - NOT NEGOTIABLE SINGLE SHIPMENT PICKUP				
			DATE (2) P.O. NO.	511(0)	SHIPPER NO			
	CONSIGNEE (TO) Servicing PDC Name Dealer Name							
	STREET (1) STREET (3)							
	-	DC Street Address	s					
		DC City, State and Zip	d Zip					
PHONE NO.	<u> </u>	ROUTE	VEHICLE NO.					
Servici	ng P	DC Tel. No.						
NUMBER SHIPPING	н					WEIGHT (LBS) (Subject to		
UNITS	M	KIND OF PACKAGING, DESCRIPTION OF ARTICLES,	SPECIAL MARKS AND EXCEPTIONS	NMFC N	o. CLASS	Correction)		
4	Х	4G BOXES X 9.0 LBS		19697	55	5		
\bigcirc		UN3268, DEVICES, 9				\bigcirc		
		EX-1993040309						
		NO PLACARDS REQUIRED PER 49C	FR 172.504(F)(9)					
		2016 ERG 171						
(6)	▲ T	OTAL			TOTAL ►	(7)		
EMERG	ENC	CY CONTACT: CONTACT MUST BE A	VAILABLE 24/7, 365 day	s per y	year	<u> </u>		
THIS IS TO CERTIFY THAT THE ABOVE NAMED MATERIALS ARE PROPERLY CLASSIFIED, DESCRIBED, PACKAGED, MARKED AND LABELED AND ARE IN PROPER CONDITION FOR TRANSPORT ACCORDING TO THE APPLICABLE REGULATIONS OF THE DEPARTMENT OF TRANSPORTATION.								
SHIPPER			CARRIER		(9)		
			DDS Carrier Name					
AUTHORIZED S			AUTHORIZED SIGNATURE	DATE 04/1	2/17			
					OF PIECES REC			

SI PLEASE	HIPP NO		ON TH	IT CHARGES ARE PREPAID IS BILL OF LADING UNLESS ED COLLECT	PLE	CARRIER ASE NOTE			IGLE SHI CK BOX	
PLACE PRO LA	PLACE PRO LABEL HERE STRAIGHT BILL O					BILL OF LAI	ADING ORIGINAL - NOT NEGOTIABLE SINGLE SHIPMENT PICKUP			
					DATE	P.O. NO.			SHIPPER NO	
CONSIGNEE (1	ſO)				SHIPPER (FROM)					
STREET					STREET					
CITY, STATE, ZI	P				CITY, STATE, ZIP					
PHONE NO.				ROUTE			VEHIC	CLE NO.		
NUMBER SHIPPING UNITS	H M	KIND OI	FPACKAC	GING, DESCRIPTION OF ARTICLES	, SPECIAL MARKS AN	D EXCEPTIONS	NMF	C No.	CLASS	WEIGHT (LBS) (Subject to Correction)
	 ■ T 	OTAL						TC	TAL ►	
MARKED	THIS IS TO CERTIFY THAT THE ABOVE NAMED MATERIALS ARE PROPERLY CLASSIFIED, DESCRIBED, PACKAGED, MARKED AND LABELED AND ARE IN PROPER CONDITION FOR TRANSPORT ACCORDING TO THE APPLICABLE REGULATIONS OF THE DEPARTMENT OF TRANSPORTATION.									
SHIPPER					CARRIER					
AUTHORIZED S	IGNATU	RE			AUTHORIZED SIGNATURE		DATI	E		
							NUI	MBER (OF PIECES	