

Ferrari North America, Inc.

March 2019

Dear Ferrari Dealer:



Ferrari has decided that a defect which relates to motor vehicle safety exists in Model Year 2017, 2018 and 2019 Ferrari 488 GTB, 488 Spider, 488 Pista, 812 Superfast, LaFerrari Aperta, GTC4Lusso and GTC4LussoT vehicles from VIN No. 230242 to 241501.

The vehicles involved are equipped with a fuel vapor separator, which, due to a manufacturing defect, may allow a small fuel leak, potentially causing smoke and/or fire. We want to assure you that our clients' safety is our priority, and we are committed to correcting this condition in their vehicles.

IMPORTANT

Ferrari will be notifying ALL affected MY 2017, 2018 and 2019 vehicle owners nationwide with two separate letters. The first notice will inform the customer about the recall and let them know that parts are currently unavailable. A second letter will be sent when the parts are available. At that time, the customer can schedule to replace the fuel vapor separator, free of charge.

Owners may contact Ferrari North America at (201) 816-2668; Ferrari's campaign number for this recall is C24000069.

You must order the necessary part for each vehicle. Upon transmittal of the repair under the normal warranty system, we will reimburse you for the labor necessary to carry out this campaign.

It is a violation of Federal law for a dealer to deliver a new motor vehicle covered by this notification under a sale or lease until the defect is remedied.

*Technical Department
Ferrari North America, Inc.*



U.S.A. RECALL CAMPAIGN NO. C24000069



488
PISTA

488
GTB

488
SPIDER

812
superfast

LaFerrari
aperta

GTC4
LUSO

GTC4
LUSO**T**

Model Year 2017, 2018 and 2019

REPLACING THE FUEL VAPOR SEPARATOR

RECALL CAMPAIGN OVERVIEW

INTRODUCTION: Ferrari 488 GTB, 488 Spider, 488 Pista, 812 Superfast, LaFerrari Aperta, GTC4Lusso and GTC4LussoT vehicles

SUBJECT: Recall Campaign No. C24000069

VEHICLES: MY 2017, 2018 and 2019 Ferrari 488 GTB, 488 Spider, 488 Pista, 812 Superfast, LaFerrari Aperta, GTC4Lusso and GTC4LussoT vehicles from VIN No. 230242 to 241501 (see Modis for VINs involved).

CONDITION: The vehicles involved are equipped with a fuel vapor separator, which, due to a manufacturing defect, may allow a small fuel leak, potentially causing smoke and/or fire.

REMEDY: Ferrari will repair the vehicle free of charge. The repair involves replacing the Fuel vapor separator. This repair takes approximately 0.65 to 16.05 hours to complete depending on the model.



RECALL CAMPAIGN OVERVIEW (cont.)

PARTS INVOLVED:

The parts necessary to implement the RECALL CAMPAIGN are described herein, and they need to be ordered by you in the quantities required.

Model	Component	Part number to be ordered
488 GTB / 488 Spider	Compl. vapor separator	70006133
GTCLusso / GTC4Lusso T	Compl. vapor separator	70006134
488 Pista	Compl. vapor separator	70006137
812 Superfast	Compl. vapor separator	70006135
LaFerrari Aperta	Compl. vapor separator	70006138

Update the CRM customer database in Modis accordingly as soon as you receive any notification regarding the status of the vehicle (e.g., change of ownership, scrapping, etc.).

SERVICES UNDER WARRANTY:

Refund for the costs incurred by the implementation of the RECALL CAMPAIGN in question, shall be made immediately after a warranty notice has been received by the Technical Service Department. This notice should include the following information:

488 GTB / 488 Spider

- › Campaign number.....C24000069
- › Cost code 24
- › Malfunction code 4414000011
- › Problem code 01
- › Operation code 44090003320
- › Time allowance.....1.30 Hours



GTC4Lusso

› Campaign number.....C24000069
› Cost code..... 24
› Malfunction code 4714000011
› Problem code 01
› Operation code 47090003321
› Time allowance.....0.95 Hours

GTC4Lusso T

› Campaign number.....C24000069
› Cost code..... 24
› Malfunction code 4614000011
› Problem code 01
› Operation code 46090003322
› Time allowance.....0.95 Hours

488 Pista

› Campaign number.....C24000069
› Cost code..... 24
› Malfunction code 3814000011
› Problem code 01
› Operation code 38090003323
› Time allowance..... 1.30 Hours

812 Superfast

› Campaign number.....C24000069
› Cost code..... 24
› Malfunction code 4514000011
› Problem code 01
› Operation code 45090003324
› Time allowance.....0.65 Hours



LaFerrari Aperta

› Campaign number.....C24000069
› Cost code..... 24
› Malfunction code 5414000011
› Problem code 01
› Operation code 54090003325
› Time allowance..... 16.05 Hours

REIMBURSEMENT: Upon receipt of a warranty claim via Modis.



U.S.A. RECALL CAMPAIGN NO. C24000069



488
PISTA

488
GTB

488
SPIDER

812 *superfast*

LaFerrari
aperta

GTC4 **LUSO**

GTC4 **LUSO** **T**

Model Year **2017, 2018 and 2019**

REPLACING THE FUEL VAPOR SEPARATOR

TECHNICAL INSTRUCTIONS

Please read **all** instructions before performing this campaign.

The procedure required for this **RECALL CAMPAIGN** consists of replacing the **Fuel Vapor Separator**.

The **RECALL CAMPAIGN** procedure described herein must be performed precisely as indicated in the following instructions:

1. Replacing the Fuel Vapor Separator

488 GTB / 488 Spider

- Remove the fuel vapor separator (as described in paragraph B3.05 “Removing the fuel vapor separator” in the Workshop Manual).
- Take the new **Compl. vapor separator Code no. 70006133** and install it on the vehicle (as described in paragraph B3.05 “Refitting the fuel vapor separator” in the Workshop Manual).

GTC4Lusso / GTC4Lusso T

- Remove the fuel vapor separator (as described in paragraph B3.06 “Removing the fuel vapor separator” in the Workshop Manual).
- Take the new **Compl. vapor separator Code no. 70006134** and install it on the vehicle (as described in paragraph B3.06 “Refitting the fuel vapor separator” in the Workshop Manual).

488 Pista

- Remove the fuel vapor separator (as described in paragraph B5.03 “Removing the fuel vapor recovery system separator” in the Workshop Manual).
- Take the new **Compl. vapor separator Code no. 70006137** and install it on the vehicle (as described in paragraph B5.03 “Refitting the fuel vapor recovery system separator” in the Workshop Manual).

812 Superfast

- Remove the fuel vapor separator (as described in paragraph B3.06 “Removing the fuel vapor separator” in the Workshop Manual).
- Take the new **Compl. vapor separator Code no. 70006135** and install it on the vehicle (as described in paragraph B3.06 “Refitting the fuel vapor separator” in the Workshop Manual).

LaFerrari Aperta

- Remove the fuel vapor separator (as described in paragraph B3.05 “Replacing the fuel vapor separator” in the Workshop Manual).
- Take the new **Compl. vapor separator Code no. 70006138** and install it on the vehicle (as described in paragraph B3.05 “Replacing the fuel vapor separator” in the Workshop Manual).

2. Repair label and Proof of Correction certificate – Only Valid for California dealers and vehicles registered in California

- IMPORTANT -

Note that all Authorized Ferrari dealers in California must fit an emissions repair label to vehicles that have had this recall completed, and provide the customer with a Proof of Correction certificate (attached). Ferrari North America will ship an initial supply of repair labels to all California dealers. If you are in an Authorized Ferrari dealer outside of California performing the recall on a vehicle registered in California, you can order the following label from FNA parts.

- Part number 079610001 – Emissions Sticker CARB

See details on how to fill out the label and certificate below. An example of the label is attached. Print a copy of the attached Proof of Correction certificate to distribute to the customer.

Repair Label:

- Campaign number: RC 69
- Dealer Code: (Enter your 4-digit dealer code)
- Date: (Enter the date on which the repair was completed)
- Recall Name/Description: Fuel Vapor Separator


NOTE: This must be filled out with an Indelible (Industrial-permanent) marker, so the writing never comes off.

Proof of Correction certificate: Print a copy and fill out all of the areas of the attached certificate & give to the customer for their records.

- License Number: (Enter the License Plate number from the vehicle)
- Make: Ferrari
- Model: (Enter the model; 488 GTB/488 Spider/488 Pista/812 Superfast/LaFerrari Aperta/GTC4Lusso/GTC4Lusso T)
- Body Type: 2-door
- Vehicle Identification Number: (Enter the 17-digit VIN)
- Manufacturer: Ferrari
- Recall Number: RC 69
- Dealer’s Name; Address, City, State: (Enter your dealer information)
- Date; Dealer’s Authorized Signature: (Enter your dealer information)

Thank you for your cooperation. Please do not hesitate to contact us if you have any questions.

Example of Emissions repair label

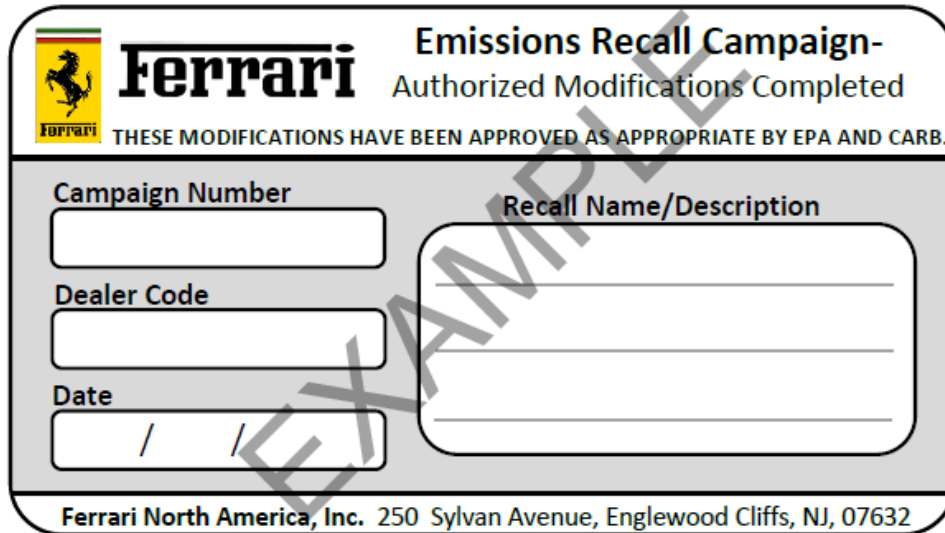

Ferrari Emissions Recall Campaign-
Authorized Modifications Completed

THESE MODIFICATIONS HAVE BEEN APPROVED AS APPROPRIATE BY EPA AND CARB.

Campaign Number	Recall Name/Description
<input type="text"/>	<input type="text"/> <hr/> <hr/> <hr/>
Dealer Code	
<input type="text"/>	
Date	
<input type="text"/>	

Ferrari North America, Inc. 250 Sylvan Avenue, Englewood Cliffs, NJ, 07632

Vehicle Emission Recall – Proof of Correction

License Number	Make	Year Model	Body Type	Vehicle Identification Number
				<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>

Manufacturer: _____

Recall Number: _____

The above described vehicle has been repaired, modified, and/or equipped with new emission control devices to meet applicable California Emission Control Laws.

Dealer' Name

Address, City, State

Date

Dealership's Authorized Signature

X

Return this certificate to DMV only when required – otherwise retain for your records.