

IMPORTANT SAFETY RECALL

Date: February 22, 2021

To: At the Beach RV & Trailer
806 US 501C
Conway, SC 29526

Subject: Safety Recall Campaign 21V061

Involving: 2021 PJ Trailers - Models C4, U6, U8, UC, UL

PJ Trailers Manufacturing, Inc. (PJ Trailers), has decided that a defect, which relates to motor vehicle safety, exists in certain 2021 PJ Trailers Models (C4, U6, U8, UC, UL). A failure of the hub subassembly on the Idler Axle from Dexter Axle could result in accidental damage to include personal injury, death and/or property damage.

Important: Enclosed as Attachment 1 is a listing of the affected trailers identified by VIN that our records indicate were shipped to you. Some of the involved trailers may still be in your inventory. Federal law requires you to complete the recall service on those trailers still in your inventory before retail delivery. **Dealer should immediately notify PJ Trailers Manufacturing, Inc. of the name and address of each person or entity to whom the Dealer has sold or delivered one of the affected trailers.** Please provide this information to PJ Trailers Manufacturing, Inc. immediately using the form in Attachment 1 and direct this to PJ Trailers Manufacturing, Inc., ATTN: Recall Office, via mail to 1807 FM 2352, Sumner, Texas 75486; via fax to (903)785-6898; or via email to recall@pjtrailers.com. When PJ Trailers Manufacturing, Inc. receives this information, those persons or entities will be notified by mail about the recall and will be instructed to contact PJ Trailer Manufacturing, Inc. toll free at (888)330-8106; or by email at recall@pjtrailers.com to schedule the required recall service.

Instructions regarding the inspection and potential replacement of the Dexter Axle Idler Axle are outlined in the attached Service Alert Bulletin. Contact PJ Trailers' Warranty Department with any questions regarding the inspection and/or repair toll free at (888)330-8106 or by email at recall@pjtrailer.com.



1807 FM 2352
Sumner, TX 75486
(903) 785-6879
(903) 785-6898
www.pjtrailers.com

PJ Trailers Manufacturing, Inc. is providing you with a Repair Confirmation Form. Complete this form for each axle replacement you perform. Upon finalizing the necessary replacements, you are required to return the completed Repair Confirmation Form to PJ Trailers Manufacturing, Inc. via facsimile at (903)785-6898 or email at recall@pjtrailers.com. The PJ Trailers Warranty Team will then contact you to arrange for the return of the axle(s) that were removed per the attached Service Alert Bulletin. All return shipping expenses will be paid for/reimbursed to you by PJ Trailers Manufacturing, Inc. upon shipment of the removed axle(s) to Dexter Axle.

When PJ Trailers Manufacturing, Inc. has received the completed Repair Confirmation Form and the shipment notification of the removed axles to Dexter Axle, you will be reimbursed for the repairs performed. PJ Trailers estimates it will take approximately 1.0 hour to complete the necessary repair and will require a replacement Idler Axle from Dexter Axle (including the idler hub).

Please be reminded that it is a violation of Federal law for you to sell or lease any of the affected trailers covered by this notification until this recall has been performed on the affected trailer. Substantial civil penalties apply to violations of this law.

If you have questions concerning this recall, please contact the PJ Trailers Warranty Department via email at recall@pjtrailers.com or at (888)330-8106.

Your immediate assistance in this important effort is appreciated.

PJ Trailers Manufacturing, Inc.

Encl: Attachment 1 - List of Affected Trailers Shipped to you
Service Alert Bulletin
Repair Confirmation Form

Attachment 1

List of Affected Trailers Shipped to At the Beach RV & Trailer:

VIN	3CVUC1221M2620377	In Inventory?	<input type="checkbox"/>	Sold?	<input type="checkbox"/>	Date	
Customer Name							
Address							
City / State / Zip							
Phone				Email			

VIN	3CVUC1428M262087	In Inventory?	<input type="checkbox"/>	Sold?	<input type="checkbox"/>	Date	
Customer Name							
Address							
City / State / Zip							
Phone				Email			

VIN	3CVUC1625M2620392	In Inventory?	<input type="checkbox"/>	Sold?	<input type="checkbox"/>	Date	
Customer Name							
Address							
City / State / Zip							
Phone				Email			

VIN	3CVUC0828M2620457	In Inventory?	<input type="checkbox"/>	Sold?	<input type="checkbox"/>	Date	
Customer Name							
Address							
City / State / Zip							
Phone				Email			

VIN	3CVUC1028M2620458	In Inventory?	<input type="checkbox"/>	Sold?	<input type="checkbox"/>	Date	
Customer Name							
Address							
City / State / Zip							
Phone				Email			

SERVICE ALERT BULLETIN

Alert Subject: D35 Axles with Idler Hubs

Component: Idler Hub

Initiated/created by: Approved per 2-10-21 email-Rob Gelven

Date: 9-Feb-2021

Problem Description:

PJ Trailers with idler axles may potentially have hubs missing inner bearing. The suspect axles are labeled with Dexter Axle Serial Numbers: 622463901 & 622463906 attached to the axle tube.


PJ Trailer Models Potential Impacted:
C4, C5, U6, U8, UC & UL

Idler Hub:



Containment:

- 1) For specific trailers shown on the list attached, identify the axle serial number by looking at the label attached to the axle (see below defined by first 9 digits):

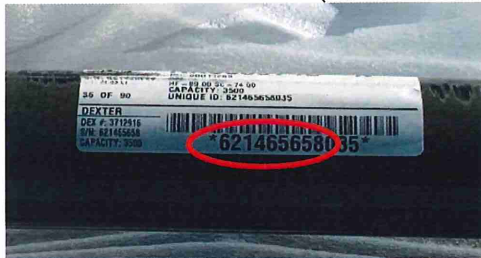

- 2) If the axle serial number matches the suspect lots (622463901 or 622463906), then evaluate the axle to confirm the presence of the inner bearing by one (1) of the methods below.
- 3) Wheel-end evaluation:
 - a. Axle with idler hub (no wheel attached): grasp the outer diameter of the idler hub and attempt to move the hub inboard and/or outboard parallel to the axle beam. Movement greater than 1/8" should be considered an inner bearing 'non-conforming' hub assembly. There will be a noticeable 'wobble' of the hub on the spindle,
 - b. Axle with wheel attached: While the trailer is sitting on the ground, grasp the top of the tire and attempt to move the entire wheel-end inboard and/or outboard. Excessive movement of the wheel-end and/or audible metal-to-metal noise will indicate a potential inner bearing 'non-conforming' hub assembly. If the evaluation is inconclusive, remove the wheel from the hub and follow step a).
- 4) All units that are confirmed with a hub missing the inner bearing should have the axle assembly replaced. Contact recall@pjtrailer.com to initiate axle replacement. Provide axle serial number affected and associate trailer VIN number.



1807 FM 2352
Sumner, TX 75486
(903) 785-6879
(903) 785-6898
www.pjtrailers.com

REPAIR CONFIRMATION FORM
SAFETY RECALL CAMPAIGN 21V061
2021 PJ Trailers - Models C4, U6, U8, UC, UL

Inspection and potential replacement - Dexter Axle Idler Axle

Upon completion of an axle replacement, you must return this form via fax to (903)785-6898; email to recall@pjtrailers.com or by mail to:

PJ Trailers Manufacturing, Inc.
ATTN: Recall Office
1807 FM 2352
Sumner, Texas 75486

Please include the following information:

VIN: _____
Date Repair Completed: _____

Name, address and telephone number of person or entity bringing trailer in for repair:

Name: _____
Address: _____
City: _____
State and Zip Code: _____
Telephone Number: _____


Name, address and telephone number of new owner of trailer (if known):

Name: _____
Address: _____
City: _____
State and Zip Code: _____
Telephone Number: _____

PJ TRAILERS
 1807 FM 2352
 Sumner, TX 75486

PLACE STICKER AT TOP OF ENVELOPE TO PROTECT
 OF THE RETURN ADDRESS. FOLD AT DOTTED LINE

CERTIFIED MAIL

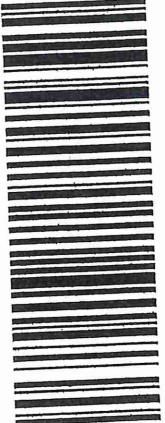

7020 1290 0001 2418 2997
 7020 1290 0001 2418 2997

U.S. Postal Service™
CERTIFIED MAIL® RECEIPT
Domestic Mail Only

For delivery information, visit our website at www.usps.com®.

OFFICIAL USE

Certified Mail Fee \$	Postmark Here	
Extra Services & Fees (check box, add fee as appropriate)		
<input type="checkbox"/> Return Receipt (hardcopy) \$		
<input type="checkbox"/> Return Receipt (electronic) \$		
<input type="checkbox"/> Certified Mail Restricted Delivery \$		
<input type="checkbox"/> Adult Signature Required \$		
<input type="checkbox"/> Adult Signature Restricted Delivery \$		
Postage \$		
Total Postage and Fees \$		
Sent <i>At the Beach RV & Trailer</i> Strē <i>806 US 501C</i> City, <i>Conway, SC 29526</i>		

PS Form 3800, April 2015 PSN 7530-02-000-9047 See Reverse for Instructions

At the Beach RV & Trailer
 806 US 501C
 Conway, SC 29526

IMPORTANT SAFETY RECALL INFORMATION

Issued in Accordance
 With Federal Law

