


HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

Subject

Inspection of the seal between the glass and frame on the following Hehr 6400 Series windows manufactured between October 1, 2018 and August 13, 2020.

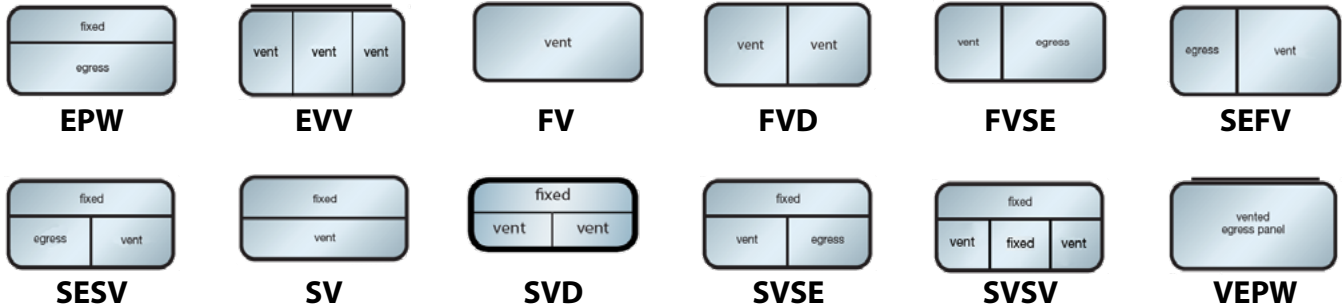

Safety

This document provides general instructions. Many variables can change the circumstances of any procedure, i.e. the degree of difficulty involved in the service operation and the ability level of the individual performing the operation. This document cannot begin to plot out procedures for every possibility, but will provide the general instructions for effectively installing, removing or servicing the system. In the event the skill level required is too advanced or the procedure too difficult, a certified technician should be consulted before performing the necessary operation. Failure to correctly install, remove or service the system may result in voiding the warranty, inflicting injury or even death.



The "WARNING" symbol above is a sign that a procedure has a safety risk involved and may cause death, serious personal injury, severe product and/or property damage if not performed safely and within the parameters set forth in this document.



The "CAUTION" symbol above is a sign that a procedure has a safety risk involved and may cause personal injury, product and/or property damage if not performed safely and within the parameters set forth in this document.

Resources Required

- Cordless or electric drill or screw gun
- Phillips screw bit
- 3/16" drill bit
- Pop rivet gun
- Ladder

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

Window Identification

Window Size

Window Size ____ X ____ = from inside trim ring RPO label or measure outside the whole/entire window
Width X Height of glass, edge-to-edge.

Egress Windows

- A. Inside the unit an EXIT sticker (Fig. 1) or red handle (Fig. 2A) will be present.
- B. Outside the unit the white backside of the EXIT sticker will be visible.

Insulated Windows

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) or a super spacer (Fig. 4A) sandwiched between two panes of glass can be seen.
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3A) is seen.

Egress and Insulated

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) can be seen or the super spacer (Fig. 4A) sandwiched between two panes of glass will be visible in addition to the EXIT sticker (Fig. 1) or red handle (Fig. 2).
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3) can be seen located above the white backside of the EXIT sticker (Fig. 1).

Fig. 1



Fig. 2


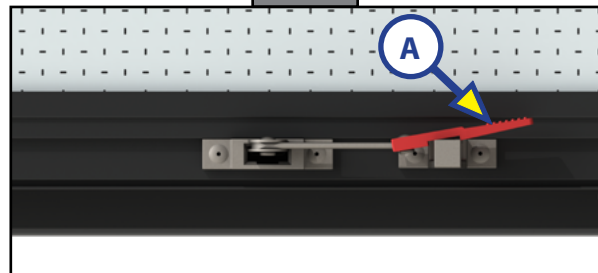


Fig. 3



Fig. 4

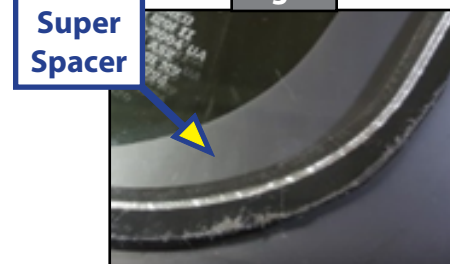

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

Inspection

The provided gauge has a colored segment at one end (Fig. 5). Use the gauge as outlined in the instructions below to determine any possible break in the seal.

1. Be sure window is in closed position.
2. Lightly insert the gauge into the gap between the glass and the frame (Fig. 6) starting near the hinge on the exterior side of the window.
3. The gauge should stop within the colored segment (Fig. 7).
4. Continue reinserting the gauge at different points, working around the glass.

NOTE: If the gauge inserts beyond the colored segment (Fig. 8) this indicates a possible break in the seal and the vent of the window will need replacing.

Fig. 5



Fig. 6



Fig. 7



Fig. 8



LIPPERT HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

Required Vent Replacement Documents

<https://lci-support-doc.s3.amazonaws.com/technical-information-sheets/windows/ccd-0003876.pdf>
<https://lci-support-doc.s3.amazonaws.com/technical-information-sheets/windows/ccd-0003877.pdf>

Action Required

Submit all claims to RV OEM.

Inspection: 0.4 hour per unit



Replacement: 0.5 hour per vent

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

Variant Codes

In each chart, the vent variant code part numbers and descriptions will be indented under the window variant code part number and description.

|   | | 6400 EPW Window Variants | |
|---|---|--------------------------|--|
| Part Number | Description | | |
| V000486280 | 6403 EPW 36 X 24 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 782312 | VENT / EXIT 6403-30 EPW 36.0 X 170 BK TP G20 4.000 RADII | | |
| V000486504 | 6423 EPW 36 X 26 X 17 G20 TP INS BK W/SCR N 3.1875 RADII | | |
| 2020126682 | VENT/EXIT 6423-30 EPW 36.0 X 170 BK TP G20 4.000 RADII | | |
| V000486274 | 6403 EPW 27.4 X 25.2 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 2020222310 | VENT / EXIT 6403-30 EPW 27.4 X 170 BK TP G20 4.000 RADII | | |
| V000486279 | 6403 EPW 34 X 52 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 2020131438 | VENT / EXIT 6403-30 EPW 34.0 X 17.0 BK TP G20 4.000 RADII | | |
| V000486272 | 6403 EPW 27 X 35 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 808835 | VENT / EXIT 6403-30 EPW 27.0 X 170 BK TP G20 4.000 RADII | | |
| V000495556 | 6403 EPW 37 X 39.5 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 2021097038 | VENT / EXIT 6403-30 EPW 37.0 X 17.0 BK TP G20 4.000 RADII | | |
| V000496631 | 6423 EPW 37.3 X 40 X 17 G20 TP INS BK W/SCR N 3.1875 RADII | | |
| 2021097081 | VENT EXIT 6423-30 EPW 37.3 X 17.0 BK TP G20 4.000 RADII | | |
| V000486284 | 6403 EPW 37.3 X 40 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 771648 | VENT / EXIT 6403-30 EPW 37.3 X 170 BK TP G20 4.000 RADII | | |
| V000486270 | 6403 EPW 27 X 33 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 808835 | VENT / EXIT 6403-30 EPW 27.0 X 170 BK TP G20 4.000 RADII | | |
| V000486276 | 6403 EPW 30 X 24 X 17 G20 TP INS BK NO SCR N 3.1875 RADII | | |
| 801590 | VENT / EXIT 6403-30 EPW 30.0 X 170 BK TP G20 4.000 RADII | | |


HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 EVV Window Variants

| Part Number | Description |
|-------------|--|
| 757126 | 1-6499-00-0-215-715-000-0-3535-0111-0284 |
| 794943 | 6499-0284 SPECIAL SHAPE 72.0 X 22.0 BK P VNT TP INS 1/8 G20 4.000 RADII |
| 2021099711 | RIGHT VENT 6499-30-R-0284 SPECIAL SHAPE 72.0 X 22.0 G20 TP INS BK 4.000 RADII |
| 2021098471 | CENTER VENT 6499-30-C-0284 SPECIAL SHAPE 72.0 X 22.0 G20 TP INS BK 4.000 RADII |




6400 FV Window Variants

| Part Number | Description |
|-------------|--|
| V000486606 | 6451 FV 36.3 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096780 | VENT 6451-40 FV 36.3 X 20.3 BK TP G20 4.000 RADII |
| V000490365 | 6451 FV 24 X 14 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096781 | VENT 6451-40 FV 24.0 X 14.0 BK TP G20 4.000 RADII |
| V000486550 | 6451 FV 24 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 789116 | 6451 FV 24.0 X 15.0 BK Y VNT TP INS G20 4.000 RADII |
| V000486597 | 6451 FV 36 X 18 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020134495 | VENT / ELEVATED 6451-40-E FV 36.0 X 18.0 BK TP G20 4.000 RADII |
| V000486513 | 6451 FV 16.1 X 24 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111562 | 6451-40-Y FV VENT (TRI-SEAL) 16.1 X 24.0 BK TP G20 4.000 RADII |
| V000486573 | 6451 FV 28.2 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021026886 | VENT / ELEVATED 6451-40-E FV 28.0 X 12.0 BK G20 TP 4.000 RADII |
| V000486517 | 6451 FV 17 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096782 | VENT 6451-40 FV 17.0 X 12.2 BK TP G20 4.000 RADII |
| V000486588 | 6451 FV 30 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096783 | VENT 6451-40 FV 30.0 X 24.0 BK TP G20 4.000 RADII |
| V000486556 | 6451 FV 24 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020124800 | 6451-40-235-235-3535-9331 |
| V000486519 | 6451 FV 18 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096785 | VENT 6451-40 FV 18.0 X 18.0 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |




6400 FV Window Variants (Cont'd)

| Part Number | Description |
|-------------|--|
| V000486541 | 6451 FV 18.3 X 26.4 G205 TP INS BK SKB W/SCRN 3.1875 RADII |
| 790786 | 6451 FV 18.3 X 26.4 BK VNT TP INS G20 4.000 RADII |
| 757121 | 1-6499-00-0-215-355-000-0-3535-0111-0175 |
| 2021097097 | VENT EXIT 6499-30-0175 VEPW 36.0 X 22.0 BK TP G20 4.000 RADII |
| V000486529 | 6451 FV 18.1 X 31.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104689 | VENT ONLY 6402-40 18.1 X 31.3 G20 TP INS BK 4.000 RADII |
| V000486543 | 6451 FV 21.2 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 786883 | 6451-40-117-207-3535-9331 |
| V000486599 | 6451 FV 36 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096794 | VENT 6451-40 FV 36.0 X 22.0 BK TP G20 4.000 RADII |
| V000486547 | 6451 FV 24 X 15 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 789116 | 6451 FV 24.0 X 15.0 BK Y VNT TP INS G20 4.000 RADII |
| V000486509 | 6451 FV 15.3 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 774071 | 6451 FV 15.3 X 20.3 BK VNT TP INS 1/8" G20 1/8" CL 4.000 RADII |
| V000494872 | 6451 FV 30.2 X 15.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 757151 | 1-6499-00-0-235-355-170-E-3535-0111-0020 |
| V000486590 | 6451 FV 32 X 14 G205 TP INS BK SKB W/SCRN 3.1875 RADII |
| 859265 | VENT 6451-40 32.0 X 14.0 BK TP G20 4.000 RADII |
| V000486521 | 6451 FV 18 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 798327 | 6451 FV 18.0 X 24.0 BK VNT TP INS 1/8 G20 4.000 RADII |
| V000486545 | 6451 FV 22.6 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020043704 | VENT ONLY 6451-40 22.6 X 26.0 G20 TP INS BK 4.000 RADII |
| V000486575 | 6451 FV 28.2 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 790665 | 6451 FV 28.2 X 18.0 BK VNT TP INS G20 4.000 RADII |
| V000486530 | 6451 FV 18.1 X 31.3 G20/OBS TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104689 | VENT ONLY 6402-40 18.1 X 31.3 G20 TP INS BK 4.000 RADII |
| V000486533 | 6451 FV 18.2 X 24.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 803937 | 6451 FV 18.2 X 24.2 BK VNT TP INS 1/8 OBS 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 FV Window Variants (Cont'd)

| Part Number | Description |
|-------------|--|
| V000486602 | 6451 FV 36 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111903 | VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII |
| V000486577 | 6451 FV 28.2 X 23 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 772251 | 6451 FV 28.2 X 23.0 BK VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000486571 | 6451 FV 27 X 26 G20/OBS TP INS BK SKB W/SCRN 3.1875 RADII |
| 810406 | 6451 VENT FV 27.0 X 26.0 BK TP G20 4.000 RADII |
| V000486594 | 6451 FV 36 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096795 | VENT 6451-40 FV 36.0 X 18.0 BK TP G20 4.000 RADII |
| V000486566 | 6451 FV 27 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 813290 | VENT 6451-40 27.0 X 20.3 BK TP G20 4.000 RADII |



6400 FVD Window Variants

| Part Number | Description |
|-------------|---|
| V000486664 | 6452 FVD 48 X 24 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111080 | Z-VENT 6452-40-Z 48.0 X 24.0 BK TP G20 4.000 RADII |
| 771877 | X-VENT 6452-40-X 48.0 X 24.0 BK TP G20 4.000 RADII |
| V000486642 | 6452 FVD 48 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020000147 | VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 2020002736 | LEFT VENT 6452-40 48.0 X 15.0 G20 TP INS BK 4.000 RADII |
| V000486610 | 6452 FVD 36 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 804557 | 6452 FVD 36.0 X 24.0 BK R VNT TP INS 1/8" G20 4.000 RADII |
| 804558 | 6452 FVD 36.0 X 24.0 BK P VNT TP INS 1/8" G20 4.000 RADII |
| V000486690 | 6452 FVD 60 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020220003 | VENT / LEFT 6452-40-P FVD 60.0 X 26.0 BK TP G20 4.000 RADII |
| 790662 | 6452 FVD 60.0 X 26.0 BK R VNT TP INS G20 4.000 RADII |
| V000486630 | 6452 FVD 42 X 26.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096822 | VENT RIGHT 6452-40-R FVD 42.0 X 26.3 BK TP G20 4.000 RADII |
| 2021096823 | VENT LEFT 6452-40-P FVD 42.0 X 26.3 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 FVD Window Variants

| Part Number | Description |
|-------------|---|
| V000487703 | 6452 FVD 72 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020125840 | X-VENT 6452-40-X FVD 72.0 X 15.0 BK TP G20 4.000 RADII |
| 811928 | Z-VENT 6452-40-Z FVD 72.0 X 15.0 BK TP G20 4.000 RADII |
| V000486675 | 6452 FVD 54 X 25 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 802692 | 6452-40-245-535-R-3535-9331 |
| 806698 | 6452-40-245-535-P-3535-9331 |
| V000486686 | 6452 FVD 60 X 22 G205 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096819 | VENT RIGHT 6452-40-R FVD 60.0 X 22.0 BK TP G20 4.000 RADII |
| 2021096821 | VENT LEFT 6452-40-P FVD 60.0 X 22.0 BK TP G20 4.000 RADII |
| V000486624 | 6452 FVD 42 X 15 G20 PT INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 802961 | VENT/RIGHT/ ELEVATED, 6452-40-Z FVD 42.0 X 15.0 BK TP G20 4.000 RADII |
| 852250 | X-VENT 6452 42.0 X 15.0 BK TP G20 4.000 RADII |
| V000486655 | 6452 FVD 48 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 770490 | 3-6452-40-0-215-475-000-Z-3535-9331-0000 |
| 797455 | 6452 FVD 48.0 X 22.0 BK P VNT TP INS 1/8 G20 4.000 RADII |
| V000492706 | 6452 FVD 70 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020125840 | X-VENT 6452-40-X FVD 72.0 X 15.0 BK TP G20 4.000 RADII |
| 811928 | Z-VENT 6452-40-Z FVD 72.0 X 15.0 BK TP G20 4.000 RADII |
| V000486619 | 6452 FVD 40 X 16 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 770213 | 3-6452-40-0-155-395-000-R-3535-9331-0000 |
| 772789 | 6452 FVD 40.0 X 16.0 BK P VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000486660 | 6452 FVD 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 788995 | 6452 FVD 48.0 X 24.0 BK R VNT INS TP 5/32 G20 4.000 RADII |
| 788996 | 6452 FVD 48.0 X 24.0 BK P VNT INS TP 5/32 G20 4.000 RADII |
| V000494765 | 6452 FVD 64 X 26.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 798960 | 6452 FVD 64.0 X 26.2 BK R VNT TP INS 1/8 G20 4.000 RADII |
| 782314 | 6452 FVD 64.0 X 26.2 BK P VNT TP INS 1/8" G20 SC 1/8" CL 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

6400 FVD Window Variants (Cont'd)

| Part Number | Description |
|-------------|---|
| V000486667 | 6452 FVD 48 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021099708 | LEFT VENT 6452-40-P 48.0 X 26.0 G20 TP INS BK 4.000 RADII |
| 771110 | 6452 FVD 48.0 X 26.0 BK R VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000492679 | 6452 FVD 53.7 X 26.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096826 | VENT RIGHT 6452-40-R FVD 53.7 X 26.2 BK TP G20 4.000 RADII |
| 2021096827 | VENT LEFT 6452-40-P FVD 53.7 X 26.2 BK TP G20 4.000 RADII |
| V000486682 | 6452 FVD 58 X 15.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096829 | VENT RIGHT 6452-40-R FVD 58.0 X 15.1 BK TP G20 4.000 RADII |
| 2021096830 | VENT LEFT 6452-40-P FVD 58.0 X 15.1 BK TP G20 4.000 RADII |
| V000495345 | 6452 FVD 60 X 20 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096833 | VENT RIGHT 6452-40-R FVD 60.0 X 20.0 BK TP G20 4.000 RADII |
| 2021096837 | VENT LEFT 6452-40-P FVD 60.0 X 20.0 BK TP G20 4.000 RADII |
| V000487701 | 6452 FVD 60 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020105304 | 6452-40-145-595-X-3535-9331 |
| 811313 | 6452-40-145-595-Z-3535-9331 |
| V000486684 | 6452 FVD 58 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 796984 | 6452 FVD 58.0 X 24.0 BK P VNT TP INS 1/8 G20 4.000 RADII |
| 794945 | 6452 FVD 58.0 X 24.0 BK R VNT TP INS 1/8 G20 4.000 RADII |
| V000486671 | 6452 FVD 48 X 30 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096824 | VENT RIGHT 6452-40-R FVD 48.0 X 30.0 BK TP G20 4.000 RADII |
| 2021096825 | VENT LEFT 6452-40-P FVD 48.0 X 30.0 BK TP G20 4.000 RADII |
| V000486669 | 6452 FVD 48 X 28 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020101527 | RIGHT VENT ONLY 6452-40 48.0 X 28.0 G20 INS TP BK 4.000 RADII |
| 2020329390 | VENT / LEFT 6452-40-P FVD 48.0 X 28.0 G20 TP BK 4.000 RADII |
| V000486633 | 6452 FVD 44 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020220005 | VENT / RIGHT 6452-40-R FVD 44.0 X 24.0 BK TP G20 4.000 RADII |
| 2020220007 | VENT / LEFT 6452-40-P FVD 44.0 X 24.0 BK TP G20 4.000 RADII |
| V000486688 | 6452 FVD 60 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020220008 | VENT / RIGHT 6452-40-R FVD 60.0 X 22.3 BK TP G20 4.000 RADII |
| 2020220009 | VENT / LEFT 6452-40-P FVD 60.0 X 22.3 BK TP G20 4.000 RADII |


LIPPERT HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |

| <div style="display: flex; justify-content: space-between; align-items: center;"> <div style="border: 1px solid black; padding: 2px;">vent</div> <div style="border: 1px solid black; padding: 2px;">egress</div> </div> <div style="text-align: center; margin-top: 5px;">6400 FVSE Window Variants</div> | |
|--|--|
| Part Number | Description |
| V000487728 | 6475 FVSE 64 X 32 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII |
| 863134 | 6475-46-315-635-P-3535-9331 |
| 2021027604 | LEFT VENT 6475-46-P FVSE 58.0 X 24.0 G20 TP BK 4.000 RADII |
| V000486869 | 6475 FVSE 58 X 24 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021027604 | 6475-46-235-575-P-3535-9331 |
| 2021097008 | VENT / EXIT / RIGHT 6475-36-R SVSE 58.0 X 24.0 BK TP G20 4.000 RADII |
| V000486865 | 6475 FVSE 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021097010 | VENT / LEFT 6475-40-P SVSE 48.0 X 24.0 BK TP G20 4.000 RADII |
| 2021097011 | VENT / EXIT / RIGHT 6475-30-R SVSE 48.0 X 24.0 BK TP G20 4.000 RADII |
| V000488011 | 6475 FVSE 68 X 20 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021097012 | VENT / LEFT 6475-46-P SVSE 68.0 X 20.0 BK TP G20 4.000 RADII |
| 2021097014 | VENT / EXIT / RIGHT 6475-36-R SVSE 68.0 X 20.0 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |




6400 SEFV Window Variants

| Part Number | Description |
|-------------|--|
| V000486726 | 6454 SEFV 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020102131 | LEFT EXIT VENT ONLY 6454-30 48.0 X 24.0 G20 TP INS BK 4.000 RADII |
| 2020129480 | VENT, RIGHT 6454-40-R 48.0 X 24.0 BK TP G20 4.000 RADII |
| V000486747 | 6454 SEFV 60 X 22 G205 EVEN TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096958 | VENT / RIGHT 6454-46-R SESV 60.0 X 22.0 BK TP G20 4.000 RADII |
| 2021096959 | VENT / EXIT / LEFT 6454-36-P SESV 60.0 X 22.0 BK TP G20 4.000 RADII |
| V000486707 | 6454 SEFV 42 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096960 | VENT / RIGHT 6454-40-R SESV 42.0 X 22.0 BK TP G20 4.000 RADII |
| 2021096962 | VENT / EXIT / LEFT 6454-30-P SESV 42.0 X 22.0 BK TP G20 4.000 RADII |
| V000486734 | 6454 SEFV 53.7 X 22.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096963 | VENT / RIGHT 6454-40-R SESV 53.7 X 22.1 BK TP G20 4.000 RADII |
| 2021096964 | VENT / EXIT / LEFT 6454-30-P SESV 53.7 X 22.1 BK TP G20 4.000 RADII |
| V000486723 | 6454 SEFV 48 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020131878 | VENT/RIGHT/ELEVATED 6454-40-Z 48.0 X 22.0 BK TP G20 4.000 RADII |
| 862993 | LEFT EXIT VENT 6454-30-P 48.0 X 22.0 G20 TP INS BK EL OP 4.000 RADII |
| 757192 | 1-6499-00-0-260-415-000-0-3535-0111-0296 |
| 2020104690 | 6499-30-260-415-P-3535-9331-0296 |
| 792711 | 6499-40-260-415-R-3535-9331-0296 |
| V000486715 | 6454 SEFV 42 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 806963 | R VENT 6452 SESV 42.0 X 24.0 BK TP 1/8" G20 4.000 RADII |
| 2021099709 | LEFT VENT 6454-40-P 42.0 X 24.0 G20 TP INS BK 4.000 RADII |
| V000486711 | 6454 SEFV 42 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 787744 | 6454 SESV 42.0 X 22.3 BK R VNT TP INS G20 4.000 RADII |
| 2021099710 | LEFT VENT 6454-40-P 42.0 X 22.3 G20 TP INS BK 4.000 RADII |
| V000486741 | 6454 SEFV 60 X 26.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020002957 | RIGHT VENT 6454-40 60.0 X 26.3 G20 TP INS BK 4.000 RADII |
| 2020002958 | LEFT VENT 6454-30 60.0 X 26.3 G20 TP INS BK 4.000 RADII |
| V000496255 | 6454 SEFV 44 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096965 | VENT / RIGHT 6454-40-R SESV 44.0 X 24.0 BK TP G20 4.000 RADII |
| 2021096974 | VENT / EXIT / LEFT 6454-30-P SESV 44.0 X 24.0 BK TP G20 4.000 RADII |

LIPPERT HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 SEFV Window Variants (Cont'd)

| Part Number | Description |
|-------------|---|
| 757137 | 1-6499-00-0-220-715-000-0-3535-0111-0292 |
| 771095 | 6499-40-220-715-R-3535-9331-0292 |
| 852138 | 6499-40-220-715-P-3535-9331-0292 |
| V000496413 | 6454 SEFV 60 X 20 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020129649 | VENT/EXIT/LEFT, 6454-36-P 60.0 X 20.0 BK TP G20 4.000 RADII |
| 2021099711 | RIGHT VENT 6454-36-R 60.0 X 20.0 G20 TP INS BK 4.000 RADII |
| V000486703 | 6454 SEFV 42 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020121298 | P-EXIT 6454-30 SESV 42.0 X 20.3 BK TP G20 4.000 RADII |
| 790664 | 6454 SESV 42.0 X 20.3 BK R VNT TP INS G20 4.000 RADII |
| V000486737 | 6454 SEFV 60 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096975 | VENT / RIGHT 6454-40-R SESV 60.0 X 22.3 BK TP G20 4.000 RADII |
| 2021096976 | VENT / EXIT / LEFT 6454-30-P SESV 60.0 X 22.3 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |




6400 SESV Window Variants

| Part Number | Description |
|-------------|---|
| V000486313 | 6404 SESV 42 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 769667 | VENT RIGHT 6404-40-R SESV 42.0 X 170 BK TP G20 4.000 RADII |
| 2020001429 | 6404-30-000-415-170-P-3535-9331 |
| V000486330 | 6404 SESV 48 X 29 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020106417 | VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 812649 | VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII |
| V000486329 | 6404 SESV 48 X 24 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020106417 | VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 812649 | VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII |
| V000486352 | 6404 SESV 60 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 800787 | VENT RIGHT 6404-40-R SESV 60.0 X 170 BK TP G20 4.000 RADII |
| 800786 | VENT EXIT LEFT 6404-30-P SESV 60.0 X 170 BK TP G20 4.000 RADII |
| V000486330 | 6404 SESV 48 X 29 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020106417 | VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 812649 | VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII |
| V000486338 | 6404 SESV 48 X 33 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020106417 | VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 812649 | VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII |
| V000489502 | 6404 SESV 54 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021097057 | VENT RIGHT 6404-40-R SESV 54.0 X 17.0 BK TP G20 4.000 RADII |
| 2021097058 | VENT EXIT LEFT 6404-30-P SESV 54.0 X 17.0 BK TP G20 4.000 RADII |
| V000486353 | 6404 SESV 60 X 38 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 800787 | VENT RIGHT 6404-40-R SESV 60.0 X 170 BK TP G20 4.000 RADII |
| 800786 | VENT EXIT LEFT 6404-30-P SESV 60.0 X 170 BK TP G20 4.000 RADII |
| V000486325 | 6404 SESV 48 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 800888 | VENT RIGHT 6404-40-R SESV 48.0 X 170 BK TP G20 4.000 RADII |
| 812649 | VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII |
| V000486359 | 6404 SESV 64 X 34 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096963 | VENT / RIGHT 6454-40-R SESV 53.7 X 22.1 BK TP G20 4.000 RADII |
| 2021096964 | VENT / EXIT / LEFT 6454-30-P SESV 53.7 X 22.1 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |




6400 SV Window Variants

| Part Number | Description |
|-------------|---|
| V000486076 | 6401 SV 18 X 16 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020002384 | VENT / ELEVATED 6401-40-Y SV 36.0 X 081 BK TP G20 4.000 RADII |
| V000486085 | 6401 SV 18 X 28 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111565 | VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII |
| V000486095 | 6401 SV 24 X 18 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 805295 | VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII |
| V000486096 | 6401 SV 24 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 805295 | VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII |
| V000486100 | 6401 SV 24 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 805295 | VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII |
| V000486132 | 6401 SV 30 X 30 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 786621 | VENT / ELEVATED 6401-40-Y SV 30.0 X 081 BK TP G20 4.000 RADII |
| 757204 | 1-6499-00-0-291-175-141-0-3535-5341-0209 |
| 789313 | 6499-0209 SPECIAL SHAPE 17.7 X 29.4 X 141 BK VNT INS TP GRN 4.000 RADII |
| V000486136 | 6401 SV 36 X 15.1 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020002384 | VENT / ELEVATED 6401-40-Y SV 36.0 X 081 BK TP G20 4.000 RADII |
| 757309 | 1-6499-00-0-475-265-170-0-3535-0111-0281 |
| 2021097090 | VENT EXIT 6499-30-0281 EPW 27.0 X 48.0 X 17.0 BK TP G20 4.000 RADII |
| V000486104 | 6401 SV 24.2 X 18.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021097018 | VENT ONLY 6401-40 SV 24.2 X 081 BK TP G20 4.000 RADII |
| V000486069 | 6401 SV 15.3 X 20.3 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 800802 | VENT ONLY 6401-40 SV 15.3 X 081 BK TP G20 4.000 RADII |
| V000486099 | 6401 SV 24 X 29 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104607 | VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII |
| V000486108 | 6401 SV 27 X 27 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 769675 | VENT / ELEVATED 6401-40-Y SV 27.0 X 081 BK TP G20 4.000 RADII |
| V000486075 | 6401 SV 18 X 15 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111565 | VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII |
| V000486083 | 6401 SV 18 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111565 | VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII |
| V000486100 | 6401 SV 24 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 805295 | VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |




6400 SV Window Variants (Cont'd)

| Part Number | Description |
|-------------|---|
| V000486133 | 6401 SV 30 X 35 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 786621 | VENT / ELEVATED 6401-40-Y SV 30.0 X 081 BK TP G20 4.000 RADII |
| V000486079 | 6401 SV 18 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001431 | 6401-40-000-175-081-3535-9331 |
| V000486111 | 6401 SV 27 X 35 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104608 | 6401-40-000-265-081-3535-9331 |
| V000486124 | 6401 SV 30 X 20 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 812648 | VENT ONLY 6401-40 SV 30.0 X 081 BK TP G20 4.000 RADII |
| 757269 | 6499-0060 SPECIAL SHAPE 14.0 X 38.1 X 101 BK TP GRN 3.188 RADII |
| 770606 | 3-6499-40-0-376-135-101-0-3535-0041-0060 |
| 757302 | 1-6499-00-0-455-155-170-0-3535-0111-0180 |
| 2021097140 | VENT 6499-40-0180 SV 16.0 X 46.0 X 170 BK TP G20 4.000 RADII |
| V000493199 | 6401 SV 18 X 15.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001830 | VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000 |
| V000493195 | 6401 SV 36 X 15.1 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020101668 | VENT ONLY 6401-40 SV 36.0 X 081 BK TP G20 4.000 RADII |
| V000487690 | 6401 SV 18 X 35 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001830 | VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000 |
| V000486081 | 6401 SV 18 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020111565 | 6401-40-000-175-081-Y-3535-9331 |
| V000486088 | 6401 SV 18 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001830 | VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000 |
| V000496288 | 6401 SV 18.1 X 36.7 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 800351 | VENT ONLY 6401-40 SV 18.1 X 081 BK TP G20 4.000 RADII |
| V000486080 | 6401 SV 18 X 20 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001830 | VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000 |

LIPPERT HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 SV Window Variants (Cont'd)

| Part Number | Description |
|-------------|---|
| 757113 | 1-6499-00-0-215-121-081-0-3535-0111-0321 |
| 2021097144 | VENT ELEVATED 6499-40-Y-0321 SV 12.3 X 22.0 X 081 BK TP G20 4.000 RADII |
| V000486102 | 6401 SV 24 X 52.3 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104607 | VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII |
| 757116 | 1-6499-00-0-215-121-081-E-3535-0111-0321 |
| 2021097144 | VENT ELEVATED 6499-40-Y-0321 SV 12.3 X 22.0 X 081 BK TP G20 4.000 RADII |
| V000486110 | 6401 SV 27 X 33 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104608 | VENT ONLY 6401-40 SV 27.0 X 081 BK TP G20 4.000 RADII |
| V000486098 | 6401 SV 24 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104607 | VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII |
| V000497174 | 6401 SV 16 X 28 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 770214 | VENT ONLY 6401-40 SV 16.0 X 081 BK TP G20 4.000 RADII |
| V000486519 | 6451 FV 18 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021096785 | VENT 6451-40 FV 18.0 X 18.0 BK TP G20 4.000 RADII |
| 757097 | 1-6499-00-0-195-295-000-0-3535-0111-0173 |
| 2021097124 | VENT EXIT 6499-30-0173 VEPW 30.0 X 20.0 BK TP G20 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 SVD Window Variants

| Part Number | Description |
|-------------|--|
| V000486183 | 6402 SVD 48 X 30 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104158 | VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 2020104159 | VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII |
| V000486181 | 6402 SVD 48 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 799857 | VENT / LEFT / ELEVATED 6402-40-X SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 804550 | VENT / RIGHT / ELEVATED 6402-40-Z SVD 48.0 X 081 BK TP G20 4.000 RADII |
| V000486185 | 6402 SVD 48 X 33 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 799857 | VENT / LEFT / ELEVATED 6402-40-X SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 804550 | VENT / RIGHT / ELEVATED 6402-40-Z SVD 48.0 X 081 BK TP G20 4.000 RADII |
| V000486199 | 6402 SVD 53.7 X 22.1 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 774276 | VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII |
| 774276 | VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII |
| V000486189 | 6402 SVD 48 X 36 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104158 | VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 2020104159 | VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII |
| V000486233 | 6402 SVD 60 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2020002737 | VENT LEFT 6402-40-P SVD 60.0 X 081 BK TP G20 4.000 RADII |
| 2021012560 | VENT RIGHT 6402-40-Z SVD 60.0 X 081 G20 TP BK 4.000 RADII |
| V000486215 | 6402 SVD 57 X 20 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 770705 | VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII |
| 770706 | VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII |
| V000486216 | 6402 SVD 57 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 770705 | VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII |
| 770706 | VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII |
| V000486176 | 6402 SVD 48 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020001433 | 6402-40-000-475-081-R-3535-9331 |
| 2020001436 | 6402-40-000-475-081-P-3535-9331 |
| V000491995 | 6402 SVD 60 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020002737 | 6402-40-000-595-081-P-3535-9331 |
| 774073 | 6402-40-000-595-081-R-3535-9331 |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 SVD Window Variants (Cont'd)

| Part Number | Description |
|-------------|--|
| V000486258 | 6402 SVD 65 X 30.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 809495 | VENT RIGHT 6402-40-R SVD 65.0 X 17.0 BK TP G20 4.000 RADII |
| 773803 | VENT LEFT 6402-40-P SVD 65.0 X 081 BK TP G20 4.000 RADII |
| V000486160 | 6402 SVD 42 X 29 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021000283 | VENT/ RIGHT 6402-40-R SVD 42.0 X 081 G20 TP BK 4.000 RADII |
| 805391 | VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP G20 4.000 RADII |
| V000486196 | 6402 SVD 48.1 X 30.4 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021097029 | VENT RIGHT 6402-40-R SVD 48.1 X 170 BK TP G20 4.000 RADII |
| 2021097030 | VENT LEFT 6402-40-P SVD 48.1 X 170 BK TP G20 4.000 RADII |
| V000486238 | 6402 SVD 60 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 771699 | VENT LEFT 6402-40-P SVD 60.0 X 170 BK TP G20 4.000 RADII |
| 772862 | VENT RIGHT 6402-40-R SVD 60.0 X 170 BK TP G20 4.000 RADII |
| V000492692 | 6402 SVD 65 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 809055 | VENT / LEFT / ELEVATED 6402-40-X 65.0 X 081 BK TP G20 4.000 RADII |
| 809061 | VENT / RIGHT / ELEVATED 6402-40-Z 65.0 X 081 BK TP G20 4.000 RADII |
| V000486174 | 6402 SVD 48 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104158 | VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 2020104159 | VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII |
| V000486233 | 6402 SVD 60 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII |
| 2021012559 | 6402-40-000-595-081-X-3535-9331 |
| 2021012560 | 6402-40-000-595-081-Z-3535-9331 |
| V000486268 | 6402 SVD 72 X 30 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020106116 | VENT LEFT 6402-40-P SVD 72.0 X 081 G20 BK TP G20 4.000 RADII |
| 770199 | VENT RIGHT 6402-40-R SVD 72.0 X 081 BK TP G20 4.000 RADII |
| V000486159 | 6402 SVD 42 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2021000283 | VENT/ RIGHT 6402-40-R SVD 42.0 X 081 G20 TP BK 4.000 RADII |
| 805391 | VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP G20 4.000 RADII |
| V000486184 | 6402 SVD 48 X 31 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020104158 | VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII |
| 2020104159 | VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|----------------|------------------------------|-------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |


| <div style="display: flex; align-items: center;"> <div style="border: 1px solid black; border-radius: 10px; padding: 2px; margin-right: 10px;"> <div style="text-align: center; font-size: 8px;">fixed</div> <div style="display: flex; justify-content: space-between; font-size: 8px;"> vent vent </div> </div> <div style="text-align: center;">6400 SVD Window Variants (Cont'd)</div> </div> | |
|---|--|
| Part Number | Description |
| 757304 | 1-6499-00-0-455-715-170-0-3535-0111-0178 |
| 2021097100 | VENT RIGHT 6499-40-R-0178 72.0 X 46.0 X 17.0 BK TP G20 4.000 RADII |
| 2021097113 | VENT LEFT 6499-40-P-0178 72.0 X 46.0 X 17.0 BK TP G20 4.000 RADII |

| <div style="display: flex; align-items: center;"> <div style="border: 1px solid black; border-radius: 10px; padding: 2px; margin-right: 10px;"> <div style="text-align: center; font-size: 8px;">fixed</div> <div style="display: flex; justify-content: space-between; font-size: 8px;"> vent egress </div> </div> <div style="text-align: center;">6400 SVSE Window Variants</div> </div> | |
|---|--|
| Part Number | Description |
| V000494826 | 6405 SVSE 58 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020328858 | VENT EXIT RIGHT 6405-30-R SVSE 58.0 X 170 BK TP G20 4.000 RADII |
| 785513 | VENT LEFT 6405-40-P SVSE 58.0 X 170 BK TP G20 4.000 RADII |
| V000493200 | 6405 SVSE 42 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 808955 | VENT EXIT RIGHT 6405-30-R SVSE 42.0 X 170 BK TP G20 4.000 RADII |
| 2020134629 | VENT LEFT 6405-40-P SVSE 42.0 X 170 BK TP G20 4.000 RADII |
| V000486369 | 6405 SVSE 58 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII |
| 2020328858 | VENT EXIT RIGHT 6405-30-R SVSE 58.0 X 170 BK TP G20 4.000 RADII |
| 785513 | VENT LEFT 6405-40-P SVSE 58.0 X 170 BK TP G20 4.000 RADII |
| 757152 | 1-6499-00-0-235-355-170-E-3535-9331-0020 |
| 806053 | 6499-30-R-0020 EXIT/VENT 36.0 X 24.0 X 170 BK 1/8" G20 INS 4.000 RADII |
| 853120 | P-VENT 6499-40-0020 36.0 X 24.0 X 170 BK TP G20 4.000 RADII |

| <div style="display: flex; align-items: center;"> <div style="border: 1px solid black; border-radius: 10px; padding: 2px; margin-right: 10px;"> <div style="text-align: center; font-size: 8px;">fixed</div> <div style="display: flex; justify-content: space-between; font-size: 8px;"> vent fixed vent </div> </div> <div style="text-align: center;">6400 SVSV Window Variants</div> </div> | |
|--|---|
| Part Number | Description |
| 757311 | 1-6499-00-0-475-595-170-0-3535-0111-0094 |
| 801306 | 6499-0094 SVT 60.0 X 48.0 X 170 BK R VNT TP INS 1/8 G20 4.000 RADII |
| 2021017812 | VENT 6499-40-P-0094 SVSV 60.0 X 48.0 X 170 G20 TP BK 4.000 RADII |
| 757245 | 1-6499-00-0-335-635-170-0-3535-0111-0176 |
| 797137 | 3-6499-40-0-335-635-170-C-3535-9331-0176 |

HEHR 6400 SERIES WINDOW VENT RECALL

| | | | |
|-----------------------|------------------------------|--------------------|---|
| Recall Number: | 21E047 | | |
| Product: | Hehr 6400 Series Window Vent | | |
| Date: | June 29, 2021 | Labor Rate: | Inspection 0.4 hour per unit Replacement 0.5 hour per vent |



6400 VEPW Window Variants

| Part Number | Description |
|-------------|--|
| V000486848 | 6473 VEPW 30 X 30 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2021097001 | VENT / EXIT 6473-30 VEPW 30.0 X 30.0 BK TP G20 4.000 RADII |
| V000486850 | 6473 VEPW 36 X 22 G20 TP INS BK W/SCRN 3.1875 RADII |
| 772346 | 6473 VEPW 36.0 X 22.0 BK EXIT/VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000486694 | 6453 VEPW 27 X 26 G20 TP INS BK NO SCRN 3.1875 RADII |
| 2021096842 | VENT / EXIT 6453-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII |
| V000486833 | 6473 VEPW 27 X 22 G20 TP INS BK W/SCRN 3.1875 RADII |
| 772932 | 6473 VEPW 27.0 X 22.0 BK EXIT/VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000486693 | 6453 VEPW 27 X 22 G20 TP INS BK NO SCRN 3.1875 RADII |
| 773218 | 6453 VEPW 27.0 X 22.0 BK EXIT/VENT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII |
| V000486696 | 6453 VEPW 30 X 22 G20 TP INS BK NO SCRN 3.1875 RADII |
| 2020002738 | VENT ONLY 6453-40 30.0 X 22.0 G20 TP INS BK 4.000 RADII |
| V000486831 | 6473 VEPW 27 X 20.3 G20 TP INS BK W/SCRN 3.1875 RADII |
| 810679 | 6473 VEPW EXIT VENT 27.0 X 20.3 BK TP G20 4.000 RADII |
| V000486835 | 6473 VEPW 27 X 26 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2021097002 | VENT / EXIT 6473-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII |
| V000486854 | 6473 VEPW 27 X 26 G20/OBS TP INS BK W/SCRN 3.1875 RADII |
| 2021097003 | VENT / EXIT 6473-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII |
| V000491391 | 6473 VEPW 36 X 26 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2020220010 | VENT / EXIT 6473-30 VEPW 24.0 X 36.0 BK TP G20 4.000 RADII |
| V000486846 | 6473 VEPW 30 X 24 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2020126217 | VENT 6473-40 VEPW 30.0 X 24.0 BK TP G20 4.000 RADII |
| 757249 | 1-6499-00-0-345-265-000-0-3535-0111-0302 |
| 2020219967 | 6499-30-345-265-3535-9331-0302 |
| V000486853 | 6473 VEPW 36 X 24 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2020126216 | VENT 6473-40 VEPW 36.0 X 24.0 BK TP G20 4.000 RADII |
| V000486839 | 6473 VEPW 30 X 20.3 G20 TP INS BK W/SCRN 3.1875 RADII |
| 2021097004 | VENT / EXIT 6473-30 VEPW 30.0 X 20.3 BK TP G20 4.000 RADII |