



Filler Fuel Neck

Bulletin Type:	Recall	Publication Date:	October 2022
Bulletin #(s):	22V-769 USA 2022-581 Canada	Make(s):	Jayco
Job Code(s):	9901581	Model(s):	Seismic FW, Seismic Luxury FW
Flat Rate(s):	9901581A .10 Inspection only Fuel Cap(s) 9901581B .40 Inspect and replace one fuel neck 9901581C .80 Inspect and replace two fuel necks	Model Year(s):	2023

Incident:	Cap on the fuel necks to our gas tank are not seating properly
Affected Units:	2023 Jayco Seismic FW and Seismic Luxury FW
Parts Kit: 22V-769	Parts Kit #: 22V-769A
	Part Kit Contents: (1) NECK,FLR FUEL 2" 07.50 MN LG W/22DEG ANG W/.63 VNT TB (Jayco Part #0338012)
	Parts Kit #: 22V-769B
	Part Kit Contents: (2) NECK,FLR FUEL 2" 07.50 MN LG W/22DEG ANG W/.63 VNT TB (Jayco Part #0338012)
Misc. Tools & Supplies:	Screwgun, #2 square drive bit, 5/16" hex head bit or socket
Parts Return Information:	N/A

FILLER FUEL NECK INSPECTION

1. Locate fuel cap on ODS rear of coach (Figure 1 & 2). There will be one on Seismic FW and two on Seismic Luxury FW.

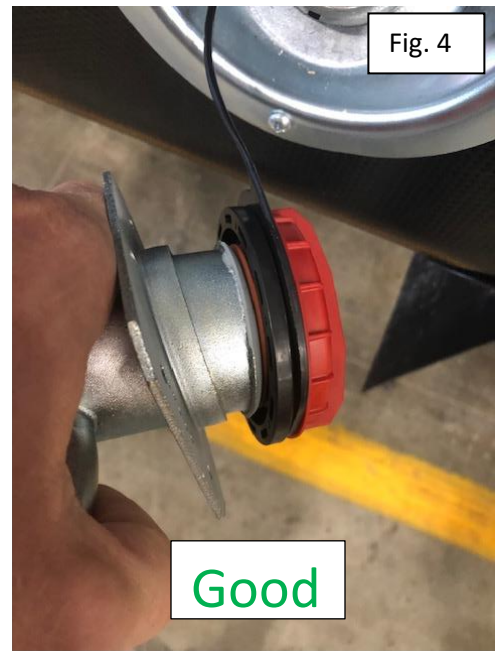


Fig. 1



Fig. 2

2. Check to make sure fuel cap seats properly to the fuel neck. If bad (Figure 3), the fuel neck will need changed. (Figure 4)



FILLER FUEL NECK REPAIR INSTRUCTIONS

3. Begin by removing the two fuel neck screws using a #2 square drive. (Figure 5 & 6)



4. Loosen the hose clamps on the back side of the fuel neck using a 5/16" socket or nut driver. (Figure 7)
5. Remove hoses from existing fuel neck and replace with new one. Test fit the cap on the new fuel neck to make sure it seats properly before installing it. (Figure 8)
6. Refasten the hose clamps on new fuel neck. (Figure 9)
7. Align fuel neck so that existing pre-drilled holes can be used. (Figure 10) Fill hole should be at the bottom.
8. Reattach fuel cap with second screw and twist on cap until it clicks. (Figure 11)



Fig. 7

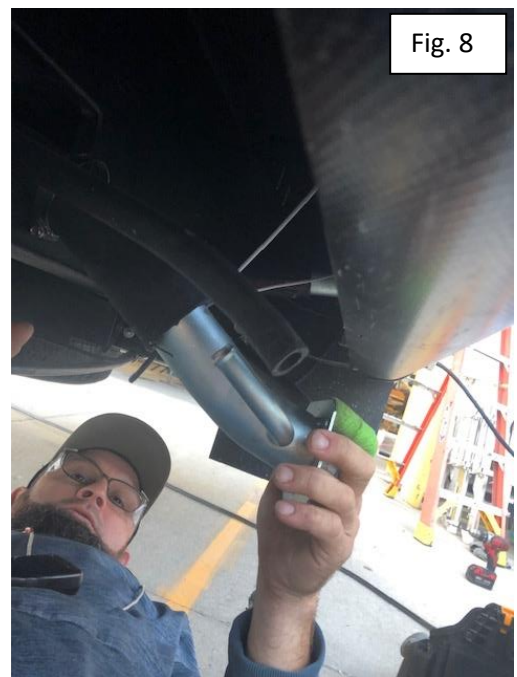


Fig. 8



Fig. 9



Fig. 10



Fig. 11

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540