

IMPORTANT SAFETY RECALL REMINDER
FIRST REMINDER - ACTION REQUIRED



SUZUKI MOTOR OF AMERICA, INC.
3251 E. Imperial Highway
P.O. Box 1100, Brea CA 92822-1100

“VIN”
“Vin as bar code”

“MODEL_NO”
“CAMPAIGN_NO”

Presorted
First Class Mail
U.S. Postage
PAID
Permit No. 100
Gardena, CA

“Name”
“Address”
“City”, “State” “Zip”

“Record Number”


OFFICIAL MANUFACTURER NOTIFICATION

Suzuki Motorcycle
Dealer Locator



www.suzukicycles.com

Scan the QR code or visit our website for more
information and to find the dealer nearest you.

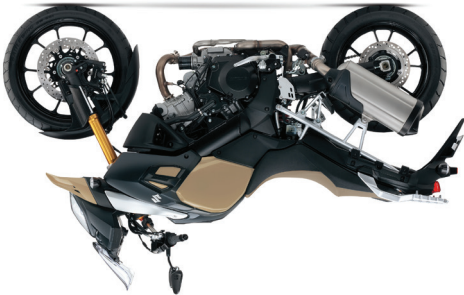

IMPORTANT SAFETY RECALL REMINDER
FIRST REMINDER - ACTION REQUIRED

IMPORTANT SAFETY RECALL REMINDER

Suzuki Motor Corporation has decided that three defects that relate to motor vehicle safety exist in certain 2014-2015 DL1000A/AA motorcycles.

Defect#1

Improper harness routing and vibration from riding can cause the wiring insulation to wear off, allowing bare wire to contact the fuel tank, creating a short circuit. As a result, the engine may stall while riding, increasing the risk of a crash.

Defect#2

The ignition switch connector terminals can corrode. If the corrosion progresses, the terminals of the connector can be connected, completing the power circuit independent of the ignition switch. Under this condition the engine cannot be stopped by turning off the ignition key. The corrosion can also lead to a loss of electrical power. If electrical power is lost, the engine may stall and it may not be possible to restart it, increasing the risk of a crash.

Defect#3

The battery ground connection may develop poor conductivity due to corrosion or a weak connection to the painted surface of the crankcase to which it is attached. This could cause the engine to stall and prevent it from being restarted, increasing the risk of a crash.

What is Suzuki doing to solve the problem?

This recall was originally announced in February 2016 and we continue to reach out to all customers who own affected motorcycles. Parts are in stock and our dealer network is ready to make the necessary repairs.

What should you do?

Please contact any authorized Suzuki dealer to schedule a service appointment as soon as possible. Mention the campaign ID on the outside of this card to help ensure they have the necessary parts on hand. The QR code and website on the back of this card will help you find a dealer near you.

Your motorcycle may be affected by more than one recall or service campaign.

There are two ways to find out:

- Visit the National Highway Traffic Safety Administration's website at www.safercar.gov and enter your year, make and model information.
- Ask your dealer when you call to schedule an appointment for repair. Just provide them with the VIN from the front of this card.

If you no longer own the vehicle in question, or if you have questions or concerns, please contact our Customer Relations Department at 714-572-1490.

Thank you for your commitment to safety and for your support of the Suzuki brand.

Suzuki Motor of America, Inc.
Warranty Service Department.