
May 13, 2015A15050B Version 1

Soft Set or Bad Connection at C505 Can Cause Various Electrical Problems

AFFECTED VEHICLES


2005–15 Odyssey and 2009–15 Pilot

EDITOR'S NOTE: This article replaces “No DVD Picture, No Compass Calibration, Security Alarm Goes Off,” posted in **August 2013**.

A soft set or bad connection at C505 in the right A-pillar can cause any or all of these symptoms:

- No picture on overhead screen (any source)
- No sound from wireless headphones (any source)
- Compass won't calibrate (models without navigation)
- Security system alarm randomly goes off
- Interior lights flicker
- Rear climate controls won't work
- No image in rearview monitor (if equipped)
- Rearview mirror won't automatically dim

NOTE: Any of these symptoms can be intermittent.

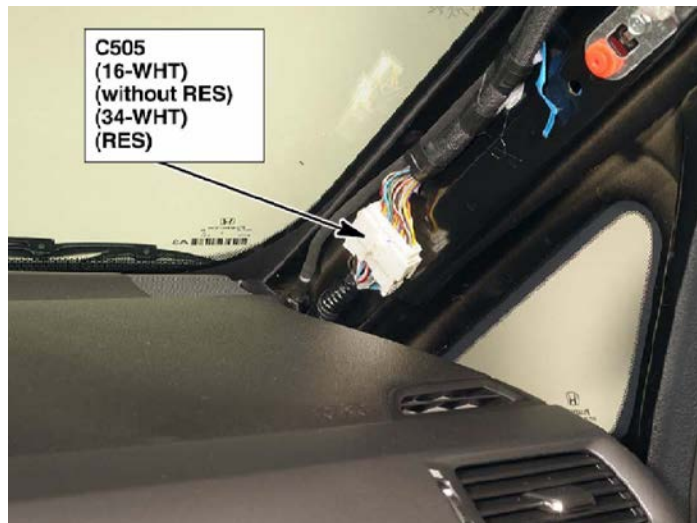

To fix this problem, check the connector and reset it if needed. If the connection is good, continue with normal troubleshooting.