



To All Lamborghini Dealers and Licensed Service Points
From Customer Service Department
Subject Service Campaign - Gallardo rear fender side air intakes sealing
Group 140.8.21
Date 19.09.2005
Pages 7

Automobili
Lamborghini
S.p.A.

Subject

Gallardo rear fender side air intakes sealing

Model / VIN-Range

Gallardo models until VIN 2785

Information to the field

In case you have a vehicle in the workshop Lamborghini recommends sealing the internal connecting joints of the rear fender side air intakes.

This modification must be performed on all cars involved at the next service.

Lamborghini recommends carrying out this upgrade aiming to extend the life of these components.

Field solution

Sealing the internal connecting joints of the rear fender side air intakes.

Spare Parts

- Polyurethane adhesive sealant (half a cartridge for each car), available at Spare Parts department - p.n. 900000125

Each dealer/service will receive 8 sealant cartridges with the next spare parts delivery. For following orders you will receive a minimum quantity of 8 cartridges for each delivery.

Procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

1-7

Via Modena,12
I-40019 Sant'Agata
Bolognese
Tel +39 051 6817 652
Fax +39 051-6817 709



Warranty Claim data

You may find on Lamborghini Web Portal in the Warranty section “Available campaigns”.

Campaign Code: L140-A06.05
Campaign Description: Side air intakes sealing
Cost Code: 50
Component Code: CCA0605
Trouble Code: 220
Labour code: CCA0605100
Labour Time: 2 h

Maximum sublet for sealant cost (for each warranty claim): 4 €(equivalent values for USA, RoW and Japan)

Your Area Manager is at your full disposal for further informations.



Best regards

Product Service



Necessary material

- Polyurethane adhesive sealant (A) (half a cartridge each car), available at the Lamborghini warehouse - p.n. 900000125.
- Cleaning degreasing solution (use a commercial product)
- Gun applicator for the adhesive sealant (C).
- A rubber pipe extension (about 60 cm length) (D) or a paintbrush (E) for sealant application.

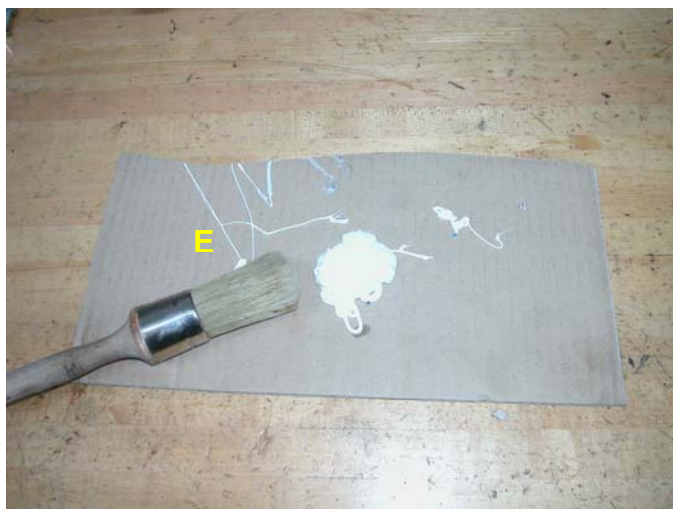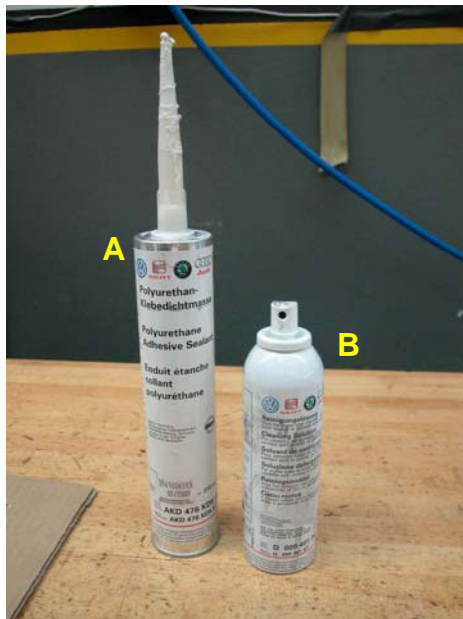


The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



Description of operations

- 1.1 Adopt all precautions to prevent car damages and to work safe
- 1.2 Raise the car on the lift

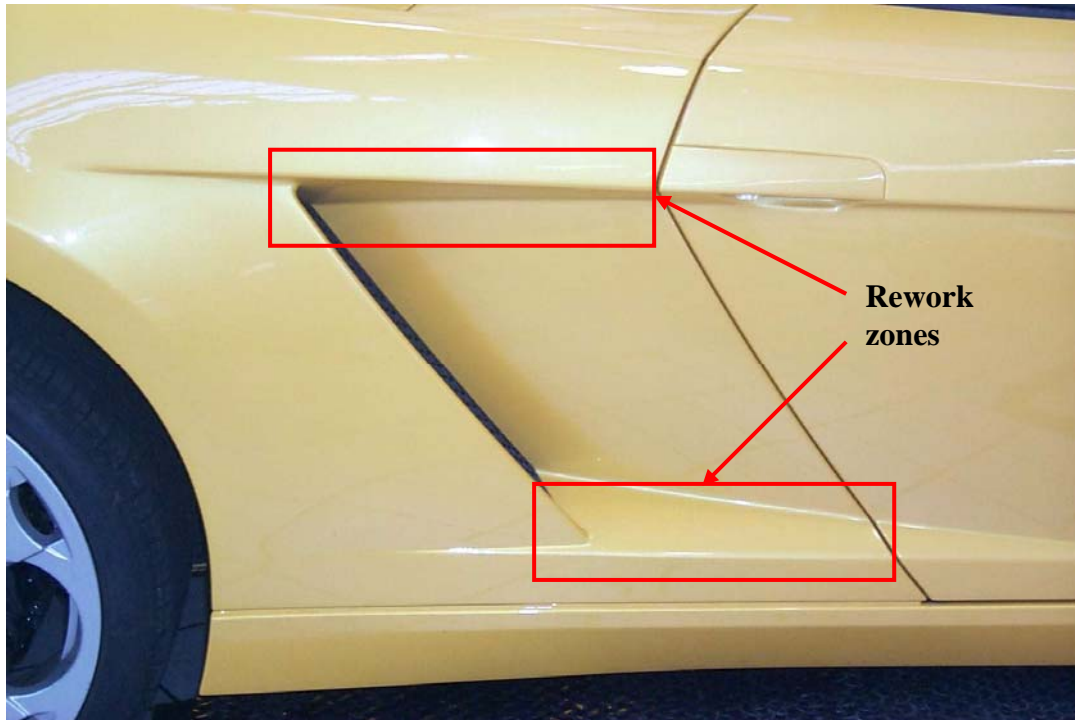

Right side

- 1.3 Remove the rear wheels of the vehicle
- 1.4 Remove the front part of the rock panels of the rear wheelhouses (pictures below)



- 1.5 Remove the oil radiator brackets (without removing the radiator pipes) and move the radiator in order to create an access to the rework zone.



Right wheel

- 1.6 Remove the air intake black grid.
- 1.7 Only for the left side air intake: remove the upper pipe from the engine oil radiator and unscrew the oil filter bracket in order to move better the radiator.





Left wheel

The information and procedures published below are strictly confidential and reserved exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



1.8 Identify the upper and lower connecting joints to be sealed (see pictures below – right side of the car).

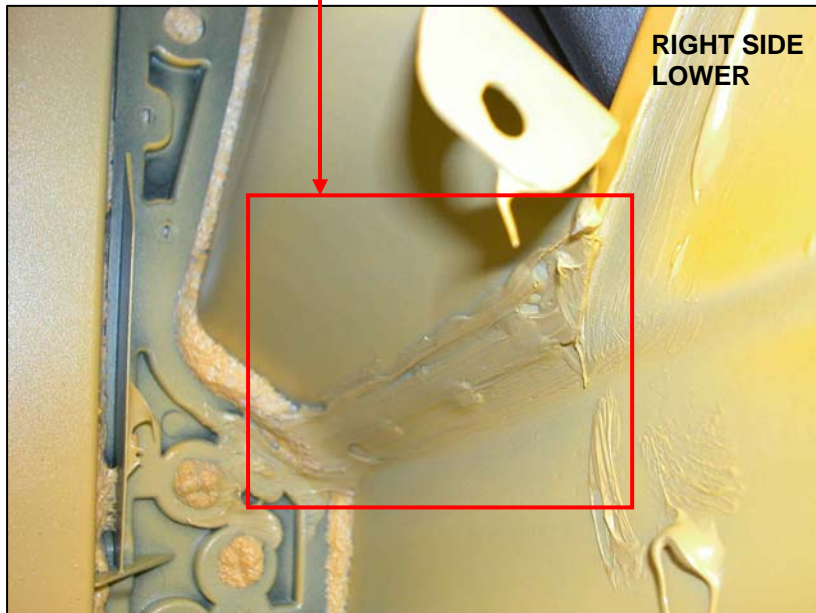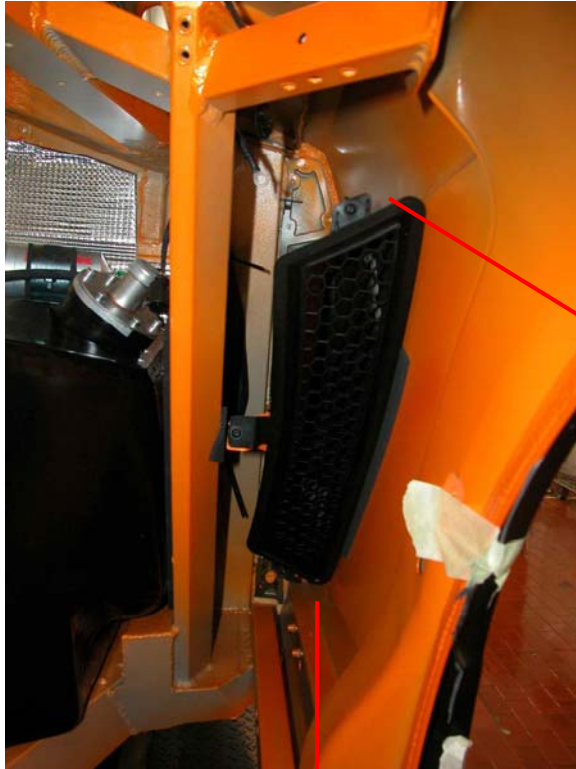

1.9 Using a cloth, clean the upper and lower connecting joints surfaces with the cleaning solution.

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



1.10 Apply the sealant on the whole connecting joints using the gun applicator with a rubber pipe extension (suggested solution) or a paintbrush (see pictures below).

1.11 Spread the sealant on the whole jointing surface (see pictures below).



1.12 Now you can reassemble all the components.

1.13 Important: check the engine oil level after reassembling the engine oil radiator.

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.