



To All Authorized Lamborghini Dealers and Licensed Service Point  
From Customer Service Department  
Page 4  
Subject Interface for K Line Pull Up  
Group 140.9.75.00.05.InterfaceLineK.GB  
Date 19.04.2005

Lamborghini S.p.A.  
Automobili

### **Subject**

Interface for K Line Pull Up for the radio

### **Model**

All Gallardo Vehicle with Radio System (not suitable for vehicle with Nav/Sat)

### **Information to the field**

This procedure is to be followed whenever the vehicle has discharge of the battery on sleep mode. The anomalous problem may occur when the battery absorbs +- 50 mA. Current drain of the battery should be maximum 25 mA.

### **Production Information**

The Factory has implement this procedure in production from VIN 2304

### **Field solution**

To mount the Interface for K line pull up to avoid the overcharge of the battery.

### **Parts**

#### You will need:

Lamborghini Tools: Hi-fi key, sound system and nav p/n 3B0051530  
Interface: p/n 400971318  
Radio PIN Number (In case the radio re-start): Check Page 37 of the Sound System Booklet.

Your Area Manager is at your full disposal for any questions you may have.

Best regards

Customer Service Department



## **Interface for K Line Pull Up for the radio**

**Description of operation:** Mount interface for K Line pull up in the back of the radio.

### **A - Necessary material**



Pic 1

**A:** p/n 3B0051530 – Quantity = 1 package with 4 keys



Pic 2

**B:** p/n 400971318 – Quantity = 1




## B - Operation

- 1.1** Insert the four keys into their place on the radio (Pic 3). Please note that each key has written on it where it should be fit. For example the key “TOP L” must be used on the LEFT TOP POSITION.



Pic 3

- 1.2** Now take out the center console part shown on Pic 4.

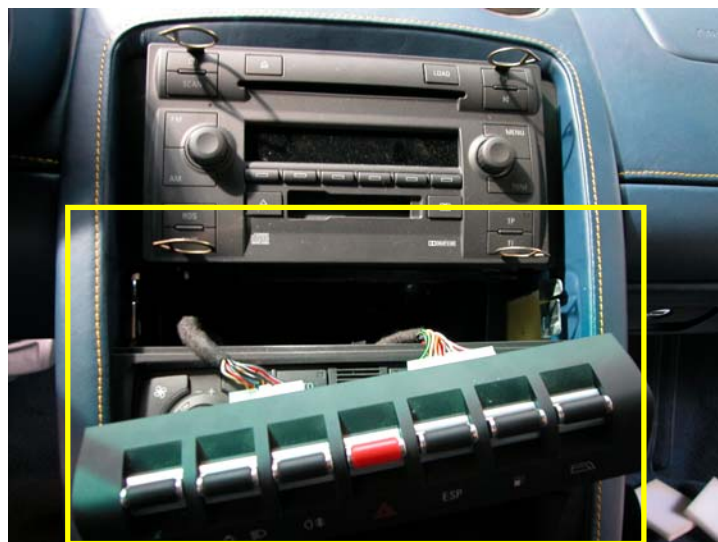


Pic 4




**1.3** Now take out the radio using the button under it.

**1.4** Take out the energy black connector (number 271 “cablaggio plancia”)

**1.5** Insert the Interface between the radio and the black connector 271 (Pic 5)

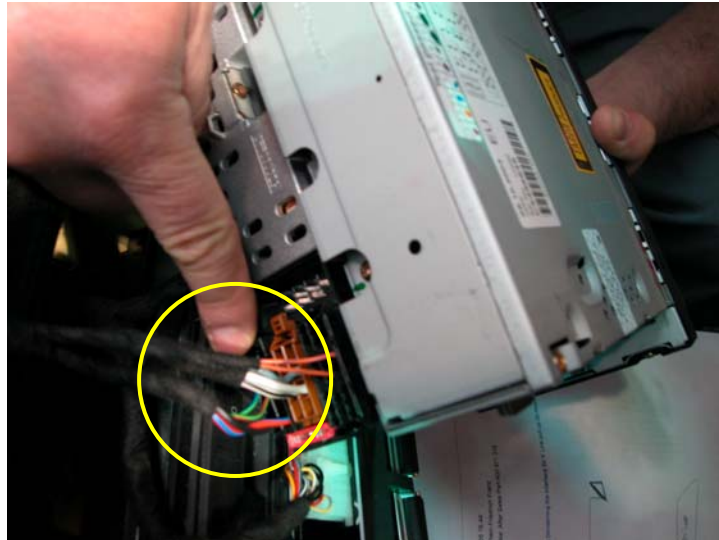

Pic 5

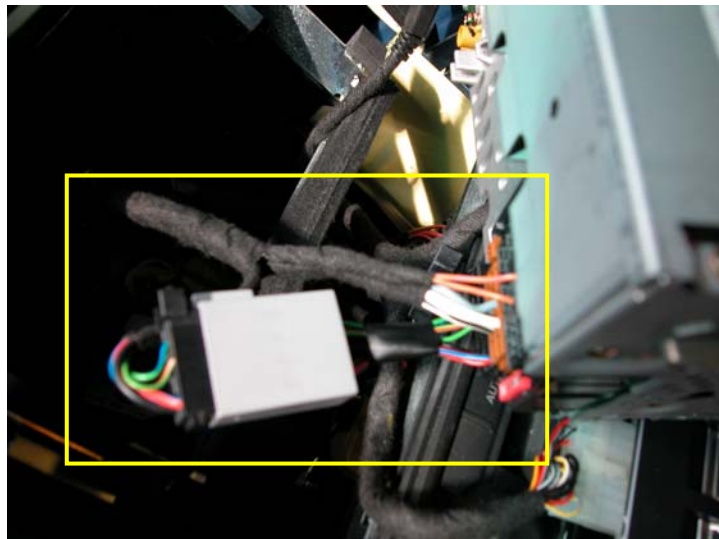

Pic 6

**1.6** Now that the connector is placed you may return the radio on the correct position.

**1.7** Remove the keys and return the center console.