

DIREZIONE COMMERCIALE

After Sales – Spare Parts

Phone +39.051.6817652 Fax +39.051.6817738

To: All Lamborghini Dealers and Service Points

Service Manager and Spare Parts Manager

From: After Sales department

Monday, 02 September 2002

Page.: 1

Technical documentation rif.06.02

Object: New front and rear shock absorber

Model: Murciélago MY02

Group: 147.4.13.00.02.modifications.GB 147.5.13.00.02.modifications.GB

During the Murciélago MY02 production we have performed some modifications to the front and rear shock absorber that have made their related Koni codes change.

Old spare parts:

Front shock absorber: the **p/n 0051009118** is related to the **Koni code nr.7120 1045 01**Rear shock absorber: the **p/n 0052009119** is related to the **Koni code nr. 8246 1065**

New spare parts:

Front shock absorber: the p/n 0051010975 is related to the Koni code nr.7120 1052 01

Rear shock absorber: the p/n 0052010976 is related to the Koni code nr.8246 1067

Starting with VIN:

ZA9BC10E02LA12047

the new shock absorbers were fitted except for the vehicles with VIN:

ZA9BC10E02LA12153 ZA9BC10E02LA12173 ZA9BC10E02LA12174

Ct.06.02 page 1 of 3



DIREZIONE COMMERCIALE

After Sales – Spare Parts

Phone +39.051.6817652 Fax +39.051.6817738


> ZA9BC10E02LA12175 ZA9BC10E02LA12176 ZA9BC10E02LA12177 ZA9BC10E02LA12178 ZA9BC10E02LA12179 ZA9BC10E02LA12180 ZA9BC10E02LA12181

Warning:

Do not fit on the same vehicle shock absorbers with different specifications.

To avoid any misunderstanding you must absolutely confront the Koni codes (see pictures nr.1 and nr.2) stamped on the shock absorber body.

The replaced shock absorber must have always the same Koni code as the mounted one. picture nr.1

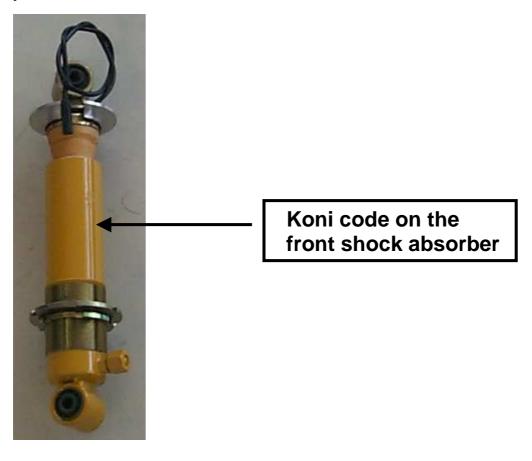

picture nr.2


Ct.06.02 page 2 of 3



DIREZIONE COMMERCIALE

After Sales – Spare Parts

Phone +39.051.6817652 Fax +39.051.6817738

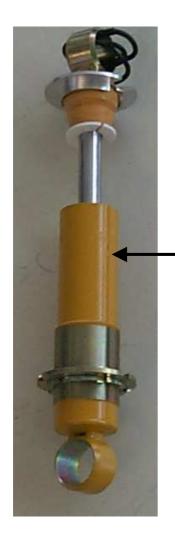

Koni code on the rear shock absorber

Note that this modification has only an impact to improve functionality and comfort without any implication for security and duration.

Please collect a copy of this bulletin in your archives, and verify the proper configuration before delivering the car to the customer.

For any further information you may need, please feel free to contact us.

Best Regards

Michele Capelli Training & Publications **Giorgio Gamberini** After Sales Manager

Ct.06.02 page 3 of 3