



VOLUME

2

GROUP
Climate Control

NUMBER
005

MODEL
Sportage

DATE
August 2000

Technical Service Bulletin

SUBJECT:

HVAC Mode Control Switch

This bulletin provides information related to 2001 MY Sportage HVAC Mode Control Switch. On 2001 MY vehicles produced before 6/29/00, an internal switch contact may break off. When this occurs, air flow selections cannot be made.



To correct this condition, the internal switch contact has been revised to eliminate breakage.

File Under: Climate Control

Circulate To: General Manager Service Manager Parts Manager
 Service Advisor(s) Technician(s) Body Shop Manager

SUBJECT:

HVAC Mode Control Switch

REPAIR PROCEDURE:


1. Open cup holder, grasp center panel assembly as illustrated in photo, and pull to release panel assembly from retaining clips.



2. Disconnect four (4) HVAC control electrical connectors and remove center panel.




3. Remove mode control switch from center panel by removing two (2) screws, and knob. Discard old switch and knob.

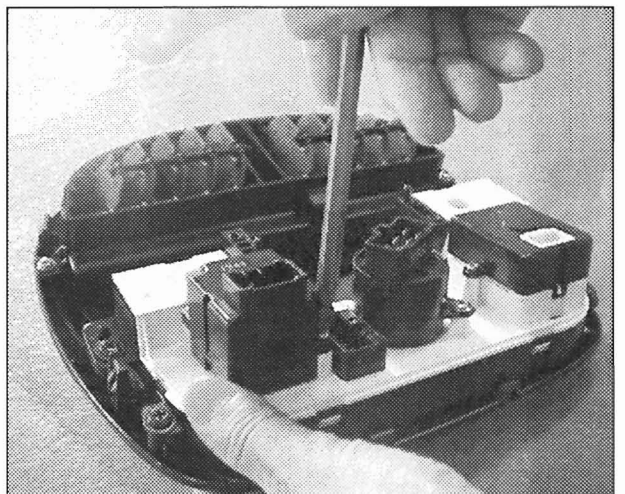

SUBJECT:**HVAC Mode Control Switch**

4. Install new mode control switch with the two (2) screws, then install the new knob.

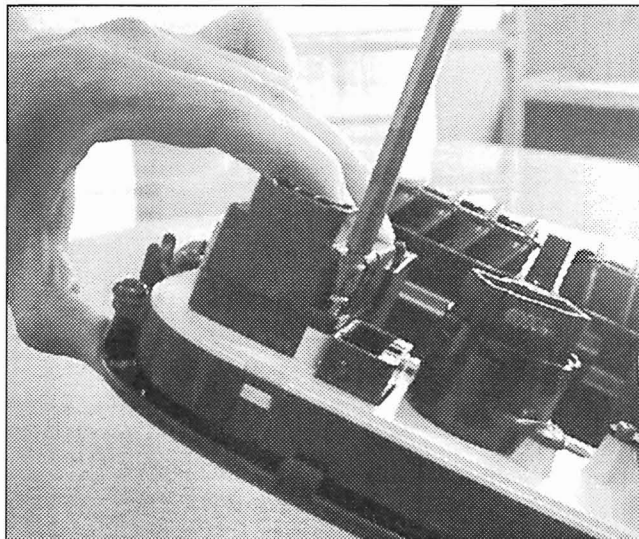

5. Reconnect the four (4) HVAC electrical connectors.



6. Reinstall center panel to dash.
7. Check and confirm proper HVAC mode control operation.



SUBJECT:

HVAC Mode Control Switch

AFFECTED PRODUCTION RANGE:

2001 MY Sportage vehicles produced before 6/29/00.

PART NUMBER INFORMATION:

Description	P/N
Mode Switch Assembly	0K070 61 C21
Mode Switch Knob	0K070 61 C32

WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty.	Cond Code	Repair Description	Cause Code	Labor OP Code	Time	Related Parts	Qty.
W	0K070 61 C21	1	N94	R&R Mode Switch	C06	61C21XTT	0.3 hr	0K070 61 C32	1