



To All Lamborghini Dealers and Licensed Service Point
From Customer Service Department
Subject Bluetooth ECU replacement
Group 140.9.71
Date 07.09.2007
Pages 5

Automobili
Lamborghini S.p.A.

Subject

Bluetooth control unit replacement.

Model / VIN-Range

All Gallardo (Coupè and Spyder) from VIN G85950 to VIN G86356.

Attention: As not all cars from this VIN range are affected, please carefully check on the Lamborghini Web-portal to verify the VIN-Info and if the car is affected by this service campaign before the start of any activity.

Information to the field / Customer notification

Due to a defective component in the Bluetooth ECU the complete car battery discharge is possible.

In case you have an involved vehicle in the workshop Lamborghini recommends to replace the Bluetooth ECU.

This rework action must be also performed on all cars in your stock immediately.

Field solution

Follow the workshop instruction in this document for the Bluetooth control unit replacement.

Spare Parts

A new Bluetooth ECU is necessary:

- USA/Canada p/n 8P0862335R;
- other market p/n 8P0862335Q.



Workshop instructions


- 1.1 Adopt all precautions to work safe and prevent car damages.
- 1.2 Remove the carpet passenger side, unhook three clip of the footrest and remove it as show in picture 1.

Pict.1



- 1.3 Disconnect the black connector and bluetooth antenna and remove the old Bluetooth ECU following the direction indicated of the arrows as show in picture 2.

Pict.2

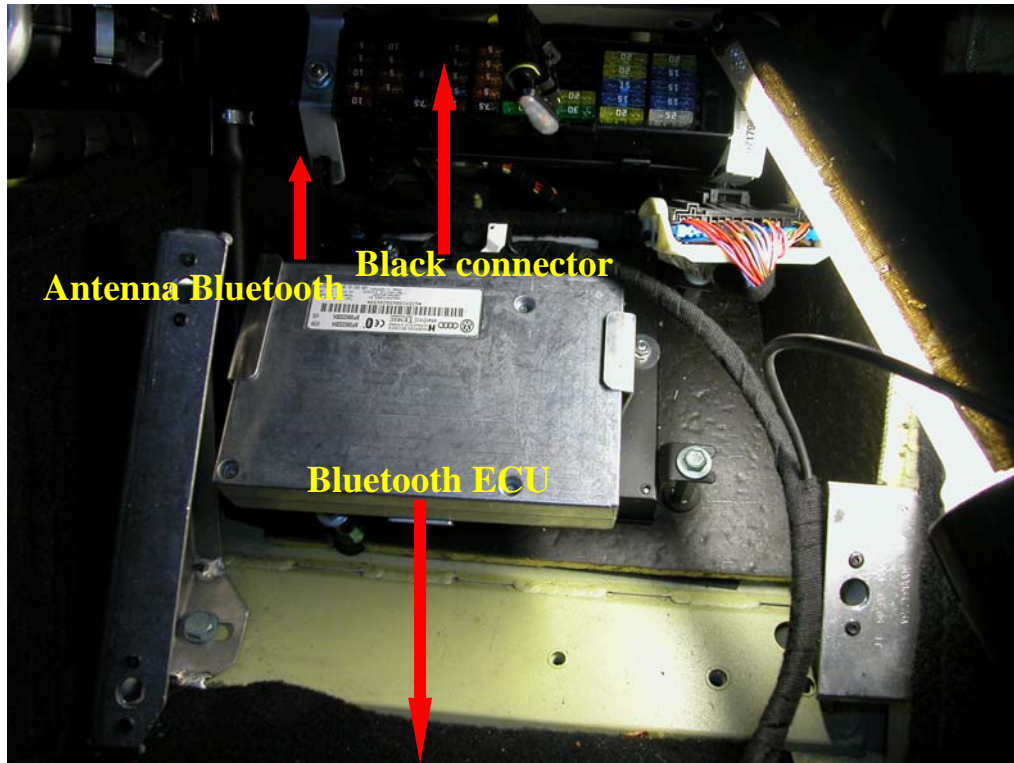

- 1.4 Insert the new Bluetooth ECU, connect the antenna bluetooth and the black connector.
- 1.5 Using the LaRa system, download the zip file associated with the car's VIN. Using the zip file and LaRa system, set up the RNS-E system (ECU 37), the Kombi instrument cluster (ECU 17) and the telephone UCU (ECU 77).



- 1.6 Turn on the multimedia system and keep the volume button (see picture 3) for 20 seconds (checking that the system is on), until an acoustic signal is heard coming from the speakers and turn off the multimedia system. Turn the system on again and, using a suitable cell phone, check the Bluetooth is working.

Pict.3



Note: The bluetooth's password of the car's multimedia system is:1234.The password must be dialed on the telephone in order to be connected to the car.

- 1.7 Assemble the passenger side footrest and the carpet.

Your Area Manager is at full disposal for further information.

Best regards

Customer Service