


L624-A.04.16	To: Official After Sales Network Subject: TPMS control unit holder replacement Date: March 18,2016 Pages 2	
--------------	-------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------

Subject.

TPMS control unit holder replacement .

Model.

Huracàn Coupè.

Model year.

2015 .

Special or Limited Versions.

All.

Markets.

All.

VIN identification.

From **FLA00163** to **FLA03965**.

Warning: some vehicles included in this VIN range may not be involved, so check carefully on the Lamborghini WEB Portal (at the section named VIN Info) if the cars in your workshop or in your dealer stock are involved before performing any other operation.

Information to the field.

As a result of continuous product monitoring, Automobili Lamborghini Spa has found that the cover which hold the control unit that manages the Tyre Pressure System (TPMS) may present sigs of rupture .

Field solution.

Replace the old cover with a new one made in a more resistant material.

Spare parts.

P/N	Description	Q
4S0907297A	TPMS control unit holder.	1

Replaced parts management.

Store properly and tagged the parts replaced with bar code form for their identification during Area Manager visits.

Bulletin substitution.

None.

Warranty Claim data.

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code: L624-A.04.16

Campaign Des.: TPMS control unit holder replacement

Cost code: 50

Component code: CCA0416

Trouble code: 220


Labor code:

CCA0416100

Labor Time:

0,5 h

Remember to fill all data in the section “Service and Recall Campaign” in the Warranty booklet of the vehicle as shown below.

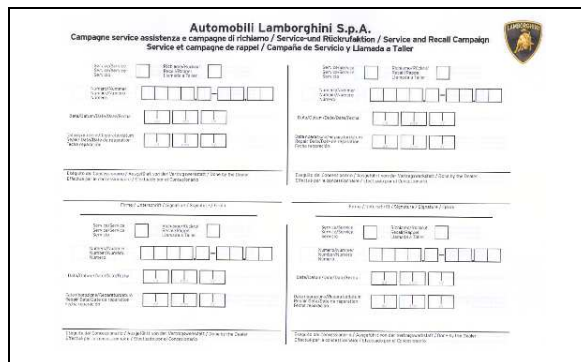


The form is titled 'Automobili Lamborghini S.p.A. Campagna servizio assistenza e campagne di richiamo / Service and Recall Campaign'. It contains various fields for recording service and recall information, including checkboxes for different types of interventions and sections for recording the date and location of the service.

Necessary tools/material.

P/N	Description	Q
-	-	-

Rev.01	<p>The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.</p> <p style="text-align: right;">doc. nr: L/V6_M06 Rev.[02]</p>	1/2
--------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----

L624-A.04.16	To: Official After Sales Network Subject: TPMS control unit holder replacement Date: March 18,2016 Pages 2	
--------------	-------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------

Workshop instructions



CAUTION.




Operation to be performed **at cold engine.**

1. Place the car on a suitable lift.
2. TPMS control unit holder disassembling.

Remove the screw that fasten the TPMS plastic cover and then consequentially the cover itself.

Fixing Screw.

Torque: **4 Nm.**

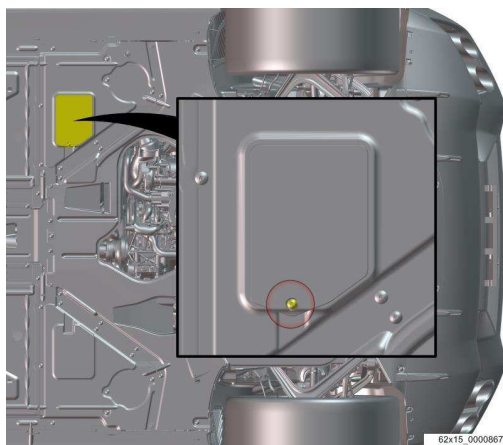


3. Wiring disconnection.



Remark

Ensure you the car is at Key off and the instrument panel is switched off.

Remove the fastening clip from the cover and then unplug the connector from the TPMS control unit.

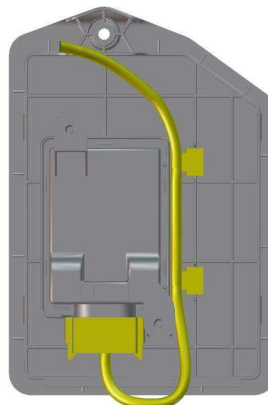

62x15_0000868

4. TPMS removal

Remove the 2 screws and then separate the control unit from the holder.

Fixing screws fastening.

Torque: **4 Nm.**

5. Remove the old loder with new one.

Assemble the previously dismantled parts following the instructions in reverse order.

Rev.01	<p>The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.</p> <p>doc. nr: L/V6_M06 Rev.[02]</p>	2/2
--------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----