

To All Authorized Lamborghini Dealers and Service Centers

Service Area Manager

From Customer Service Department

Subject High Temperature Sticker Repositioning.

Group 0.10.00 Date 28/10/2011

Pages 4

Subject

Repositioning the "High Temperature" sticker in the engine compartment.

Model/VIN Range

Lamborghini Aventador LP-700 MY 2012 From VIN CLA00091 to VIN CL00226.

<u>Warning</u>: as not all the vehicles on this VIN list are involved, check on the Lamborghini Web portal (VIN Info section) whether the vehicle is involved in this campaign before proceeding with operations.

Information for the field

As a continuous product monitoring, Automobili Lamborghini Spa has found that the stickers warning not to touch hot engine parts may not be correctly positioned hot parts may not be correctly collocated.

Solution for the field

Repositioning the high temperature sticker.

Spare parts

P/N	Description	Q
470010521 Nameplate - high temperature		1

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A, as per copyright law. The company reserves the right to make updates and modifications as needed. The following are prohibited: reprinting, reproduction, forwarding to unauthorized persons and/or third parties, and either partial or complete translation, without the express written consent of Automobili Lamborghini S.p.A.



Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code: L834-A.04.11

Campaign Description: High Temperature Sticker Repositioning.

Cost Code: 50

Component Code: CCA0411

Trouble Code: 220

Labour Code: CCA01411100

Labour Time: 0.3h

Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Service/Service Richlamo/Rückruf	
Service/Service Recall/Roppel Llamada a Taller	Service/Service Service/Service Recall/Rappel Service/Service Recall/Rappel
Numero/Nummer Number/Numéro Número	Numero/Numero Number/Numero Numero Numero
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Facha
Deta riparazione/Reparaturdatum Repair Data/Date de réparation Petcha reparación nd rem yy	Data risarazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación Fecha reparación
Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario	Esequito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario
Firma / Unterschrift / Signature / Signature / Firma	
ogniture, strategic of the strategic of	Firma / Unterschrift / Signature / Signature / Firma
Service/Service Richlamo/Rückruf	
Service/Service Recall/Rappel Servicio Liamada a Taller	Service/Service Richiamo/Rückruf Service/Service Recall/Rappel Servicio Llameda a Tailer
Service/Service Recall/Rappel	Service/Service Recall/Rappel
Service/Service Recall/Rappet Servicio Liamada a Taller Numero/Nummer Number/Numéro	Service Service
Service/Service Recall/Rappet Service Identification Interest Inte	Service/Service Recall/Rappet Servico Llamada a Taller Numero/Nammer Number/Numfeto Numero Nümero

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A, as per copyright law. The company reserves the right to make updates and modifications as needed. The following are prohibited: reprinting, reproduction, forwarding to unauthorized persons and/or third parties, and either partial or complete translation, without the express written consent of Automobili Lamborghini S.p.A.



Description of required procedures.

Preliminary operation.

Help documentation: Aventador LP700-4 repair manual:

i. chapter 08.27.00

ii. chapter 10.6B.00

Sticker repositioning.

(082700).

1




3 Use the VAS PC to lift the rear spoiler (106B00).

Remove the "High Temperature" sticker on the engine bay.

4 1 1

Use a cloth soaked in a specific and non aggressive product available for sale as, for example, "PPG Deltron D837 Spirt Wipe SL".

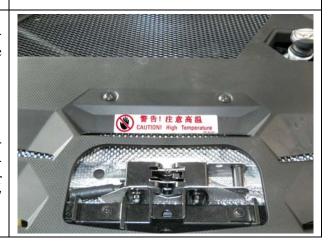

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A, as per copyright law. The company reserves the right to make updates and modifications as needed. The following are prohibited: reprinting, reproduction, forwarding to unauthorized persons and/or third parties, and either partial or complete translation, without the express written consent of Automobili Lamborghini S.p.A.



5	Position the new sticker (code 470.010.521) as shown in the image. Use a cloth soaked in a product as the one at the former step to clean the surface before applying the sticker.	常 学 社 産 森 A CAUTION High Reminerature
6	Use the VAS PC to lower the rear spoiler (106B00).	
7	Close the engine hood.	

Please contact your Area Manager for any further information.

Yours sincerely

Customer Service

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A, as per copyright law. The company reserves the right to make updates and modifications as needed. The following are prohibited: reprinting, reproduction, forwarding to unauthorized persons and/or third parties, and either partial or complete translation, without the express written consent of Automobili Lamborghini S.p.A.