



Service Bulletin

PRELIMINARY INFORMATION

Subject: SES Traction Control lamp on and Engine Runs Rough with DTC P0300

Models: 2014-2015 Chevrolet Silverado, Suburban, Tahoe
2014-2015 GMC Sierra, Yukon, Yukon XL
2015 Cadillac Escalade
Engine 4.3L LV3 5.3 L83 6.2 L86


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern


Some customers may comment on an SES light with DTC P0300 set and/or a rough running engine concern

Recommendation/Instructions


If SI diagnostics have been completed with no trouble found inspect for a possible terminal tension concern on both the ignition coil power feed for a possible cause of the DTC P0300 set and/or a rough running engine, and the X2 connector of the UBEC (Under hood Fuse Block) for an intermittent SES Traction control lamp concern and repair as necessary

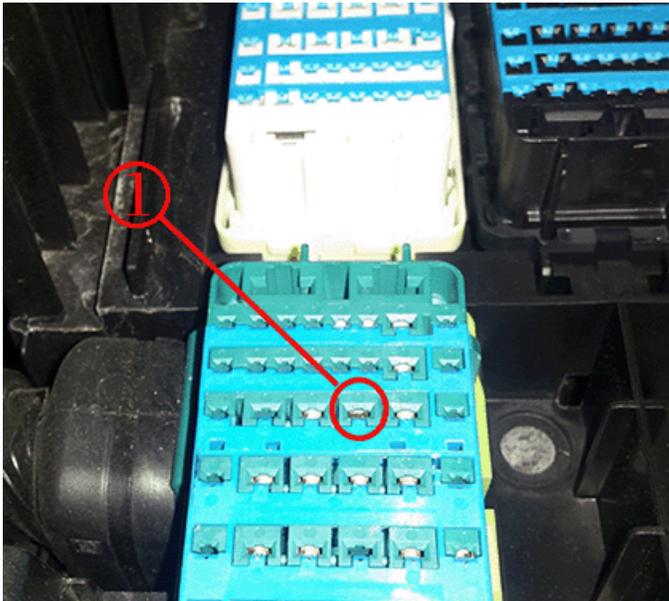

X2 Terminal

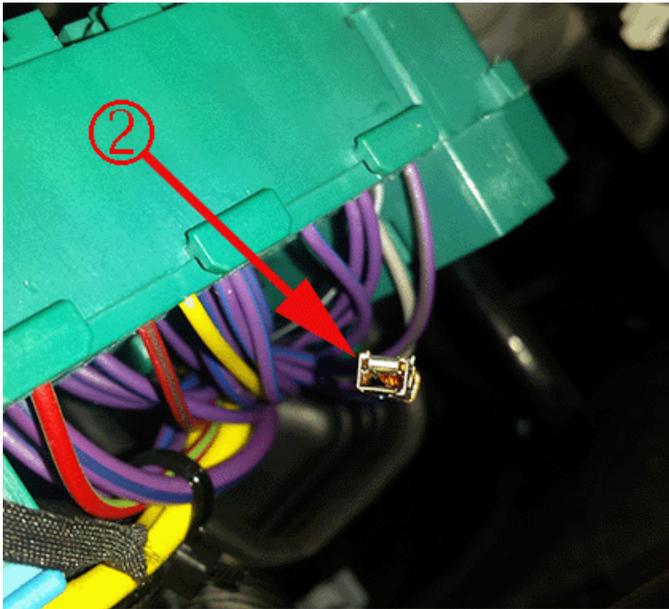

Notice terminal "spread" NO tension

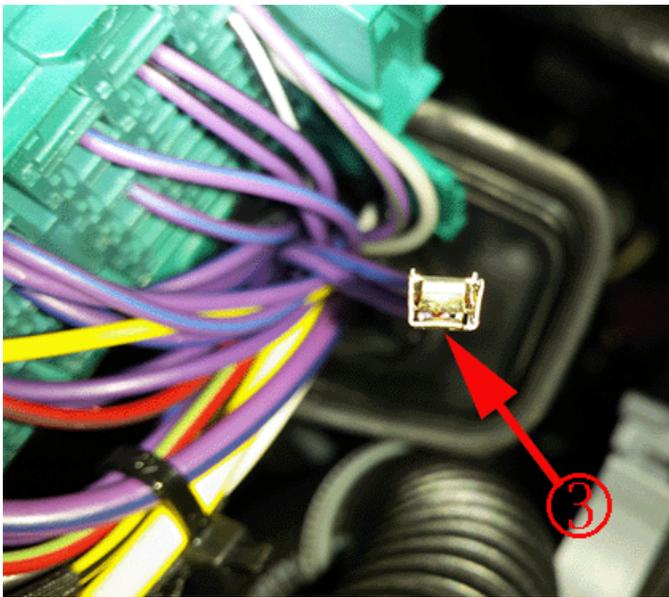

Notice Tighter tension of terminal after repair

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION