

Service Bulletin


INFORMATION

Subject: Front Tire Front Air Deflector Fastener Length Differences

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Volt	2016	2016			All	All

Condition	When performing a PDI, or if removing the left front tire front air deflector or the front bumper fascia center air deflector, the incorrect length screw may have been provided for installation.		
	If a longer screw is installed in the incorrect position of the left front tire front air deflector, the longer screw may come in contact with the battery coolant hose.		

Correction

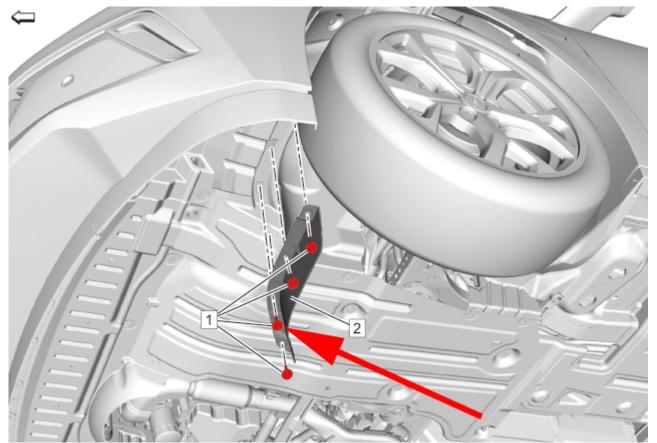

During PDI installation or replacement/removal of the left front tire front air deflector (2), use shorter screw (Part Number 11570498) instead of the possible provided longer screw in the location pictured above.

Note: The shorter screw is only needed to be used in replacement of the longer screw on the left side of the vehicle.

Parts Information

Description	Part Number	Qty
Screw Asm	11570498	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1480618*	Left Front Tire Front Air Deflector Screw Installation/Replacement	0.0 hr

*This is a unique Labor Operation for Bulletin use to cover part cost only. The required labor is included in 0590072 for the Pre-Delivery Inspection (PDI) or the repair that required the removal of the left front tire deflector.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION