



Service Bulletin

File in Section: -

Bulletin No.: PI1255

Date: June, 2014

PRELIMINARY INFORMATION

Subject: Changing Outside Rearview Mirrors

Models: 2014 Chevrolet Silverado 1500
2015 Chevrolet Silverado
2014 GMC Sierra 1500
2015 GMC Sierra
Equipped with RPOs DL3, DL8, DE2

Attention: Any changes or modifications to the vehicle should be first reviewed with the customer, and then noted on the repair order with customer approval. This is for customer satisfaction; this is not a warranty procedure.

Condition/Concern

Some customers may request to have a different style mirror installed on their vehicle or request a different mirror before they purchase the vehicle. The new electrical architecture for the Silverado and Sierra has made swapping mirrors a more involved procedure than with previous models.

Recommendation/Instructions

DL3

- Mirrors, outside chrome cap, heated power-adjustable, power-folding and driver-side auto-dimming, with integrated turn signal indicators and puddle lamps (includes driver's side spotter mirror)

DL8

- Mirrors, outside heated power-adjustable (includes driver's side spotter mirror)

The following chart describes the current and loss of functionality that each package will have:

DL3 Mirrors

	DL3	Upgrade to DPN
Power Folding	X	
Power-Adjustable, Black (includes driver's side spotter mirror)	X	X
Puddle Lights	X	
Integrated Turn Signal Indicators	X	X
Electro-Chromatic	X	
Memory Function	X	X
Heated Mirror	X	X

DL8 Mirrors


	DL8	Upgrade to DF2
Power Folding		
Power-Adjustable, Black (includes driver's side spotter mirror)	X	X
Puddle Lights		
Integrated Turn Signal Indicators		
Electro-Chromatic		
Memory Function	X	X
Heated Mirror	X	X

When swapping to the trailer tow mirrors, the first thing to know is the installation of the trailer tow mirrors may require the technician to add an additional mounting hole to the door (See the chart below). Non-trailing mirrors only require 3 mounting holes. Trailer tow mirrors require 4 mounting holes.

Secondly, the side mirror switch may need to be replaced for trucks built with RPO DL3. See the chart below. This eliminates the power fold button.

Series	RPO	Drill 4th Mounting Hole	Replace Side Mirror Switch
1500	DL3	Yes	Yes
1500	DL8	Yes	No
2500 (Plant Code Z)	DL3	Yes	Yes
2500 (Plant Code Z)	DL8	Yes	No
2500 (Plant Code F)	DL3	No	Yes
2500 (Plant Code F)	DL8	No	No

Note: If upgrading from DE2 (Mirrors, outside manual, Black) to DF2 (Mirrors, outside high-visibility vertical camper-style, Black with manual folding and extension and lower convex spotter glass) will only require drilling of the fourth hole (2). See the picture below.

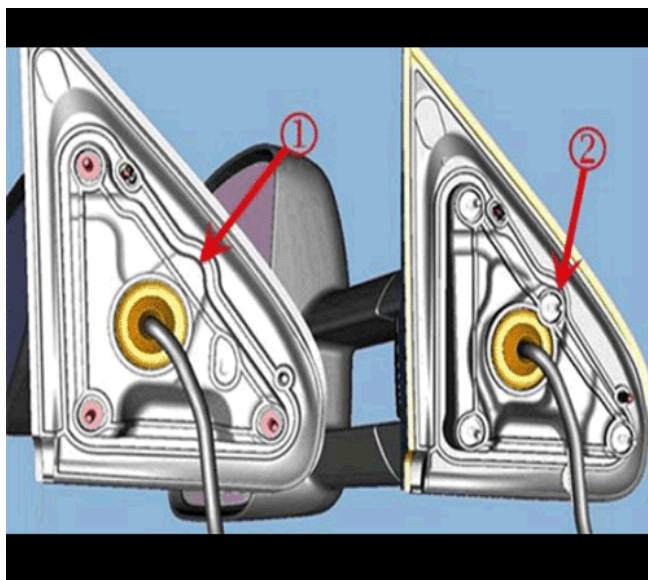

3802187

RPO DL3, DL8 to DPN (1500 Series)

DPN/DL8 to DL3:

1. Remove the front side door window garnish molding. Refer to Front Side Door Window Garnish Molding Replacement in SI.
2. Remove the outside rearview mirror nuts, disconnect electrical and remove the mirror.
3. If necessary, drill out the fourth hole (see chart above).
4. Install the new mirror, mirror nuts and connect the electrical.
5. Install the new switch to the bezel.
6. Install the front side door window garnish molding. Refer to Front Side Door Window Garnish Molding Replacement in SI.

Note: Trailer Tow Finish is Black only - see below for TT Finish P/Ns.

Part Number	Description	RPO
22820395	MIRROR O/S LH, WIDE LOAD, FOLDING	DF2
22820396	MIRROR O/S RH, WIDE LOAD, FOLDING	DF2
22820397	MIRROR O/S LH, WIDE LOAD, FOLDING, VERTICAL GLASS, MAN EXTENDING, HEATED, TURN SIG IND	DPN

Part Number	Description	RPO
22820398	MIRROR O/S RH, WIDE LOAD, FOLDING VERTICAL GLASS, MAN EXTENDING, HEATED, TURN SIG IND	DPN
22754405	SWITCH, O/S RR VIEW MIR R/CON	CK157 (43-53) (A31, DL8, DPN, UQA, YE9, 4AA) (EXC SLT)

Warranty Information

As the associated vehicle was modified outside of production specifications, labor associated with these procedures should NOT be charged under warranty. Rather, this should be customer pay.