

MEDIC UPDATE
TECHNICAL SERVICE BULLETIN

| | | | |
|---|---|---|--|
| SUBJECT: LOW FUEL WARNING LIGHT | | | No. TSB-03-13-007 |
| | | | DATE: October, 2003 |
| | | | MODEL: 1997-2003 Diamante |
| CIRCULATE TO: | <input type="checkbox"/> GENERAL MANAGER | <input checked="" type="checkbox"/> PARTS MANAGER | <input checked="" type="checkbox"/> TECHNICIAN |
| <input checked="" type="checkbox"/> SERVICE ADVISOR | <input checked="" type="checkbox"/> SERVICE MANAGER | <input type="checkbox"/> WARRANTY PROCESSOR | <input type="checkbox"/> SALES MANAGER |


PURPOSE

On some affected vehicles, the low fuel warning light may not illuminate until after the fuel gauge reaches "E". The warning light should illuminate when there is approximately 3.7 gallons of fuel remaining. The fuel gauge sending unit has been improved to eliminate this condition.

AFFECTED VEHICLES

1997-2003 Diamante models produced before 7/7/03

PROCEDURE

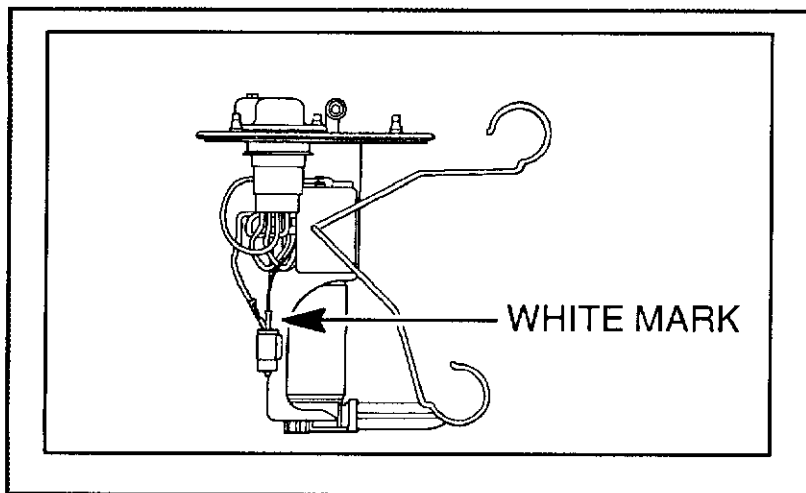

Check for normal operation of the fuel gauge sending unit. If it does not operate normally, replace the fuel tank pump and gauge assembly (listed in the PARTS INFORMATION section of this bulletin). Refer to Group 13 in the Diamante service manual.

Improved parts have a white mark located above the lower fuel warning thermistor.

PARTS INFORMATION

066058

Use the Genuine Mitsubishi Part listed below.

| Description | Part Number |
|-----------------------------------|-------------|
| Fuel tank pump and gauge assembly | MR908180 |

WARRANTY INFORMATION

Normal warranty procedures apply.

Mitsubishi Motors North America, Inc.
