



Date:
23.06.2026

Affected Models:
All Emira Models

Affected Regions:
All Regions

Affected Volume:
N/A

Number:
131-26018

Copy files should be maintained by:


Service Manager		Service Reception		Supervisor		Parts Manager	
-----------------	--	-------------------	--	------------	--	---------------	--

TITLE

Carconfig update on EmiraDS.

REASON

A new Carconfig file is available on EmiraDS to support any future ECU (Electronic Control Unit) software upgrades.

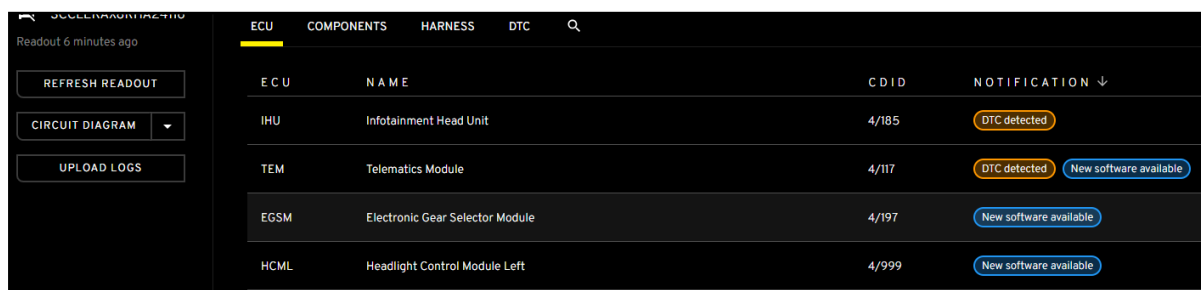


ECU	NAME	CDID	NOTIFICATION
IHU	Infotainment Head Unit	4/185	DTC detected
TEM	Telematics Module	4/117	DTC detected New software available
EGSM	Electronic Gear Selector Module	4/197	New software available
HCML	Headlight Control Module Left	4/999	New software available

Because the Carconfig is a common file shared across all ECU software packages, the “New Software Available” notification will be displayed on multiple ECUs, (except for CPC, EIS, EMS, FSCM, and TCM 2L ECUs).

Important

This does not necessarily indicate that a specific upgrade is required for each ECU listed, but if a software notification is also available for the DDM (Driver Door Module), upgrading the DDM first will clear the notification for all other ECUs that do not have individually applicable upgrades.

ACTION

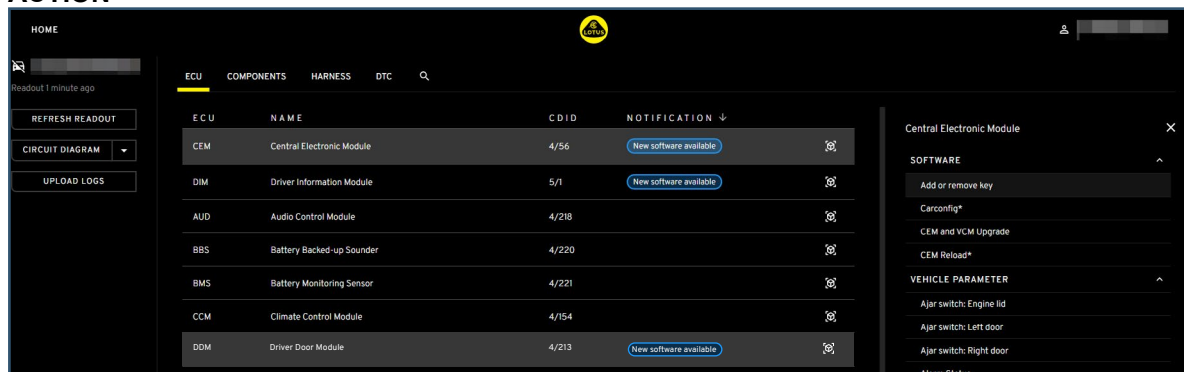

ECU	NAME	CDID	NOTIFICATION
CEM	Central Electronic Module	4/56	New software available
DIM	Driver Information Module	5/1	New software available
AUD	Audio Control Module	4/218	
BBS	Battery Backed-up Sounder	4/220	
BMS	Battery Monitoring Sensor	4/221	
CCM	Climate Control Module	4/154	
DDM	Driver Door Module	4/213	New software available

Central Electronic Module
SOFTWARE
Add or remove key
Carconfig*
CEM and VCM Upgrade
CEM Reload*
VEHICLE PARAMETER
Ajar switch: Engine lid
Ajar switch: Left door
Ajar switch: Right door
Alarm Status

If a vehicle connected to EmiraDS is displaying the “New Software Available” notification across multiple ECUs, then check to see if software notification is also available for the DDM. **Upgrade the DDM first** and then check to see if the “New Software Available” notification on other ECU’s has now been deleted.

CHARGES

No charges are associated with the contents of this bulletin.

Ends.

Lotus Technology Innovative Limited

C/O Browne Jacobson LLP 15th Floor, 6 Bevis Marks London, United Kingdom, EC3A 7BA