


# SOP01855


## QAAR9208 Repair/Replace

### Battery Door Support Cable

Department: 17  
 People Required: 1  
 Time to Complete: 7 min  
 Date Created: Dec. 20, 2018  
 Date Revised:                      Rev #:  
 Created by Initial: GK            Verified: DP

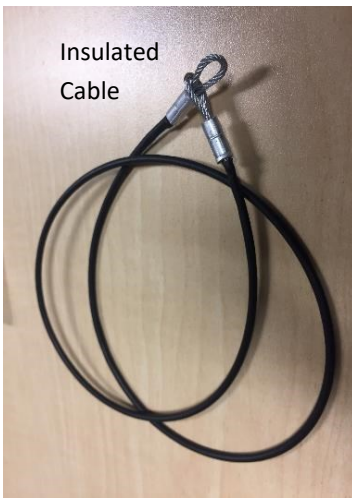

Insulated Cable




5/16

OR



Tools you will need:



- Insulated Cable
- 9mm (3/8") wrench
- 5/16 socket or nut driver
- #6 Robertson or Phillips screw driver.

1





Open the battery compartment door (3rd from front) on the driver's side of the coach.

2



Support the door with your knee to remove the tension from the cable.

3




Hold the machine screw of the cable with the screwdriver while loosening the nut on the other side with the 9mm wrench.

4

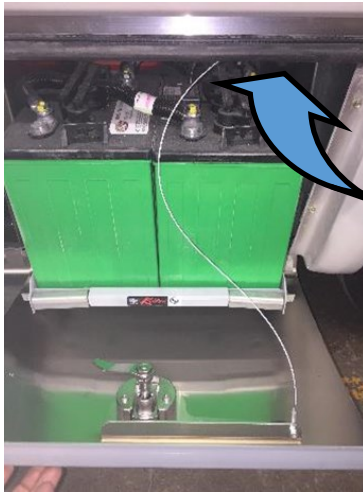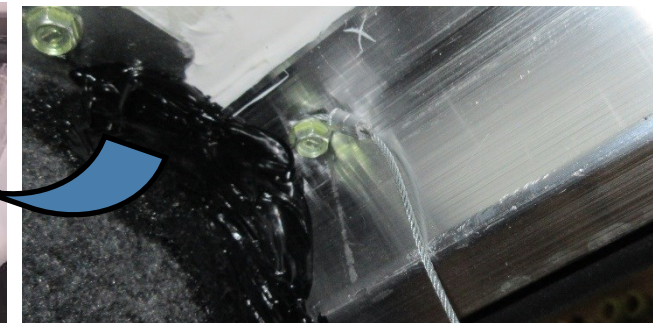Use the 5/16" socket/nut driver to remove the tek screw from the inside floor aluminum rail.

5

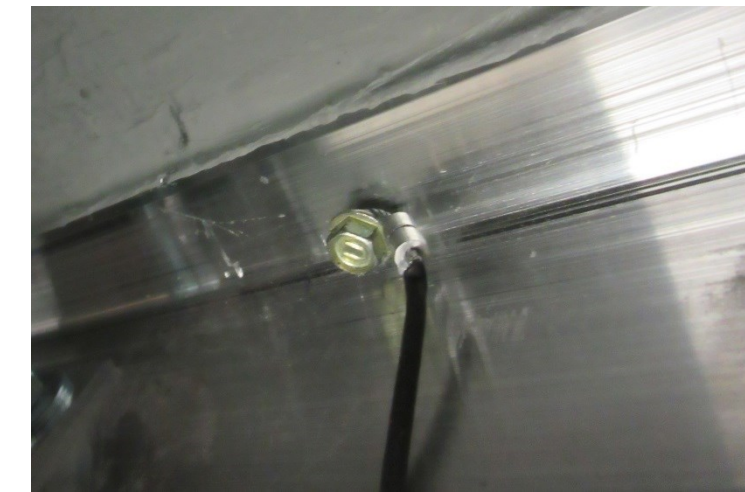

Install the new insulated cable fastening one cable loop to the aluminum floor rail with the 5/16" tek screw back into the same hole.


6



Install the other loop of the insulated cable with the machine screw, washer, and cable loop on the bottom of the door latch and the self locking nut on the top.

Tighten nut on the machine screw.

7



Complete.

8

9