


3335 Susan Street, Suite 100 Costa Mesa, CA 92626 www.agilityfuelsolutions.com

+1 949 236 5520

LETTER TO INTERMEDIATE- AND FINAL-STAGE MANUFACTURERS

* * * IMPORTANT SAFETY RECALL NOTICE* * *

NHTSA Recall 20E019

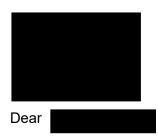

We are writing to inform you that Agility Fuel Solutions LLC (Agility) has determined that a defect relating to motor vehicle safety exists in Agility-supplied compressed natural gas (CNG) fuel systems equipped with certain EMER S.p.A. (EMER) pressure relief devices (PRDs) (EMER Part Numbers PRD2302T-004, PRD2322T-001, PRD2322T-004, PRD2102T, PRD212 and PRD 210OR) and EMER valves that contain EMER PRDs (EMER Part Numbers MARK147-007 and MARK147-008). Agility is conducting a safety recall to address this condition. Our records indicate that some of the affected CNG fuel systems were shipped to you. This recall also includes any of the above-listed PRDs and valves that you may have purchased as service and/or replacement parts.

A copy of Agility's Part 573 Defect Notification is enclosed. This notification was submitted to the National Highway Traffic Safety Administration (NHTSA) on April 8, 2020. An amendment was submitted to NHTSA on April 23, 2020.

What is the issue?

The EMER-supplied thermally activated PRDs and valves identified above and installed on the subject CNG fuel systems may not vent the fuel system as intended when exposed to heat. If a PRD, including a PRD within a valve, does not release, or is slow to release, during a fire on a fuel system, one or more system components may rupture, potentially causing equipment damage and/or personal injury.

What should you do?

For affected fuel systems that remain in your inventory, please call Agility to schedule a repair. For any PRDs and/or valves listed above that you purchased as service or replacement parts, please contact Agility to arrange for return of any new (uninstalled) parts remaining in your inventory for credit.

For fuel systems installed in vehicles that have left your control (including those in which you installed one of the suspect PRDs or valves listed above), we encourage you to make a safety defect determination in accordance with 49 USC 30118 *et seq.* and, as appropriate, to submit a Defect Notification to NHTSA in accordance with 49 CFR Part 573. Agility and its authorized representatives will work with you to arrange owner notifications in accordance with 49 CFR Part 577 and replacement of the potentially defective PRDs on affected vehicles. The defective PRDs will be replaced with PRDs that meet applicable specifications. Installation of the replacement PRDs is expected to take approximately one hour. However, because the CNG fuel system needs to be defueled in order to install the replacement PRDs, each vehicle may need to be available for a longer period of time. We will do our best to minimize the time that the vehicle needs to be available.

Agility aims to have this recall service completed on all affected vehicles as soon as possible and needs your assistance in locating them. Therefore, please provide a copy of this letter and the attached owner letter to your affected customers and send the name, address and VIN information for the affected vehicle(s) to Agility Fuel Solutions at 3335 Susan St. Ste 100, Costa Mesa, CA 92868; Attention: Kurt Nielsen or electronically to support@agilityfs.com. Agility will follow up with owners to arrange the repair. If you were an intermediate-stage manufacturer and do not have VIN or owner contact information, we request that you obtain that information from your customers and forward it to us to follow up.

Federal law prohibits the delivery of affected vehicles or equipment under a sale or lease until the defect has been remedied.

Can we assist further?

Please call Agility at (949) 267-7745 or send us an email at support@agilityfs.com if you have any questions or need further assistance.

We apologize for the inconvenience, but we are taking this step in the interest of our customers' safety and satisfaction with our products. Our commitment, together with that of our authorized service representatives, is to provide you with the highest level of product service and support. Thank you for your attention to this important matter.

Sincerely,

Kurt Nielsen

SVP of Corporate Operations Agility Fuel Solutions LLC

1000

Enclosures: Copy of 573 Defect Notification (Amendment 1)

Owner Notification Letter